

PICTURE 1

**IBM Personal System/2 Adapter/A
for Ethernet Twisted-Pair Networks**

June 1, 1992

This supplement contains a Symptom-to-FRU Index and a parts listing for the IBM Personal System/2 Adapter/A for Ethernet Twisted-Pair Networks. (If you require the Twisted-Pair Option Diskette, order part number 42G0298, form number S42G-0298-00.)

Insert this supplement in the IBM Personal System/2 *Hardware Maintenance Service* manual (part number 15F2200, form number SBOF-3988-00).

IBM and Personal System/2 are trademarks of the International Business Machines Corporation.
| Copyright International Business Machines Corporation 1992. All rights reserved.

Note to U.S. Government users-Documentation related to Restricted rights-Use, duplication, or disclosure is subject to restrictions set forth in GSA ADP Schedule Contract with IBM Corp.

Part Number 42G0352
Form Number S42G-0352-00

1.0 Symptom-to-FRU Index

Error symptoms and the FRUs that might be responsible for the failure are listed below.

Error / Symptom	FRU / Action
06402, 06405, 06406, 06411, 06412, 06416, 06417	Twisted-Pair Adapter/A System Board
06418, 06419, 06420, 06421, 06422, 06423, 06424, 06425	<p>An adapter problem may exist. To verify proper operation of the adapter, do the following:</p> <ol style="list-style-type: none"> 1. Disconnect the network cable from the adapter. 2. Terminate the adapter using one of the following methods: <ul style="list-style-type: none"> <input type="checkbox"/> For an Attachment Unit Interface (AUI) cable connector, install the AUI wrap plug. <input type="checkbox"/> For a Twisted-Pair cable connection, attach the network cable to an isolated hub with no network traffic. 3. Start the advanced diagnostics tests. <p>If the error remains, replace the adapter. If the tests have completed satisfactorily, contact the LAN Administrator for further assistance (a network problem may exist).</p>

Twisted-Pair Adapter/A Parts Listing

2.0 Twisted-Pair Adapter/A Parts Listing

Twisted-Pair Adapter/A	92F0046
Ethernet AUI Wrap Plug	85F0036