

## DRM-1804X Installing on Windows95

---

---

Microsoft's Windows 95 does not have direct support for Pioneer's DRM-1804X. To access the DRM1804X in the Windows 95 operating system, follow the instructions below:

- 1.) Add device driver to the CONFIG.SYS file:  
    <ASPI Manager>  
    C:\PIONEER\DRD18ASP.SYS /D:MSCD000

Note: <ASPI Manager> is dependent on the user's SCSI controller.  
Reference your SCSI controller manufacturer.

Example: Adaptec 1542CF SCSI controller:  
    C:\ADAPTEC\ASP4DOS.SYS  
    C:\PIONEER\DRD18ASP.SYS /D:MSCD000

Note: Future Domain SCSI controller will not need an ASPI manager

Example: Future Domain SCSI controller  
    C:\PIONEER\DRD18FD.SYS /D:MSCD000

- 2.) Add latest MSCDEX to AUTOEXEC.BAT file:

Example:  
    C:\WINDOWS\COMMAND\MSCDEX.EXE /D:MSCD000

- 3.) Add "DRD18ASP.SYS" to the IOS.INI file.
  - a.) goto Windows directory
  - b.) copy IOS.INI file to IOS.ORG
  - c.) Edit IOS.INI file
  - d.) locate the section named "[CDunsafe]" near the bottom of the file.
  - e.) add "DRD18ASP.SYS" name under the "[CDunsafe]" section  
        i.e. [SafeList]  
        ...  
        predir.exe ; Printer redirect  
  
        [CDunsafe]  
        drd18asp.sys ; Pioneer 1804x
  - f.) exit IOS.INI and reboot the computer system