ESCALA Power7

PCI Adapter Placement for M6-700, M6-705, M6-715, M7-700, M7-705 or M7-715



REFERENCE 86 A1 63FF 06

ESCALA Models Reference

The ESCALA Power7 publications concern the following models:

Bull Escala E1-700 / E3-700 Bull Escala E1-705 Bull Escala E1-715 Bull Escala E3-705 Bull Escala E3-705 Bull Escala E2-700 / E2-700T Bull Escala E2-705 / E2-705T Bull Escala E2-715 / E2-715T Bull Escala E4-700 / E4-700T Bull Escala E4-700 / E4-700T Bull Escala E4-705 Bull Escala E4-715 Bull Escala E5-700 Bull Escala E5-715 Bull Escala M5-715 Bull Escala M6-700 Bull Escala M6-705 Bull Escala M6-705 Bull Escala M7-700 Bull Escala M7-700	(31E/2B ,8231-E2B) (31E/1C, 8231-E1C) (31E/1D, 8231-E1D) (31E/2C, 8231-E2C) (31E/2D, 8231-E2D) (02E/4B, 8202-E4B) (02E/4C, 8202-E4C) (02E/4D, 8202-E4D) (05F/6B, 8205-E6B) (05E/6C, 8205-E6C) (05E/6D, 8205-E6D) (33E/8B, 8233-E8B) (08E/8D, 8408-E8D) (09R/MD, 9109-RMD) (17M/MB, 9117-MMB) (17M/MC, 9117-MMC) (17M/MD, 9117-MMD) (79M/HB, 9179-MHB)
Bull Escala M7-705	(79M/HC, 9179-MHC)
Bull Escala M7-715	(79M/HD, 9179-MHD)
Bull Escala H9-700	(19F/HB, 9119-FHB)

References to 8236-E8C models are irrelevant.

Hardware

February 2013

BULL CEDOC 357 AVENUE PATTON B.P.20845 49008 ANGERS CEDEX 01 FRANCE The following copyright notice protects this book under Copyright laws which prohibit such actions as, but not limited to, copying, distributing, modifying, and making derivative works.

Copyright © Bull SAS 2013

Printed in France

Trademarks and Acknowledgements

We acknowledge the rights of the proprietors of the trademarks mentioned in this manual.

All brand names and software and hardware product names are subject to trademark and/or patent protection.

Quoting of brand and product names is for information purposes only and does not represent trademark misuse.

The information in this document is subject to change without notice. Bull will not be liable for errors contained herein, or for incidental or consequential damages in connection with the use of this material.

Contents

afety notices		. \
CI adapter placement for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC	c, or 79M/HD	1
apported PCI adapters for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD		
PCI adapter slot priorities for the 17M/MB, 17M/MC, and 17M/MD		
PCI adapter slot priorities for the 79M/HB, 79M/HC, and 79M/HD		
O expansion units		
PCI slot priorities for the 57/96 expansion unit		. 43
PCI slot priorities for the 58/02 and 58/77 expansion units		. 45
otices		47
ademarks		
ectronic emission notices		
Class A Notices		
Class B Notices		
orms and conditions		

Safety notices

Safety notices may be printed throughout this guide.

- **DANGER** notices call attention to a situation that is potentially lethal or extremely hazardous to people.
- **CAUTION** notices call attention to a situation that is potentially hazardous to people because of some existing condition.
- Attention notices call attention to the possibility of damage to a program, device, system, or data.

World Trade safety information

Several countries require the safety information contained in product publications to be presented in their national languages. If this requirement applies to your country, a safety information booklet is included in the publications package shipped with the product. The booklet contains the safety information in your national language with references to the U.S. English source. Before using a U.S. English publication to install, operate, or service this product, you must first become familiar with the related safety information in the booklet. You should also refer to the booklet any time you do not clearly understand any safety information in the U.S. English publications.

Laser safety information

The servers can use I/O cards or features that are fiber-optic based and that utilize lasers or LEDs.

Laser compliance

The servers may be installed inside or outside of an IT equipment rack.

DANGER

When working on or around the system, observe the following precautions:

Electrical voltage and current from power, telephone, and communication cables are hazardous. To avoid a shock hazard:

- Connect power to this unit only with the provided power cord. Do not use the provided power cord for any other product.
- Do not open or service any power supply assembly.
- · Do not connect or disconnect any cables or perform installation, maintenance, or reconfiguration of this product during an electrical storm.
- The product might be equipped with multiple power cords. To remove all hazardous voltages, disconnect all power cords.
- · Connect all power cords to a properly wired and grounded electrical outlet. Ensure that the outlet supplies proper voltage and phase rotation according to the system rating plate.
- · Connect any equipment that will be attached to this product to properly wired outlets.
- · When possible, use one hand only to connect or disconnect signal cables.
- Never turn on any equipment when there is evidence of fire, water, or structural damage.
- Disconnect the attached power cords, telecommunications systems, networks, and modems before you open the device covers, unless instructed otherwise in the installation and configuration procedures.
- · Connect and disconnect cables as described in the following procedures when installing, moving, or opening covers on this product or attached devices.

To Disconnect:

- 1. Turn off everything (unless instructed otherwise).
- **2.** Remove the power cords from the outlets.
- 3. Remove the signal cables from the connectors.
- 4. Remove all cables from the devices.

To Connect:

- 1. Turn off everything (unless instructed otherwise).
- 2. Attach all cables to the devices.
- 3. Attach the signal cables to the connectors.
- 4. Attach the power cords to the outlets.
- 5. Turn on the devices.

(D005a)

DANGER

Observe the following precautions when working on or around your IT rack system:

- · Heavy equipment-personal injury or equipment damage might result if mishandled.
- Always lower the leveling pads on the rack cabinet.
- Always install stabilizer brackets on the rack cabinet.
- To avoid hazardous conditions due to uneven mechanical loading, always install the heaviest devices in the bottom of the rack cabinet. Always install servers and optional devices starting from the bottom of the rack cabinet.
- Rack-mounted devices are not to be used as shelves or work spaces. Do not place objects on top of rack-mounted devices.



- Each rack cabinet might have more than one power cord. Be sure to disconnect all power cords in the rack cabinet when directed to disconnect power during servicing.
- Connect all devices installed in a rack cabinet to power devices installed in the same rack cabinet. Do not plug a power cord from a device installed in one rack cabinet into a power device installed in a different rack cabinet.
- An electrical outlet that is not correctly wired could place hazardous voltage on the metal parts of the system or the devices that attach to the system. It is the responsibility of the customer to ensure that the outlet is correctly wired and grounded to prevent an electrical shock.

CAUTION

- Do not install a unit in a rack where the internal rack ambient temperatures will exceed the manufacturer's recommended ambient temperature for all your rack-mounted devices.
- Do not install a unit in a rack where the air flow is compromised. Ensure that air flow is not blocked or reduced on any side, front, or back of a unit used for air flow through the unit.
- Consideration should be given to the connection of the equipment to the supply circuit so that overloading of the circuits does not compromise the supply wiring or overcurrent protection. To provide the correct power connection to a rack, refer to the rating labels located on the equipment in the rack to determine the total power requirement of the supply circuit.
- (For sliding drawers.) Do not pull out or install any drawer or feature if the rack stabilizer brackets are not attached to the rack. Do not pull out more than one drawer at a time. The rack might become unstable if you pull out more than one drawer at a time.
- (For fixed drawers.) This drawer is a fixed drawer and must not be moved for servicing unless specified by the manufacturer. Attempting to move the drawer partially or completely out of the rack might cause the rack to become unstable or cause the drawer to fall out of the rack.

(R001)

CAUTION:

Removing components from the upper positions in the rack cabinet improves rack stability during relocation. Follow these general guidelines whenever you relocate a populated rack cabinet within a room or building:

- · Reduce the weight of the rack cabinet by removing equipment starting at the top of the rack cabinet. When possible, restore the rack cabinet to the configuration of the rack cabinet as you received it. If this configuration is not known, you must observe the following precautions:
 - Remove all devices in the 32U position and above.
 - Ensure that the heaviest devices are installed in the bottom of the rack cabinet.
 - Ensure that there are no empty U-levels between devices installed in the rack cabinet below the 32U level.
- If the rack cabinet you are relocating is part of a suite of rack cabinets, detach the rack cabinet from the suite.
- Inspect the route that you plan to take to eliminate potential hazards.
- · Verify that the route that you choose can support the weight of the loaded rack cabinet. Refer to the documentation that comes with your rack cabinet for the weight of a loaded rack cabinet.
- Verify that all door openings are at least 760 x 230 mm (30 x 80 in.).
- Ensure that all devices, shelves, drawers, doors, and cables are secure.
- Ensure that the four leveling pads are raised to their highest position.
- Ensure that there is no stabilizer bracket installed on the rack cabinet during movement.
- Do not use a ramp inclined at more than 10 degrees.
- When the rack cabinet is in the new location, complete the following steps:
 - Lower the four leveling pads.
 - Install stabilizer brackets on the rack cabinet.
 - If you removed any devices from the rack cabinet, repopulate the rack cabinet from the lowest position to the highest position.
- If a long-distance relocation is required, restore the rack cabinet to the configuration of the rack cabinet as you received it. Pack the rack cabinet in the original packaging material, or equivalent. Also lower the leveling pads to raise the casters off of the pallet and bolt the rack cabinet to the pallet.

(R002)


(L001)



(L002)



(L003)

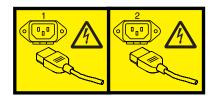

or



All lasers are certified in the U.S. to conform to the requirements of DHHS 21 CFR Subchapter J for class 1 laser products. Outside the U.S., they are certified to be in compliance with IEC 60825 as a class 1 laser product. Consult the label on each part for laser certification numbers and approval information.

CAUTION:

This product might contain one or more of the following devices: CD-ROM drive, DVD-ROM drive, DVD-RAM drive, or laser module, which are Class 1 laser products. Note the following information:

- Do not remove the covers. Removing the covers of the laser product could result in exposure to hazardous laser radiation. There are no serviceable parts inside the device.
- · Use of the controls or adjustments or performance of procedures other than those specified herein might result in hazardous radiation exposure.

(C026)

CAUTION:

Data processing environments can contain equipment transmitting on system links with laser modules that operate at greater than Class 1 power levels. For this reason, never look into the end of an optical fiber cable or open receptacle. (C027)

CAUTION:

This product contains a Class 1M laser. Do not view directly with optical instruments. (C028)

CAUTION:

Some laser products contain an embedded Class 3A or Class 3B laser diode. Note the following information: laser radiation when open. Do not stare into the beam, do not view directly with optical instruments, and avoid direct exposure to the beam. (C030)

CAUTION:

The battery contains lithium. To avoid possible explosion, do not burn or charge the battery.

Do Not:

- ___ Throw or immerse into water
- Heat to more than 100°C (212°F)
- ___ Repair or disassemble

Exchange only with the approved part. Recycle or discard the battery as instructed by local regulations. (C003a)

Power and cabling information for NEBS (Network Equipment-Building System) GR-1089-CORE

The following comments apply to the servers that have been designated as conforming to NEBS (Network Equipment-Building System) GR-1089-CORE:

The equipment is suitable for installation in the following:

- · Network telecommunications facilities
- Locations where the NEC (National Electrical Code) applies

The intrabuilding ports of this equipment are suitable for connection to intrabuilding or unexposed wiring or cabling only. The intrabuilding ports of this equipment *must not* be metallically connected to the interfaces that connect to the OSP (outside plant) or its wiring. These interfaces are designed for use as intrabuilding interfaces only (Type 2 or Type 4 ports as described in GR-1089-CORE) and require isolation from the exposed OSP cabling. The addition of primary protectors is not sufficient protection to connect these interfaces metallically to OSP wiring.

Note: All Ethernet cables must be shielded and grounded at both ends.

The ac-powered system does not require the use of an external surge protection device (SPD).

The dc-powered system employs an isolated DC return (DC-I) design. The DC battery return terminal *shall not* be connected to the chassis or frame ground.

PCI adapter placement for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD

Find information about the Peripheral Component Interconnect (PCI), PCI-X, and PCI Express (PCIe) adapters that are supported for the 7/70 (17M/MB, 17M/MC, or 17M/MD) and the 7/80 (79M/HB, 79M/HC, or 79M/HD) systems that contain the POWER7® processor and the associated I/O expansion units.

The following features are electromagnetic compatibility (EMC) Class B features. See the Class B Notices in the Hardware Notices section.

Table 1. Electromagnetic compatibility (EMC) Class B features

Feature	Description			
1912, 5736	PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter			
1983, 5706	Port 10/100/1000 Base-TX Ethernet PCI-X Adapter			
1986, 5713	1 Gb iSCSI TOE PCI-X Adapter			
2728	4-port USB PCIe Adapter			
4764	PCI-X Cryptographic Coprocessor			
4807	PCIe Cryptographic Coprocessor			
5717	4-port 10/100/1000 Base-TX PCI Express Adapter			
5732	10 Gb Ethernet-CX4 PCI Express Adapter			
5748	POWER® GXT145 PCI Express Graphics Accelerator			
5767	2-port 10/100/1000 Base-TX Ethernet PCI Express Adapter			
5768	2-port Gb Ethernet-SX PCI Express Adapter			
5769	10 Gb Ethernet-SR PCI Express Adapter			
5772	10 Gb Ethernet-LR PCI Express Adapter			
5785	4 Port Async EIA-232 PCIe Adapter			

Supported PCI adapters for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD

Find information about the placement rules and slot priorities for the Peripheral Component Interconnect (PCI), PCI-X, and PCI Express (PCIe) adapters that are supported for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD systems that contain the POWER7 processor and the associated I/O expansion units.

This section provides reference information that information technology (IT) personnel and service representatives can use in determining where to place PCI, PCI-X, and PCIe adapters.

Adapters supported on the AIX®, , or Linux operating system

Table 2 on page 2 and Table 3 on page 8 list adapters supported on the AIX or Linux operating systems. Not all adapters are supported on all operating systems. Exceptions are noted in the Description column.

Important:

• Not all adapters are supported on all system configurations. This document does not replace the latest sales and marketing publications and tools that document supported features.

- Before adding or rearranging adapters, use the System Planning Tool to validate the new adapter configuration. See the add URL here.
- If you are installing a new feature, ensure that you have the software required to support the new feature and determine whether you must install any existing PTF prerequisites. To do this, use the add URL here.

PCI and PCI-X adapters

The following table lists Peripheral Component Interconnect (PCI) and Peripheral Component Interconnect-X (PCI-X) adapters.

Table 2. PCI and PCI-X adapters

System	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB,	2943	3-B	8-port Asynchronous EIA-232E/RS-422A PCI Adapter (FC 2943; CCIN 3-B)
79M/HC, and 79M/HD			• PCI bus
			8 Async ports
			OS support: AIX operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5723	5723	2-port Asynchronous EIA-232 PCI Adapter (FC 5723; CCIN 5723)
79M/HC, and 79M/HD			PCI adapter
			• 2-port EIA-232 asynchronous serial communications
			• 16C850 UART equivalent
			OS support: AIX and Linux operating systems
	5704 or 6239	5704	2 Gb Fibre Channel Tape Controller (FC 5704, 6239; CCIN 5704)
			• Provides attachment to external tape devices
			Extra-high bandwidth
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5716	5716 280B	2 Gb Fibre Channel PCI-X Adapter (FC 5716; CCIN 280B)
			• PCI-X, 64-bit
			High bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5735	577D	8 Gb PCI Express Dual-port Fibre Channel Adapter (FC 5735; CCIN 577D)
79M/HC, and 79M/HD			• Short, x8
			 Extra-high bandwidth: If only one port is planned to be active in normal operation, the adapter is counted as an extra-high bandwidth adapter. If both ports are planned to be active, the adapter must be treated as two extra-high bandwidth adapters.
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5749	576B	4 Gb Dual-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5749; CCIN 576B)
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5758	1910	4 Gb Single-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5758; CCIN 1910)
79M/HC, and 79M/HD			 PCI-X 2.0a, PCI 3.0, PCI-X Mode 2 - 266 MHz, PCI-X Mode 1 - 133 MHz, PCI - 66 MHz
			High-speed data networking
			OS support: AIX and Linux operating systems

Table 2. PCI and PCI-X adapters (continued)

System	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5759	5759	4 Gb Dual-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5759; CCIN 5759)
			• Short, 64-bit, 3.3 V
			High-speed data networking
			Extra-high bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5760 and 5761	280D and 280E	4 Gb Single-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5760, 5761; CCIN 280D, 280E)
79M/HC, and 79M/HD			 PCI-X 2.0a, PCI 3.0, PCI-X Mode 2 - 266 MHz, PCI-X Mode 1 - 133 MHz, PCI - 66 MHz
			High-speed data networking
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	2849	2849	GXT135P Graphics Accelerator with digital support (FC 2849; CCIN 2849)
79M/HC, and 79M/HD			• Short, 32 or 64-bit, 3.3 V
			High bandwidth
			Not hot-pluggable
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC,	2844	2844	PCI IOP (FC 2844, CCIN 2844)
17M/MD, 79M/HB, 79M/HC, and 79M/HD			
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	2847	2847	PCI IOP for SAN Load Source (FC 2847, CCIN 2847)
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5700	5700	IBM Gigabit Ethernet-SX PCI-X Adapter (FC 5700; CCIN 5700)
79M/HC, and 79M/HD			One full-duplex 1000 Base-SX fiber connection to a gigabit Ethernet LAN
			High bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5701	5701	IBM 10/100/1000 Base-TX Ethernet PCI-X Adapter (FC 5701; CCIN 5701)
79M/HC, and 79M/HD			• One full-duplex 10/100/1000 Base-TX UTP connection to a gigabit Ethernet
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5706	5706	2-port 10/100/1000 Base-TX Ethernet PCI-X Adapter (FC 5706; CCIN 5706)
79M/HC, and 79M/HD			• Short, 32-bit or 64-bit, 3.3 V or 5 V
			High bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5707	5706	IBM 2-port Gb Ethernet-SX PCI-X Adapter (FC 5707; CCIN 5706)
79M/HC, and 79M/HD			• Short, 32-bit or 64-bit, 3.3 V or 5 V
			High bandwidth
			OS support: AIX, , and Linux operating system

Table 2. PCI and PCI-X adapters (continued)

System	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5713	573B	1 Gb-TX iSCSI TOE PCI-X Adapter (FC 5713; CCIN 573B) • Short, 32-bit or 64-bit, 3.3 V or 5 V • High bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5714	573C	1 Gb iSCSI TOE PCI-X on Optical Media Adapter (FC 5714; CCIN 573C)
79M/HC, and 79M/HD			• Short, 32-bit or 64-bit, 3.3 V or 5 V
			High bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5721	573A	10 Gb Ethernet-SR PCI-X 2.0 DDR Adapter (FC 5721; CCIN 573A)
79M/HC, and 79M/HD			High bandwidth
			OS support: AIX, , and Linux operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5722	573A	10 Gb Ethernet-LR PCI-X 2.0 DDR Adapter (FC 5722; CCIN 573A)
79M/HC, and 79M/HD			High bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 5740 17M/MD, 79M/HB,	5740	5740 1954	4-port 10/100/1000 Base-TX PCI-X adapter (FC 5740; CCIN 1954)
79M/HC, and 79M/HD			• PCI-X 1.0a
			• Full-height, 64-bit
			High bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 2738	2738	2738 28EF	2-port USB PCI Adapter (FC 2738; CCIN 28EF)
17M/MD, 79M/HB,			Short, 32-bit
79M/HC, and 79M/HD			• 3.3 or 5 V
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC,	4764	4764	PCI-X Cryptographic Coprocessor (FC 4764; CCIN 4764)
17M/MD, 79M/HB,			• Short, 64-bit, 3.3 V
79M/HC, and 79M/HD			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC,	4805	2058	PCI Cryptographic Accelerator (FC 4805; CCIN 2058)
17M/MD, 79M/HB,			• Short, 32-bit, 33 MHz
79M/HC, and 79M/HD			OS support: operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5900	572A	PCI-X DDR Dual-x4 3 Gb SAS Adapter (FC 5900; CCIN 572A)
79M/HC, and 79M/HD			• Short, 64-bit, 3.3 V
			Extra-high bandwidth
			Supports a dual controller mode in a multi-initiator configuration
			OS support: AIX and Linux operating systems

Table 2. PCI and PCI-X adapters (continued)

System	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5902	572B	PCI-X DDR Ext Dual-x4 3 Gb SAS RAID Adapter (FC 5902; CCIN 572B)
			• Long, 64-bit, 3.3 V
			Extra-high bandwidth
			The adapter must be connected and configured in a dual controller mode in a multi-initiator configuration, and this configuration requires that the adapters are installed in pairs.
			This adapter supports disk expansion units. This adapter does not support media expansion units.
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5904	572F and 575C	PCI-X DDR 1.5 GB cache SAS RAID Adapter (FC 5904; CCIN 572F, 575C)
79M/HC, and 79M/HD			• Long, 64-bit, 3.3 V
			Extra-high bandwidth
			No blind-swap cassette
			Double-wide adapter requires two adjacent slots:
			 572F is the CCIN on the SAS controller side of the double-wide adapter.
			 575C is the CCIN on the write-cache side of the double-wide adapter.
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5908	572F, 575C	PCI-X DDR 1.5 GB cache SAS RAID Adapter (FC 5908; CCIN 572F, 575C)
79M/HC, and 79M/HD			• Long, 64-bit, 3.3 V
			Extra-high bandwidth
			Generation 3 blind-swap cassette
			Double-wide adapter requires two adjacent slots:
			 572F is the CCIN on the SAS controller side of the double-wide adapter.
			 575C is the CCIN on the write-cache side of the double-wide adapter.
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5912	572A	PCI-X DDR Dual-x4 3 Gb SAS Adapter (FC 5912; CCIN 572A)
79M/HC, and 79M/HD			• Short, 64-bit, 3.3 V
			Extra-high bandwidth
			Supports a dual controller mode in a multi-initiator configuration
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	1912	571A	PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 1912; CCIN 571A)
79M/HC, and 79M/HD			• Short, 64-bit, 3.3 V
			High bandwidth
			OS support: AIX, , and Linuxoperating systems

Table 2. PCI and PCI-X adapters (continued)

System	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	2757	2757	PCI Ultra RAID Disk Controller (FC 2757; CCIN 2757) • Long, 64-bit • High bandwidth • IOP controlled • The controller must be mirrored to be supported. • This adapter might encounter performance limitations in PCI-X expansion units and systems. • OS support: operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	2780	2780	PCI-X Ultra4 RAID Disk Controller (FC 2780; CCIN 2780) • Long, 64-bit, 133 MHz • High bandwidth • IOP controlled • The controller must be mirrored to be supported. • OS support: operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5580	5708	PCI-X Ultra4 RAID Disk Controller with Auxiliary-write cache IOA (FC 5580; CCIN 2780) • Long, 64-bit, 133 MHz • High bandwidth • IOP controlled auxiliary-write cache • The controller must be mirrored to be supported. • OS support: operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5583	571E	PCI-X Quad-Channel Ultra320 SCSI RAID Adapter (FC 5582, 5583, 5738, 5777; CCIN 571E) PCI-X compliant 64-bit, 3.3 V OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5590	574F	Auxiliary-write cache IOA (FC 5590; CCIN 574F)
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5736	571A	PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 5736; CCIN 571A) • Short, 32-bit or 64-bit, 3.3 V • High bandwidth • OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5776	571B	PCI-X Disk Controller (FC 5776; CCIN 571B) • Long, 64-bit, 266 MHz • Extra-high bandwidth • Dual-mode capable adapter • The controller must be mirrored to be supported • OS support: AIX, , and Linux operating systems

Table 2. PCI and PCI-X adapters (continued)

System	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5777	571F	PCI-X Disk Controller (FC 5777; CCIN 571F) • Long, 64-bit, 266 MHz • Extra-high bandwidth • Dual-mode capable adapter • The controller must be mirrored to be supported • OS support: operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5778	571F	 PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary Write Cache (double-wide) (FC 5778; CCIN 571F) Long, 64-bit, 3.3 V, 266 MHz Dual-mode capable adapter Extra-high bandwidth Double-wide adapter, requires two, adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side is the side with the external SCSI connectors. When used in a logical partition (LPAR) environment, this double-wide adapter must have both slots of the adapter assigned to the same logical partition. When using DLPAR, both slots of the adapter must be managed together. Because of the complexity of this adapter, concurrent maintenance is not supported through the HMC. Concurrent maintenance must be done from the Hardware Service Manager (HSM). OS support: operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	5782	571F and 575B	PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary Write Cache (double-wide) (FC 5782; CCIN 571F and 575B) • Long, 64-bit, 3.3 V, 266 MHz • Dual-mode capable adapter • Extra-high bandwidth • Double-wide adapter, requires two adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side is the side with the external SCSI connectors. • OS support: operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	2947	576C	 ARTIC960Hx 4-port Multiprotocol PCI Adapter (FC 2947) 32-bit PCI Provides 4-ports with different protocols, EIA-232, EIA530, RS-449, X.21, or V.35 OS support: AIX operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	6805	2742	PCI 2-Line WAN IOA (FC 6805; CCIN 2742) • Short, 32-bit, 66 MHz • No IOP • OS support: and Linux operating systems

Table 2. PCI and PCI-X adapters (continued)

System	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	6833	2793	PCI 2-Line WAN with Modem No IOP (FC 6833; CCIN 2793) • Two lines per port WAN with modem adapter • Non-CIM • OS support: and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, and 79M/HD	6834	2793	PCI 2-Line WAN with Modem No IOP CIM (FC 6834; CCIN 2793) • Two lines per port WAN with modem adapter • CIM • OS support: and Linux operating systems

PCle adapters

The following table lists PCIe adapters.

Table 3. PCIe adapters

Supported system	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5289	57D4	PCIe 2-port Async EIA-232 PCIe 1X LPC Adapter (FC 5289; CCIN 57D4)
79M/HC, and 79M/HD			• Short, x1
			• PCIe 1.1
			Two ports through RJ45 by using the DB9 connector
			EIA-232 Compatible
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC,	5785	57D2	4 Port Async EIA-232 PCIe Adapter (FC 5785; CCIN 57D2)
17M/MD, 79M/HB,			• Short, x1
79M/HC, and 79M/HD			OS support: AIX and Linux operating systems
17M/MC, 17M/MD, 79M/HC, and 79M/HD	5729	5729	PCIe2 FH 4-port 8 Gb Fibre Channel Adapter (FC 5729; CCIN 5729)
			• PCIe 2.1, x8
			Full-height, full length adapter with standard-size bracket
			Extra-high bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5773	5773	4 Gb PCI Express Single Port Fibre Channel Adapter (FC 5773; CCIN 5773)
79M/HC, and 79M/HD			• Short, x4
			High bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5774	5774	4 Gb PCI Express Dual-port Fibre Channel Adapter (FC 5774; CCIN 5774)
79M/HC, and 79M/HD			• Short, x4
			Extra-high bandwidth
			OS support: AIX, , and Linux operating systems

Table 3. PCIe adapters (continued)

Supported system	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5748	5774	4 Gb PCI Express Dual-port Fibre Channel Adapter (FC 5774; CCIN 5774)
79M/HC, and 79M/HD			• Short, x4
			Extra-high bandwidth
			OS support: AIX, , and Linux operating systems
17M/MC, 17M/MD,	5287	5287	PCIe2 2-port 10 GbE SR Adapter (FC 5287; CCIN 5287)
79M/HC, and 79M/HD			• Generation 2, x8
			Full-height adapter
			• Two 10 Gb Ethernet ports
			• 10 GBASE- Direct attach SFP+ twinax cable
			OS support: AIX and Linux operating systems
17M/MC, 17M/MD, 79M/HC, and 79M/HD	5288	5288	PCIe2 LP 2-port 10 GbE SFP+ Copper Adapter (FC 5288; CCIN 5288)
			Generation 2, full-height adapter
			• Two 10 Gb Ethernet ports
			Requires available PCIe generation 2 slot
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC,	5708	2B3B	10 Gb FCoE PCIe Dual-port Adapter (FC 5708; CCIN 2B3B)
17M/MD, 79M/HB,			Regular full-height
79M/HC, and 79M/HD			Extra-high bandwidth
			PCIe 2.0 adapter with x8 generation 1
			Convergence enhanced Ethernet (CEE) supported
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5717	5717	4-port 10/100/1000 Base-TX PCI Express Adapter (FC 5717; CCIN 5717)
79M/HC, and 79M/HD			• Short, x4
			High bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5732	2B43	10 Gb Ethernet-CX4 PCI Express Adapter (FC 5732; CCIN 2B43)
79M/HC, and 79M/HD			• Short, x8
			Extra-high bandwidth
			OS support: AIX and Linux operating systems
17M/MC, 17M/MD, 79M/HC, and 79M/HD	5744	2B44	PCIe2 2x10 GbE SR 2x1 GbE UTP Adapter (FC 5744; CCIN 2B44)
			• Short, x8
			Full-height adapter
			Extra-high bandwidth
			PCIe generation 2
			OS support: Linux operating system

Table 3. PCIe adapters (continued)

Supported system	Feature code	CCIN	Description
17M/MC, 17M/MD, 79M/HC, and 79M/HD	5745	2B43	PCIe2 2x10 GbE SFP+ Copper 2x1 GbE UTP Adapter (FC 5745; CCIN 2B43)
			• Short, x8
			• PCIe 2
			Extra-high bandwidth
			OS support: Linux operating system
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5767	5767	2-port 10/100/1000 Base-TX Ethernet PCI Express Adapter (FC 5767; CCIN 5767)
79M/HC, and 79M/HD			• Short, x4
			High bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5768	5768	2-port Gigabit Ethernet-SX PCI Express Adapter (FC 5768; CCIN 5768)
79M/HC, and 79M/HD			• Short, x4
			High bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5769	2B44	10 Gb Ethernet-SR PCI Express Adapter (FC 5769; CCIN 2B44)
79M/HC, and 79M/HD			Short, full-high, x8
			Low-profile capable
			Extra-high bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5772	576E	10 Gb Ethernet-LR PCI Express Adapter (FC 5772; CCIN 576E)
79M/HC, and 79M/HD			• Short, x8
			Low-profile capable
			Extra-high bandwidth
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC,	5899	576F	PCIe2 4-port 1 GbE Adapter (FC 5899; CCIN 576F)
17M/MD, 79M/HB,			Regular-height adapter
79M/HC, and 79M/HD			• PCIe generation 1 or generation 2, x4
			High bandwidth
			• Four-port 1 Gb Ethernet
			OS support: AIX, , and Linux operating systems
17M/MC, 17M/MD, 79M/HC, and 79M/HD	EC28	EC27	PCIe2 2-port 10 GbE RoCE SFP+ adapter (FC EC28; CCIN EC27)
			Regular-height adapter
			• PCIe generation 2, x8
			Extra-high bandwidth, low latency 10 Gb Ethernet
			OS support: AIX and Linux operating systems
			• Firmware level 7.6 or later

Table 3. PCIe adapters (continued)

Supported system	Feature code	CCIN	Description
17M/MC, 17M/MD, 79M/HC, and 79M/HD	EC30	EC29	PCIe2 2-port 10 GbE RoCE SR adapter (FC EC30; CCIN EC29)
			Regular-height adapter
			• PCIe generation 2, x8
			Extra-high bandwidth, low latency 10 Gb Ethernet
			OS support: AIX and Linux operating systems
			• Firmware level 7.6 or later
17M/MB, 17M/MC,	2728	57D1	4-port USB PCIe Adapter (FC 2728; CCIN 57D1)
17M/MD, 79M/HB,			Low-profile adapter
79M/HC, and 79M/HD			Single-slot, half-length PCIe adapter
			• PCIe 1.1
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC,	4808	4765	PCIe Cryptographic Coprocessor (FC 4808; CCIN 4765)
17M/MD, 79M/HB,			Generation 3 blind-swap cassette
79M/HC, and 79M/HD			PCIe x4, full-height, half-length
			OS support: AIX and operating systems
17M/MB, 17M/MC,	4809	4765	PCIe Cryptographic Coprocessor (FC 4809; CCIN 4765)
17M/MD, 79M/HB,			Generation 4 blind-swap cassette
79M/HC, and 79M/HD			PCIe x4, full-height, half-length
			OS support: AIX and operating systems
17M/MC, 17M/MD, 79M/HC, and 79M/HD	5285	58E2	PCIe2 2-port 4X InfiniBand QDR Adapter (FC 5285; CCIN 58E2)
			Generation 2 full-height adapter
			Extra-high bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	2055	57CD	PCIe RAID and SSD SAS Adapter 3 Gb with Blind-Swap Cassette (FC 2055; CCIN 57CD)
79M/HC, and 79M/HD			Low-profile adapter, requires two slots
			• Short, x8
			OS support: AIX, , and Linux operating systems
			VIOS attachment requires version 2.2, or later
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5805	574E	PCIe 380 MB Cache Dual - x4 3 Gb SAS RAID Adapter (FC 5805; CCIN 574E)
79M/HC, and 79M/HD			• Short, dual x4
			SAS RAID adapter
			Installed in pairs
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC,	5901	57B3	PCIe Dual - x4 SAS Adapter (FC 5901; CCIN 57B3)
17M/MD, 79M/HB,			• Short
79M/HC, and 79M/HD			Extra-high bandwidth
			OS support: AIX, , and Linux operating systems

Table 3. PCIe adapters (continued)

Supported system	Feature code	CCIN	Description
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5903	574E	PCIe 380 MB Cache Dual x4 3 Gb SAS RAID Adapter (FC 5903; CCIN 574E)
79M/HC, and 79M/HD			• Short
			Extra-high bandwidth
			Installed in pairs
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5909	57B9	PCI Express x8 Ext Dual-x4 3 Gb SAS Adapter and cable card (FC 5909; CCIN 57B9)
79M/HC, and 79M/HD			Short, 8x, PCIe adapter combined with a cable card assembly
			Extra-high bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5911	57BA	SAS adapter for internal Split DASD option (FC5911; CCIN 57BA)
79M/HC, and 79M/HD			Short, 8x, PCIe adapter combined with a cable card assembly
			Extra-high bandwidth
			OS support: AIX and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	5913	57B5	PCIe2 1.8-GB Cache RAID SAS Tri-port 6 Gb Adapter (FC 5913; CCIN 57B5)
79M/HC, and 79M/HD			• Full-height, short, PCIe2 x8
			Transfer speed of 6 Gbps
			Write cache backup of 1.8 GB
			One PCIe x8 slot per adapter
			Adapters are installed in pairs
			OS support: AIX, , and Linux operating systems
17M/MC, 17M/MD, 79M/HC, and 79M/HD	ESA1	57B4	PCIe2 RAID SAS Adapter Dual-port 6 Gb (FC ESA1; CCIN 57B4)
			Regular-height adapter
			PCIe generation 2, x8
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	2893	576C	PCI Express 2-Line WAN with Modem (FC 2893; CCIN 576C)
79M/HC, and 79M/HD			• Short, x4
			Non-CIM
			OS support: AIX, , and Linux operating systems
17M/MB, 17M/MC, 17M/MD, 79M/HB,	2894	576C	PCI Express 2-Line WAN with Modem (FC 2894; CCIN 576C)
79M/HC, and 79M/HD			• Short, x4
			• CIM
			OS support: AIX, , and Linux operating systems

PCI adapter slot priorities for the 17M/MB, 17M/MC, and 17M/MD

Some adapters must be placed in specific Peripheral Component Interconnect (PCI), Peripheral Component Interconnect-X (PCI-X), or PCI Express (PCIe) slots to function correctly or to perform optimally. Learn how to determine where to install PCI adapters.

PCI slot descriptions

Figure 1 shows the rear view of the system unit with the location codes for the PCI and GX++ adapter slots. Table 4 describes the slots. Each PCI-X DDR or PCIe is a separate PCI host bridge (PHB).

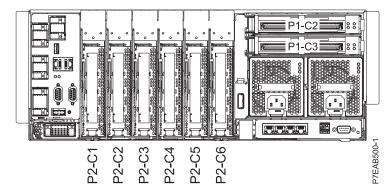


Figure 1. Rear view of enclosure with location codes

Table 1	PCI	clot	Incations	and	descriptions
Iavic 4.	1 01	SIUL	iucaliulis	anu	ucaciibilolia

Slot	Location	Description			РНВ	Slot
	code	17M/MB system	17M/MC system	17M/MD system		size
Slot 1	P2-C1	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB0 module A	Long
Slot 2	P2-C2	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB1 module A	Long
Slot 3	P2-C3	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB2 module A	Long
Slot 4	P2-C4	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB3 module A	Long
Slot 5	P2-C5	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB0 module B	Long
Slot 6	P2-C6	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB1 module B	Long
GX++	P1-C2	Location for GX++ adapter			NA	NA
GX++	P1-C3	Location for GX++ a	adapter		NA	NA

[•] All slots support enhanced error handling (EEH).

PCI and PCI-X expansion units

Each system unit supports up to eight I/O expansion units attached to GX++ adapters. I/O expansion units are required to achieve the maximum number of adapters listed in Table 5 on page 15

[·] The system uses generation-4, blind-swap cassettes to manage the installation and removal of adapters. Cassettes can be installed and removed without removing the drawer from the rack.

Expansion unit 57/96 is supported on the 17M/MB, 17M/MC, and 17M/MD systems that are running AIX or Linux operating system.

Feature code (FC) 1808 (GX++ 12X DDR Dual-port IB Adapter) is supported for the 17M/MB, 17M/MC, and 17M/MD systems.

The 57/96 attaches to a GX++ adapter installed in one of the two GX slots available in each system unit. The limit is four 57/96 I/O drawers attached to each GX adapter.

Note: For optimum performance, you might want to limit the total number of expansion units that contain high bandwidth and extra-high bandwidth adapters. See "Performance notes" on page 25.

The maximum number of attached remote I/O drawers depends on the number processor features configured in the system for 12X Host Channel attached I/O drawers:

- Systems with one processor unit support up to eight 57/96 expansion units, four per GX++ adapter.
- Systems with two processor units support up to sixteen 57/96 expansion units, four per GX++ adapter.
- Systems with three processor units support up to twenty-four 57/96 expansion units, four per GX++ adapter.
- Systems with four processor units support up to thirty-two 57/96 expansion units, four per GX++ adapter.

PCIe expansion units

PCIe expansion unit 58/77 and 58/02 are supported on the system that are running AIX or Linux. The system can be configured to support up to two I/O expansion units per GX adapter.

Restriction: A GX++ adapter that has one or two 58/77 or 58/02 expansion units or one of each 58/77 and 58/02 expansion units connected cannot have anything else connected to that adapter.

Note: For optimum performance, you might want to limit the total number of expansion units that contain high bandwidth and extra-high bandwidth adapters. See "Performance notes" on page 25.

The expansion units attach to a GX++ adapter installed in the GX slots available in the system.

The maximum number of attached remote I/O drawers depends on the number of processor units in the system.

- Systems with one processor unit support up to four 58/02 or 58/77 expansion units, two per GX++ adapter.
- Systems with two processor units support up to eight 58/02 or 58/77 expansion units, two per GX++ adapter.
- Systems with three processor units support up to twelve 58/02 or 58/77 expansion units, two per GX++ adapter.
- Systems with four processor units support up to sixteen 58/02 or 58/77 expansion units, two per GX++ adapter.

Systems with a combination of PCI/PCI-X and PCIe expansion units

A system can have a combination of PCI/PCI-X expansion units (57/96) and PCIe expansion units (58/02 or 58/77). The expansion units cannot be combined on the same GX++ adapter. Following are the limits per each system unit:

- Up to eight 57/96 (PCI/PCI-X) expansion units
- Up to four 58/02 or 58/77 (PCIe) expansion units

• Up to four 57/96 (PCI/PCI-X) expansion units on one GX++ adapter and two 58/02 or 58/77 (PCIe) expansion units on the second GX++ adapter.

PCI and PCI-X adapters

Use this information to identify slot placement priorities and the maximum number of specified adapters allowed. In the following table, adapters are sorted in descending order by priority. Verify whether the adapter is supported for your system. For details about the supported adapters, see "Supported PCI adapters for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD" on page 1.

Table 5. Adapter slot priorities and maximums for PCI and PCI-X adapters

Feature code	Description	Maximum number of adapters supported
2943	8-port Asynchronous EIA-232E/RS-422A PCI Adapter (FC 2943; CCIN 3-B)	192 per system
	• PCI bus	
	8 Async ports	
	OS support: AIX operating system	
5723	2-port Asynchronous EIA-232 PCI Adapter (FC 5723; CCIN 5723)	192 per system
	PCI adapter	
	2-port EIA-232 asynchronous serial communications	
	• 16C850 UART equivalent	
	OS support: AIX and Linux operating systems	
5704 or 6239 ²	2 Gb Fibre Channel Tape Controller (FC 5704, 6239; CCIN 5704)	Supported only in
	Provides attachment to external tape devices	expansion units
	Extra-high bandwidth	
5716 ¹	2 Gb Fibre Channel PCI-X Adapter (FC 5716; CCIN 280B)	192 per system
	• PCI-X, 64-bit	
	High bandwidth	
	OS support: AIX and Linux operating systems	
5735 ²	8 Gb PCI Express Dual-port Fibre Channel Adapter (FC 5735; CCIN 577D)	184 per system
	• Short, x8	
	• Extra-high bandwidth: If only one port is planned to be active in normal operation, the adapter is counted as an extra-high bandwidth adapter. If both ports are planned to be active, the adapter must be treated as two extra-high bandwidth adapters.	
	OS support: AIX, , and Linux operating systems	
5749 ²	4 Gb Dual-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5749; CCIN 576B)	192 per system
5758	4 Gb Single-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5758; CCIN 1910)	192 per system
	• PCI-X 2.0a, PCI 3.0, PCI-X Mode 2 - 266 MHz, PCI-X Mode 1 - 133 MHz, PCI - 66 MHz	
	High-speed data networking	
	OS support: AIX and Linux operating systems	

Table 5. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported
5759 ²	4 Gb Dual-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5759; CCIN 5759)	192 per system
	• Short, 64-bit, 3.3 V	
	High-speed data networking	
	Extra-high bandwidth	
	OS support: AIX and Linux operating systems	
5760 and 5761	4 Gb Single-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5760, 5761; CCIN 280D, 280E)	Supported only in expansion units
	• PCI-X 2.0a, PCI 3.0, PCI-X Mode 2 - 266 MHz, PCI-X Mode 1 - 133 MHz, PCI - 66 MHz	
	High-speed data networking	
	OS support: AIX and Linux operating systems	
2849 ¹	GXT135P Graphics Accelerator with digital support (FC 2849; CCIN 2849)	8 per system
	• Short, 32 or 64-bit, 3.3 V	
	High bandwidth	
	Not hot-pluggable	
	OS support: AIX and Linux operating systems	
2844	PCI IOP (FC 2844, CCIN 2844)	Supported only in expansion units
2847	PCI IOP for SAN Load Source (FC 2847, CCIN 2847)	Supported only in expansion units
5700	IBM Gigabit Ethernet-SX PCI-X Adapter (FC 5700; CCIN 5700)	192 per system
	One full-duplex 1000 Base-SX fiber connection to a gigabit Ethernet LAN	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5701	IBM 10/100/1000 Base-TX Ethernet PCI-X Adapter (FC 5701; CCIN 5701)	192 per system
	One full-duplex 10/100/1000 Base-TX UTP connection to a gigabit Ethernet	
	OS support: AIX, , and Linux operating systems	
5706 ¹	2-port 10/100/1000 Base-TX Ethernet PCI-X Adapter (FC 5706; CCIN 5706)	192 per system
	• Short, 32-bit or 64-bit, 3.3 V or 5 V	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5707 ¹	IBM 2-port Gb Ethernet-SX PCI-X Adapter (FC 5707; CCIN 5706)	Supported only in
-	• Short, 32-bit or 64-bit, 3.3 V or 5 V	expansion units
	High bandwidth	
	OS support: AIX, , and Linux operating system	
5713 ¹	1 Gb-TX iSCSI TOE PCI-X Adapter (FC 5713; CCIN 573B)	192 per system
<i>J</i> 1 10	• Short, 32-bit or 64-bit, 3.3 V or 5 V	172 per system
	High bandwidth	
	OS support: AIX, , and Linux operating systems	

Table 5. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported
5714 ¹	1 Gb iSCSI TOE PCI-X on Optical Media Adapter (FC 5714; CCIN 573C)	192 per system
	• Short, 32-bit or 64-bit, 3.3 V or 5 V	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5721 ¹	10 Gb Ethernet-SR PCI-X 2.0 DDR Adapter (FC 5721; CCIN 573A)	192 per system
	High bandwidth	
	OS support: AIX, , and Linux operating system	
5722 ¹	10 Gb Ethernet-LR PCI-X 2.0 DDR Adapter (FC 5722; CCIN 573A)	192 per system
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5740	4-port 10/100/1000 Base-TX PCI-X adapter (FC 5740; CCIN 1954)	192 per system
	• PCI-X 1.0a	
	• Full-height, 64-bit	
	High bandwidth	
	OS support: AIX and Linux operating systems	
2738	2-port USB PCI Adapter (FC 2738; CCIN 28EF)	192 per system
	• Short, 32-bit	
	• 3.3 or 5 V	
	OS support: AIX and Linux operating systems	
4764	PCI-X Cryptographic Coprocessor (FC 4764; CCIN 4764)	192 per system
	• Short, 64-bit, 3.3 V	
	OS support: AIX, , and Linux operating systems	
4805	PCI Cryptographic Accelerator (FC 4805; CCIN 2058)	Supported only in
	• Short, 32-bit, 33 MHz	expansion units
	OS support: operating system	
5900 ²	PCI-X DDR Dual-x4 3 Gb SAS Adapter (FC 5900; CCIN 572A)	192 per system
	• Short, 64-bit, 3.3 V	
	Extra-high bandwidth	
	Supports a dual controller mode in a multi-initiator configuration	
	OS support: AIX and Linux operating systems	
5902 ²	PCI-X DDR Ext Dual-x4 3 Gb SAS RAID Adapter (FC 5902; CCIN 572B)	192 per system
	• Long, 64-bit, 3.3 V	
	Extra-high bandwidth	
	The adapter must be connected and configured in a dual controller mode in a multi-initiator configuration, and this configuration requires that the adapters are installed in pairs.	
	This adapter supports disk expansion units. This adapter does not support media expansion units.	
	OS support: AIX and Linux operating systems	

Table 5. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Description	Maximum number of adapters supported
PCI-X DDR 1.5 GB cache SAS RAID Adapter (FC 5904; CCIN 572F, 575C)	Supported only in expansion units
• Long, 64-bit, 3.3 V	
Extra-high bandwidth	
No blind-swap cassette	
Double-wide adapter requires two adjacent slots:	
 572F is the CCIN on the SAS controller side of the double-wide adapter. 	
 575C is the CCIN on the write-cache side of the double-wide adapter. 	
OS support: AIX, , and Linux operating systems	
PCI-X DDR 1.5 GB cache SAS RAID Adapter (FC 5908; CCIN 572F, 575C)	64 per system
• Long, 64-bit, 3.3 V	
Extra-high bandwidth	
Generation 3 blind-swap cassette	
Double-wide adapter requires two adjacent slots:	
 572F is the CCIN on the SAS controller side of the double-wide adapter. 	
 575C is the CCIN on the write-cache side of the double-wide adapter. 	
OS support: AIX, , and Linux operating systems	
PCI-X DDR Dual-x4 3 Gb SAS Adapter (FC 5912; CCIN 572A)	192 per system
• Short, 64-bit, 3.3 V	
Extra-high bandwidth	
Supports a dual controller mode in a multi-initiator configuration	
OS support: AIX, , and Linux operating systems	
PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 1912; CCIN 571A)	192 per system
• Short, 64-bit, 3.3 V	
High bandwidth	
OS support: AIX, , and Linuxoperating systems	
	Supported only in
	expansion units
This adapter might encounter performance limitations in PCI-X	
PCI-X Ultra4 RAID Disk Controller (FC 2780; CCIN 2780)	Supported only in
• Long, 64-bit, 133 MHz	expansion units
DOILS OF DIG TOO 1711 12	1 *
High bandwidth	
	 575C) Long, 64-bit, 3.3 V Extra-high bandwidth No blind-swap cassette Double-wide adapter requires two adjacent slots: - 572F is the CCIN on the SAS controller side of the double-wide adapter. - 575C is the CCIN on the write-cache side of the double-wide adapter. OS support: AIX, , and Linux operating systems PCI-X DDR 1.5 GB cache SAS RAID Adapter (FC 5908; CCIN 572F, 575C) Long, 64-bit, 3.3 V Extra-high bandwidth Generation 3 blind-swap cassette Double-wide adapter requires two adjacent slots: - 572F is the CCIN on the SAS controller side of the double-wide adapter. - 575C is the CCIN on the write-cache side of the double-wide adapter. OS support: AIX, , and Linux operating systems PCI-X DDR Dual-x4 3 Gb SAS Adapter (FC 5912; CCIN 572A) Short, 64-bit, 3.3 V Extra-high bandwidth Supports a dual controller mode in a multi-initiator configuration OS support: AIX, , and Linux operating systems PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 1912; CCIN 571A) Short, 64-bit, 3.3 V High bandwidth OS support: AIX, , and Linux operating systems PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 1912; CCIN 571A) Short, 64-bit, 3.3 V High bandwidth OS support: AIX, , and Linux operating systems PCI Ultra RAID Disk Controller (FC 2757; CCIN 2757) Long, 64-bit High bandwidth IOP controlled The controller must be mirrored to be supported.

Table 5. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported
5580 ¹	PCI-X Ultra4 RAID Disk Controller with Auxiliary-write cache IOA (FC 5580; CCIN 2780)	Supported only in expansion units
	• Long, 64-bit, 133 MHz	
	High bandwidth	
	IOP controlled auxiliary-write cache	
	• The controller must be mirrored to be supported.	
	OS support: operating system	
5583	PCI-X Quad-Channel Ultra320 SCSI RAID Adapter (FC 5582, 5583, 5738, 5777; CCIN 571E)	Supported only in expansion units
	PCI-X compliant	
	• 64-bit, 3.3 V	
	OS support: AIX, , and Linux operating systems	
5590	Auxiliary-write cache IOA (FC 5590; CCIN 574F)	Supported only in expansion units
5736 ¹	PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 5736; CCIN 571A)	192 per system
	• Short, 32-bit or 64-bit, 3.3 V	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5776 ²	PCI-X Disk Controller (FC 5776; CCIN 571B)	Supported only in
	• Long, 64-bit, 266 MHz	expansion units
	Extra-high bandwidth	
	Dual-mode capable adapter	
	The controller must be mirrored to be supported	
	OS support: AIX, , and Linux operating systems	
5777 ²	PCI-X Disk Controller (FC 5777; CCIN 571F)	Supported only in
	• Long, 64-bit, 266 MHz	expansion units
	Extra-high bandwidth	
	Dual-mode capable adapter	
	The controller must be mirrored to be supported	
	OS support: operating system	

Table 5. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported
5778 ²	PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary Write Cache (double-wide) (FC 5778; CCIN 571F)	Supported only in expansion units
	• Long, 64-bit, 3.3 V, 266 MHz	
	Dual-mode capable adapter	
	Extra-high bandwidth	
	• Double-wide adapter, requires two, adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side is the side with the external SCSI connectors.	
	 When used in a logical partition (LPAR) environment, this double-wide adapter must have both slots of the adapter assigned to the same logical partition. When using DLPAR, both slots of the adapter must be managed together. 	
	Because of the complexity of this adapter, concurrent maintenance is not supported through the HMC. Concurrent maintenance must be done from the Hardware Service Manager (HSM).	
	OS support: operating system	
5782 ²	PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary Write Cache (double-wide) (FC 5782; CCIN 571F and 575B)	64 per system
	• Long, 64-bit, 3.3 V, 266 MHz	
	Dual-mode capable adapter	
	Extra-high bandwidth	
	• Double-wide adapter, requires two adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side is the side with the external SCSI connectors.	
	OS support: operating system	
2947	ARTIC960Hx 4-port Multiprotocol PCI Adapter (FC 2947)	192 per system
	• 32-bit PCI	
	• Provides 4-ports with different protocols, EIA-232, EIA530, RS-449, X.21, or V.35	
	OS support: AIX operating system	
6805	PCI 2-Line WAN IOA (FC 6805; CCIN 2742)	192 per system
	Short, 32-bit, 66 MHz	
	No IOP	
	OS support: and Linux operating systems	
6833	PCI 2-Line WAN with Modem No IOP (FC 6833; CCIN 2793)	192 per system
	Two lines per port WAN with modem adapter	
	Non-CIM	
	OS support: and Linux operating systems	
6834	PCI 2-Line WAN with Modem No IOP CIM (FC 6834; CCIN 2793)	192 per system
	Two lines per port WAN with modem adapter	
	• CIM	
	OS support: and Linux operating systems	
High bandwidt	h adapter. See the "Performance notes" on page 25 before installing this ad	apter.
Extra-high hand	dwidth adapter. See the "Performance notes" on page 25 before installing th	nis adapter.

PCle adapters

Use this information to identify slot placement priorities and the maximum number of specified adapters allowed. In the following table, adapters are sorted in descending order by priority. Verify whether the adapter is supported for your system. For details about the supported adapters, see "Supported PCI adapters for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD" on page 1.

Table 6. Adapter slot priorities and maximums for PCIe adapters

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
5289	PCIe 2-port Async EIA-232 PCIe 1X LPC Adapter (FC 5289; CCIN 57D4)	1, 5, 2, 6, 3, 4	56 per system
	• Short, x1		
	• PCIe 1.1		
	Two ports through RJ45 by using the DB9 connector		
	• EIA-232 Compatible		
	OS support: AIX and Linux operating systems		
5785	4 Port Async EIA-232 PCIe Adapter (FC 5785; CCIN 57D2)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x1		
	OS support: AIX and Linux operating systems		
5729 ^{2, 4}	PCIe2 FH 4-port 8 Gb Fibre Channel Adapter (FC 5729; CCIN 5729)	1, 5, 2, 6, 3, 4	24 per system
	• PCIe 2.1, x8		
	Full-height, full length adapter with standard-size bracket		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
5773 ¹	4 Gb PCI Express Single Port Fibre Channel Adapter (FC 5773; CCIN 5773)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	High bandwidth		
	OS support: AIX and Linux operating systems		
5774 ²	4 Gb PCI Express Dual-port Fibre Channel Adapter (FC 5774; CCIN 5774)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
5748	POWER GXT145 PCI Express Graphics Accelerator (FC 5748; CCIN 5748)	1, 5, 2, 6, 3, 4	8 per system
	• Short, x1		
	Not hot-pluggable		
	OS support: AIX and Linux operating systems		
5287 ⁴	PCIe2 2-port 10 GbE SR Adapter (FC 5287; CCIN 5287)	1, 5, 2, 6, 3, 4	24 per system
	• Generation 2, x8		
	Full-height adapter		
	Two 10 Gb Ethernet ports		
	• 10 GBASE- Direct attach SFP+ twinax cable		
	OS support: AIX and Linux operating systems		

Table 6. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
52884	PCIe2 LP 2-port 10 GbE SFP+ Copper Adapter (FC 5288; CCIN 5288)	1, 5, 2, 6, 3, 4	24 per system
	Generation 2, full-height adapter		
	Two 10 Gb Ethernet ports		
	Requires available PCIe generation 2 slot		
	OS support: AIX and Linux operating systems		
5708 ²	10 Gb FCoE PCIe Dual-port Adapter (FC 5708; CCIN 2B3B)	1, 5, 2, 6, 3, 4	184 per systemIf only one port is
	Regular full-height		planned to be active
	Extra-high bandwidth		in normal
	PCIe 2.0 adapter with x8 generation 1		operation, the
	Convergence enhanced Ethernet (CEE) supported		adapter is counted as an extra-high
	OS support: AIX, , and Linux operating systems		bandwidth adapter. If both ports are planned to be active, the adapter needs to be treated as two extra-high bandwidth adapters.
5717 ¹	4-port 10/100/1000 Base-TX PCI Express Adapter (FC 5717; CCIN 5717)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	High bandwidth		
	OS support: AIX and Linux operating systems		
5732 ²	10 Gb Ethernet-CX4 PCI Express Adapter (FC 5732; CCIN 2B43)	1, 5, 2, 6, 3, 4	128 per system
	• Short, x8		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
5744 ^{2, 4}	PCIe2 2x10 GbE SR 2x1 GbE UTP Adapter (FC 5744; CCIN 2B44)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x8		
	Full-height adapter		
	Extra-high bandwidth		
	PCIe generation 2		
	OS support: Linux operating system		
5745 ^{2, 4}	PCIe2 2x10 GbE SFP+ Copper 2x1 GbE UTP Adapter (FC 5745; CCIN 2B43)	1, 5, 2, 6, 3, 4	24 per system
	• Short, x8		
	• PCIe 2		
	Extra-high bandwidth		
	OS support: Linux operating system		

Table 6. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
57671	2-port 10/100/1000 Base-TX Ethernet PCI Express Adapter (FC 5767; CCIN 5767)	1, 5, 2, 6, 3, 4	184 per system64 per system for
	• Short, x4		• 64 per system for
	High bandwidth		
	OS support: AIX, , and Linux operating systems		
5768 ¹	2-port Gigabit Ethernet-SX PCI Express Adapter (FC 5768; CCIN 5768)	1, 5, 2, 6, 3, 4	184 per system64 per system for
	• Short, x4		64 per system for
	High bandwidth		
	OS support: AIX, , and Linux operating systems		
5769 ²	10 Gb Ethernet-SR PCI Express Adapter (FC 5769; CCIN 2B44)	1, 5, 2, 6, 3, 4	128 per system
	Short, full-high, x8		
	Low-profile capable		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
5772 ²	10 Gb Ethernet-LR PCI Express Adapter (FC 5772; CCIN 576E)	1, 5, 2, 6, 3, 4	48 per system
	• Short, x8		
	Low-profile capable		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
5899 ^{1, 4}	PCIe2 4-port 1 GbE Adapter (FC 5899; CCIN 576F)	1, 5, 2, 6, 3, 4	184 per system
	Regular-height adapter		
	PCIe generation 1 or generation 2, x4		
	High bandwidth		
	Four-port 1 Gb Ethernet		
	OS support: AIX, , and Linux operating systems		
EC28 ^{2, 4}	PCIe2 2-port 10 GbE RoCE SFP+ adapter (FC EC28; CCIN EC27)	1, 5, 2, 6, 3, 4	24 per system
	Regular-height adapter		
	PCIe generation 2, x8		
	Extra-high bandwidth, low latency 10 Gb Ethernet		
	OS support: AIX and Linux operating systems		
	Firmware level 7.6 or later		
EC30 ^{2, 4}	PCIe2 2-port 10 GbE RoCE SR adapter (FC EC30; CCIN EC29)	1, 5, 2, 6, 3, 4	24 per system
	Regular-height adapter		
	PCIe generation 2, x8		
	Extra-high bandwidth, low latency 10 Gb Ethernet		
	OS support: AIX and Linux operating systems		
	• Firmware level 7.6 or later		

Table 6. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
2728	4-port USB PCIe Adapter (FC 2728; CCIN 57D1)	1, 5, 2, 6, 3, 4	8 per system
	Low-profile adapter		
	Single-slot, half-length PCIe adapter		
	• PCIe 1.1		
	OS support: AIX and Linux operating systems		
4808	PCIe Cryptographic Coprocessor (FC 4808; CCIN 4765)	1, 5, 2, 6, 3, 4	10 per system
	Generation 3 blind-swap cassette		
	PCIe x4, full-height, half-length		
	OS support: AIX and operating systems		
4809	PCIe Cryptographic Coprocessor (FC 4809; CCIN 4765)	1, 5, 2, 6, 3, 4	10 per system
	Generation 4 blind-swap cassette		
	PCIe x4, full-height, half-length		
	OS support: AIX and operating systems		
5285 ^{2, 4}	PCIe2 2-port 4X InfiniBand QDR Adapter (FC 5285; CCIN 58E2)	1, 5	2 per system
	Generation 2 full-height adapter		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
2055	PCIe RAID and SSD SAS Adapter 3 Gb with Blind-Swap Cassette (FC 2055; CCIN 57CD)	1, 5, 2, 6, 3, 4	80 per system
	Low-profile adapter, requires two slots		
	• Short, x8		
	OS support: AIX, , and Linux operating systems		
	VIOS attachment requires version 2.2, or later		
5805	PCIe 380 MB Cache Dual - x4 3 Gb SAS RAID Adapter (FC 5805; CCIN 574E)	1, 5, 2, 6, 3, 4	184 per system
	Short, dual x4		
	SAS RAID adapter		
	Installed in pairs		
	OS support: AIX, , and Linux operating systems		
5901 ²	PCIe Dual - x4 SAS Adapter (FC 5901; CCIN 57B3)	1, 5, 2, 6, 3, 4	184 per system
	• Short		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
5903 ²	PCIe 380 MB Cache Dual x4 3 Gb SAS RAID Adapter (FC 5903; CCIN 574E)	1, 5, 2, 6, 3, 4	184 per system
	• Short		
	Extra-high bandwidth		
	Installed in pairs		
	OS support: AIX and Linux operating systems		

Table 6. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
5909 ²	PCI Express x8 Ext Dual-x4 3 Gb SAS Adapter and cable card (FC 5909; CCIN 57B9)	Supported only in expansion units	
	Short, 8x, PCIe adapter combined with a cable card assembly		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
5911 ²	SAS adapter for internal Split DASD option (FC5911; CCIN 57BA)	Supported only in expansion units	
	Short, 8x, PCIe adapter combined with a cable card assembly		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
5913 ⁴	PCIe2 1.8-GB Cache RAID SAS Tri-port 6 Gb Adapter (FC 5913; CCIN 57B5)	1, 5, 2, 6, 3, 4	136 per system
	• Full-height, short, PCIe2 x8		
	Transfer speed of 6 Gbps		
	Write cache backup of 1.8 GB		
	One PCIe x8 slot per adapter		
	Adapters are installed in pairs		
	OS support: AIX, , and Linux operating systems		
ESA1 ⁴	PCIe2 RAID SAS Adapter Dual-port 6 Gb (FC ESA1; CCIN 57B4)	1, 5, 2, 6, 3, 4	184 per system
	Regular-height adapter		
	PCIe generation 2, x8		
	OS support: AIX, , and Linux operating systems		
2893	PCI Express 2-Line WAN with Modem (FC 2893; CCIN 576C)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	Non-CIM		
	OS support: AIX, , and Linux operating systems		
2894	PCI Express 2-Line WAN with Modem (FC 2894; CCIN 576C)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	• CIM		
	OS support: AIX, , and Linux operating systems		

¹ High-bandwidth adapter. See the "Performance notes" before installing this adapter.

Performance notes

Use the information in this section to help determine the maximum number of adapters that can be placed in a system while still maintaining optimum performance.

²Extra-high bandwidth adapter. See the "Performance notes" before installing this adapter.

³The adapters are spread across the system unit and the slot in this order for the best performance.

 $^{^4}$ PCIe2 adapters must only be installed in generation-2 PCIe slots. The PCIe2 adapters are not supported in the 17M/MB system and 58/02 and 58/77 expansion units.

Performance notes for GX++ adapters and I/O expansion units

Notes:

- Feature code (FC) 1808 (GX++ 12X DDR Dual-port IB adapter) is supported for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD system.
- FC 1914 (GX++ 2-port PCIe2 x8 adapter) is supported for the 17M/MD or 79M/HD system.

When using extra-high bandwidth adapters, follow these guidelines:

- The I/O expansion units must be limited to one expansion unit per GX++ adapter. Do not connect multiple expansion units to the same GX++ adapter.
- When using multiple GX++ adapters on a system with multiple system units, spread the GX++ adapter across the system units. For example, on a system with two system units attached to two FC 58/02 expansion units, use two GX++ adapters, and install one in the P1-C2 slot of one system and then place the second GX++ adapter in P1-C2 slot in the second system (rather than installing both GX++ adapters in one system). Installing of the GX++ adapters in separate systems ensures a better spread of the I/O devices across the systems for best performance.

Table 5 on page 15 and Table 6 on page 21 identify the slot placement priorities and the maximum number of specified adapters allowed for connectivity. However, for optimum performance, you can further limit the total number of high bandwidth and extra-high bandwidth adapters. If you must expand the I/O capacity of the system for extra-high bandwidth adapters, consider attaching high-performance I/O expansion units like the 57/96, 58/02, or 58/77.

The following four tables provide guidelines on the maximum number of high bandwidth and extra-high bandwidth adapters you can use and still maintain optimum performance.

Note: Because of the many types of application workloads, these guidelines cannot cover all cases. The numbers in the following tables are suggestions for single types of adapters that are running exclusively. For systems with mixed adapter types or that have high aggregate bandwidth requirements, consult with a support representative for additional guidelines.

Extra-high bandwidth storage adapters

Table 7. Maximum number of extra-high bandwidth storage adapters for best performance

System configuration	PCIe adapters in system units	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ¹	Adapters in system units plus I/O expansion FC 57/96 ¹	PCIe adapters in 58/02 or 58/77 I/O Expansion units ¹	System maximum ¹
One system unit	6	3	6	4	10
Two system units	12	6	12	8	20
Three system units	18	9	18	12	30
Four system units	24	12	24	16	40

¹If 5708 or 5735 adapters are used in an application with both ports active, each adapter counts as two extra-high bandwidth adapters.

High bandwidth storage adapters

Table 8. Maximum number of high-bandwidth storage adapters for best performance

System configuration	PCIe adapters in system units	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ¹	Adapters in system units plus I/O expansion FC 57/96 ¹		System maximum
One system unit	6	6	12	8	20
Two system units	12	12	24	16	40
Three system units	18	18	36	24	60
Four system units	24	24	48	32	80

[•] For optimum performance, no more than one 10 Gb Ethernet port per two processors must be used in a system. If one 10 Gb Ethernet port is present per POWER7 processor, no other 10 Gb or 1 Gb ports must be used.

Extra-high bandwidth Ethernet adapters

Table 9. Maximum number of extra-high bandwidth Ethernet adapters for best performance

System configuration	PCIe adapters in system units ²	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ¹	Adapters in system units plus I/O expansion FC 57/96 ¹	PCIe adapters in 58/02 or 58/77 I/O Expansion units ¹	
One system unit	2	2	2	2	2
Two system units	4	4	4	4	4
Three system units	6	6	6	6	6
Four system units	8	8	8	8	8

[•] For optimum performance, no more than one 10 Gb Ethernet port per two processors must be used in a system. If one 10 Gb Ethernet port is present per POWER7 processor, no other 10 Gb or 1-Gb ports must be used.

High-bandwidth Ethernet adapters

Table 10. Maximum number of high-bandwidth Ethernet adapters for best performance

System configuration	PCIe adapters in system units	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ¹	Adapters in system units plus I/O expansion FC 57/96 ¹	PCIe adapters in 58/02 or 58/77 I/O Expansion units ¹	System maximum
One system unit	6	6	6	6	8
Two system units	12	12	12	12	16
Three system units	18	18	18	18	24
Four system units	24	24	24	24	32

[•] If 5708 or 5735 adapters are used in an application with both ports active, each adapter counts as two extra-high bandwidth adapters.

[•] If 5708 or 5735 adapters are used in an application with both ports active, each adapter counts as two extra-high bandwidth adapters.

²For best performance, extra-high bandwidth Ethernet adapters must be installed in 58/02 or 58/77 expansion drawers when available, instead of using internal system unit slots.

Table 10. Maximum number of high-bandwidth Ethernet adapters for best performance (continued)

·	PCIe adapters in system units	adapters in I/O	system units plus)
		expansion unit FC 57/96 ¹	I/O expansion FC 57/96 ¹	Expansion units	

For optimum performance, no more than one 10 Gb Ethernet port per two processors must be used in a system. If two 1 Gb Ethernet ports are present per processor, no other 1 Gb or 10-Gb ports must be used.

PCI adapter slot priorities for the 79M/HB, 79M/HC, and 79M/HD

Some adapters must be placed in specific Peripheral Component Interconnect (PCI), Peripheral Component Interconnect-X (PCI-X), or PCI Express (PCIe) slots to function correctly or to perform optimally. Learn how to determine where to install PCI adapters.

PCI slot descriptions

Figure 2 shows the rear view of the system unit with the location codes for the PCI and GX++ adapter slots. Table 11 describes the slots. Each PCI-X DDR or PCIe is a separate PCI host bridge (PHB).

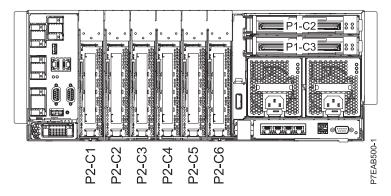


Figure 2. Rear view of enclosure with location codes

Table 11. PCI slot locations and descriptions

Slot	Location		Description		РНВ	Slot
	code 79M/HB system 79M/HC system 79M/HD sy		79M/HD system		size	
Slot 1	P2-C1	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB0 module A	Long
Slot 2	P2-C2	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB1 module A	Long
Slot 3	P2-C3	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB2 module A	Long
Slot 4	P2-C4	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB3 module A	Long
Slot 5	P2-C5	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB0 module B	Long
Slot 6	P2-C6	PCIe x8, generation-1	PCIe x8, generation-2	PCIe x8, generation-2	PCIe PHB1 module B	Long
GX++	P1-C2	Location for GX++	adapter		NA	NA
GX++	P1-C3	Location for GX++	adapter		NA	NA

Table 11. PCI slot locations and descriptions (continued)

Slot	Location		Description		РНВ	Slot
	code	79M/HB system	79M/HC system	79M/HD system		size

- All slots support enhanced error handling (EEH).
- The system uses generation-4, blind-swap cassettes to manage the installation and removal of adapters. Cassettes can be installed and removed without removing the drawer from the rack.

PCI and PCI-X expansion units

Each system supports up to eight I/O expansion units attached to GX++ adapters. I/O expansion units are required to achieve the maximum number of adapters listed in Table 12 on page 30

Expansion unit 57/96 is supported on the 79M/HB, 79M/HC, and 79M/HD systems that are running AIX or Linux operating systems.

Feature code (FC) 1808 (GX++ 12X DDR Dual-port IB Adapter) is supported for the 79M/HB, 79M/HC, and 79M/HD systems.

The 57/96 attaches to a GX++ adapter installed in one of the two GX slots available in each system unit. The limit is four 57/96 I/O drawers attached to each GX++ adapter.

Note: For optimum performance, you can limit the total number of expansion units that contain high bandwidth and extra-high bandwidth adapters. See "Performance notes" on page 41.

The maximum number of attached remote I/O drawers depends on the number processor features configured in the system for 12X Host Channel attached I/O drawers:

- Systems with one processor unit support up to eight 57/96 expansion units, four per GX++ adapter.
- Systems with two processor units support up to sixteen 57/96 expansion units, four per GX++ adapter.
- Systems with three processor units support up to twenty-four 57/96 expansion units, four per GX++ adapter.
- Systems with four processor units support up to thirty-two 57/96 expansion units, four per GX++ adapter.

PCIe expansion units

PCIe expansion unit 58/77 and 58/02 are supported on the system that are running AIX or Linux. The system can be configured to support up to two I/O expansion units per GX adapter.

Restriction: A GX++ adapter that has one or two 58/77 or 58/02 expansion units connected cannot have anything else connected to that adapter.

Note: For optimum performance, you can limit the total number of expansion units that contain high bandwidth and extra-high bandwidth adapters. See "Performance notes" on page 41.

The expansion units attach to a GX++ adapter installed in one or both of the two GX slots available in the system unit.

The maximum number of attached remote I/O drawers depends on the number of processor units in the system.

• Systems with one processor unit support up to four 58/02 or 58/77 expansion units, two per GX++ adapter.

- Systems with two processor units support up to eight 58/02 or 58/77 expansion units, two per GX++ adapter.
- Systems with three processor units support up to twelve 58/02 or 58/77 expansion units, two per GX++ adapter.
- Systems with four processor units support up to sixteen 58/02 or 58/77 expansion units, two per GX++ adapter.

Systems with a combination of PCI/PCI-X and PCIe expansion units

A system can have a combination of PCI/PCI-X expansion units (57/96) and PCIe expansion units (58/02 or 58/77). The expansion units cannot be combined on the same GX++ adapter. Following are the limits per each system unit:

- Up to eight 57/96 (PCI/PCI-X) expansion units
- Up to four 58/02 or 58/77 (PCIe) expansion units
- Up to four 57/96 (PCI/PCI-X) expansion units on one GX++ adapter and two 58/02 or 58/77 (PCIe) expansion units on the second GX++ adapter.

PCI and PCI-X adapters

Use this information to identify slot placement priorities and the maximum number of specified adapters allowed. In the following table, adapters are sorted in descending order by priority. Verify whether the adapter is supported for your system. For details about the supported adapters, see "Supported PCI adapters for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD" on page 1

Table 12. Adapter slot priorities and maximums for PCI and PCI-X adapters

Feature code	Description	Maximum number of adapters supported
2943	8-port Asynchronous EIA-232E/RS-422A PCI Adapter (FC 2943; CCIN 3-B)	192 per system
	• PCI bus	
	8 Async ports	
	OS support: AIX operating system	
5723	2-port Asynchronous EIA-232 PCI Adapter (FC 5723; CCIN 5723)	192 per system
	PCI adapter	
	2-port EIA-232 asynchronous serial communications	
	• 16C850 UART equivalent	
	OS support: AIX and Linux operating systems	
5704 or 6239 ²	2 Gb Fibre Channel Tape Controller (FC 5704, 6239; CCIN 5704)	Supported only in
	Provides attachment to external tape devices	expansion units
	Extra-high bandwidth	
5716 ¹	2 Gb Fibre Channel PCI-X Adapter (FC 5716; CCIN 280B)	192 per system
	• PCI-X, 64-bit	
	High bandwidth	
	OS support: AIX and Linux operating systems	

Table 12. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported
5735 ²	8 Gb PCI Express Dual-port Fibre Channel Adapter (FC 5735; CCIN 577D)	184 per system
	• Short, x8	
	• Extra-high bandwidth: If only one port is planned to be active in normal operation, the adapter is counted as an extra-high bandwidth adapter. If both ports are planned to be active, the adapter must be treated as two extra-high bandwidth adapters.	
	OS support: AIX, , and Linux operating systems	
5749 ²	4 Gb Dual-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5749; CCIN 576B)	192 per system
5758	4 Gb Single-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5758; CCIN 1910)	192 per system
	• PCI-X 2.0a, PCI 3.0, PCI-X Mode 2 - 266 MHz, PCI-X Mode 1 - 133 MHz, PCI - 66 MHz	
	High-speed data networking	
	OS support: AIX and Linux operating systems	
5759 ²	4 Gb Dual-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5759; CCIN 5759)	192 per system
	• Short, 64-bit, 3.3 V	
	High-speed data networking	
	Extra-high bandwidth	
	OS support: AIX and Linux operating systems	
5760 and 5761	4 Gb Single-port Fibre Channel PCI-X 2.0 DDR Adapter (FC 5760, 5761; CCIN 280D, 280E)	Supported only in expansion units
	• PCI-X 2.0a, PCI 3.0, PCI-X Mode 2 - 266 MHz, PCI-X Mode 1 - 133 MHz, PCI - 66 MHz	
	High-speed data networking	
	OS support: AIX and Linux operating systems	
2849 ¹	GXT135P Graphics Accelerator with digital support (FC 2849; CCIN 2849)	8 per system
	• Short, 32 or 64-bit, 3.3 V	
	High bandwidth	
	Not hot-pluggable	
	OS support: AIX and Linux operating systems	
2844	PCI IOP (FC 2844, CCIN 2844)	Supported only in expansion units
2847	PCI IOP for SAN Load Source (FC 2847, CCIN 2847)	Supported only in expansion units
5700	IBM Gigabit Ethernet-SX PCI-X Adapter (FC 5700; CCIN 5700)	192 per system
	One full-duplex 1000 Base-SX fiber connection to a gigabit Ethernet LAN	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	

Table 12. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

5701	IDA 4 0 /4 00 /4 000 D	
	IBM 10/100/1000 Base-TX Ethernet PCI-X Adapter (FC 5701; CCIN 5701)	192 per system
	• One full-duplex 10/100/1000 Base-TX UTP connection to a gigabit Ethernet	
	OS support: AIX, , and Linux operating systems	
5706 ¹	2-port 10/100/1000 Base-TX Ethernet PCI-X Adapter (FC 5706; CCIN 5706)	192 per system
	• Short, 32-bit or 64-bit, 3.3 V or 5 V	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5707 ¹	IBM 2-port Gb Ethernet-SX PCI-X Adapter (FC 5707; CCIN 5706)	Supported only in
	• Short, 32-bit or 64-bit, 3.3 V or 5 V	expansion units
	High bandwidth	
	OS support: AIX, , and Linux operating system	
5713 ¹	1 Gb-TX iSCSI TOE PCI-X Adapter (FC 5713; CCIN 573B)	192 per system
	• Short, 32-bit or 64-bit, 3.3 V or 5 V	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5714 ¹	1 Gb iSCSI TOE PCI-X on Optical Media Adapter (FC 5714; CCIN 573C)	192 per system
	• Short, 32-bit or 64-bit, 3.3 V or 5 V	
	High bandwidth	
	OS support: AIX, , and Linux operating systems	
5721 ¹	10 Gb Ethernet-SR PCI-X 2.0 DDR Adapter (FC 5721; CCIN 573A)	192 per system
	High bandwidth	
	OS support: AIX, , and Linux operating system	
5722 ¹	10 Gb Ethernet-LR PCI-X 2.0 DDR Adapter (FC 5722; CCIN 573A)	192 per system
	High bandwidth	1 7
	OS support: AIX, , and Linux operating systems	
5740	4-port 10/100/1000 Base-TX PCI-X adapter (FC 5740; CCIN 1954)	192 per system
	• PCI-X 1.0a	- For eyesess
	• Full-height, 64-bit	
	High bandwidth	
	OS support: AIX and Linux operating systems	
2738	2-port USB PCI Adapter (FC 2738; CCIN 28EF)	192 per system
-, 55	• Short, 32-bit	is a per system
	• 3.3 or 5 V	
	OS support: AIX and Linux operating systems	
1764	PCI-X Cryptographic Coprocessor (FC 4764; CCIN 4764)	192 per system
	• Short, 64-bit, 3.3 V	1,2 per oyotem
	OS support: AIX, , and Linux operating systems	
4805	PCI Cryptographic Accelerator (FC 4805; CCIN 2058)	Supported only in
1000	Short, 32-bit, 33 MHz	expansion units
	OHOLG OZ-DIG OO WILL	1

Table 12. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported
5900 ²	PCI-X DDR Dual-x4 3 Gb SAS Adapter (FC 5900; CCIN 572A) • Short, 64-bit, 3.3 V	192 per system
	Extra-high bandwidth	
	Supports a dual controller mode in a multi-initiator configuration	
	OS support: AIX and Linux operating systems	
5902 ²	PCI-X DDR Ext Dual-x4 3 Gb SAS RAID Adapter (FC 5902; CCIN 572B)	192 per system
	• Long, 64-bit, 3.3 V	
	Extra-high bandwidth	
	The adapter must be connected and configured in a dual controller mode in a multi-initiator configuration, and this configuration requires that the adapters are installed in pairs.	
	• This adapter supports disk expansion units. This adapter does not support media expansion units.	
	OS support: AIX and Linux operating systems	
5904 ²	PCI-X DDR 1.5 GB cache SAS RAID Adapter (FC 5904; CCIN 572F, 575C)	Supported only in expansion units
	• Long, 64-bit, 3.3 V	
	Extra-high bandwidth	
	No blind-swap cassette	
	Double-wide adapter requires two adjacent slots:	
	 572F is the CCIN on the SAS controller side of the double-wide adapter. 	
	 575C is the CCIN on the write-cache side of the double-wide adapter. 	
	OS support: AIX, , and Linux operating systems	
5908 ²	PCI-X DDR 1.5 GB cache SAS RAID Adapter (FC 5908; CCIN 572F, 575C)	64 per system
	• Long, 64-bit, 3.3 V	
	Extra-high bandwidth	
	Generation 3 blind-swap cassette	
	Double-wide adapter requires two adjacent slots:	
	 572F is the CCIN on the SAS controller side of the double-wide adapter. 	
	 575C is the CCIN on the write-cache side of the double-wide adapter. 	
	OS support: AIX, , and Linux operating systems	
5912 ²	PCI-X DDR Dual-x4 3 Gb SAS Adapter (FC 5912; CCIN 572A)	192 per system
	• Short, 64-bit, 3.3 V	
	Extra-high bandwidth	
	Supports a dual controller mode in a multi-initiator configuration	
	OS support: AIX, , and Linux operating systems	

Table 12. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported	
1912¹	PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 1912; CCIN 571A)	192 per system	
	• Short, 64-bit, 3.3 V		
	High bandwidth		
	OS support: AIX, , and Linuxoperating systems		
2757 ¹	PCI Ultra RAID Disk Controller (FC 2757; CCIN 2757)	Supported only in	
	• Long, 64-bit	expansion units	
	High bandwidth		
	IOP controlled		
	The controller must be mirrored to be supported.		
	This adapter might encounter performance limitations in PCI-X expansion units and systems.		
	OS support: operating system		
2780 ¹	PCI-X Ultra4 RAID Disk Controller (FC 2780; CCIN 2780)	Supported only in	
	• Long, 64-bit, 133 MHz	expansion units	
	High bandwidth		
	IOP controlled		
	The controller must be mirrored to be supported.		
	OS support: operating system		
5580 ¹	PCI-X Ultra4 RAID Disk Controller with Auxiliary-write cache IOA (FC 5580; CCIN 2780)	Supported only in expansion units	
	• Long, 64-bit, 133 MHz		
	High bandwidth		
	IOP controlled auxiliary-write cache		
	The controller must be mirrored to be supported.		
	OS support: operating system		
5583	PCI-X Quad-Channel Ultra320 SCSI RAID Adapter (FC 5582, 5583, 5738, 5777; CCIN 571E)	Supported only in expansion units	
	PCI-X compliant		
	• 64-bit, 3.3 V		
	OS support: AIX, , and Linux operating systems		
5590	Auxiliary-write cache IOA (FC 5590; CCIN 574F)	Supported only in expansion units	
5736 ¹	PCI-X DDR 2.0 Dual Channel Ultra320 SCSI Adapter (FC 5736; CCIN 571A)	192 per system	
	• Short, 32-bit or 64-bit, 3.3 V		
	High bandwidth		
	OS support: AIX, , and Linux operating systems		
5776 ²	PCI-X Disk Controller (FC 5776; CCIN 571B)	Supported only in	
	• Long, 64-bit, 266 MHz	expansion units	
	Extra-high bandwidth		
	Dual-mode capable adapter		
	The controller must be mirrored to be supported		
	OS support: AIX, , and Linux operating systems		

Table 12. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

ture code Description			
PCI-X Disk Controller (FC 5777; CCIN 571F)	Supported only in		
• Long, 64-bit, 266 MHz	expansion units		
Extra-high bandwidth			
Dual-mode capable adapter			
The controller must be mirrored to be supported			
OS support: operating system			
PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary	Supported only in expansion units		
	1		
 Double-wide adapter, requires two, adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side is the side with the external SCSI connectors. 			
 When used in a logical partition (LPAR) environment, this double-wide adapter must have both slots of the adapter assigned to the same logical partition. When using DLPAR, both slots of the adapter must be managed together. 			
• Because of the complexity of this adapter, concurrent maintenance is not supported through the HMC. Concurrent maintenance must be done from the Hardware Service Manager (HSM).			
OS support: operating system			
PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary Write Cache (double-wide) (FC 5782; CCIN 571F and 575B)	64 per system		
• Long, 64-bit, 3.3 V, 266 MHz			
Dual-mode capable adapter			
Extra-high bandwidth			
• Double-wide adapter, requires two adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side is the side with the external SCSI connectors.			
OS support: operating system			
ARTIC960Hx 4-port Multiprotocol PCI Adapter (FC 2947)	192 per system		
• 32-bit PCI			
• Provides 4-ports with different protocols, EIA-232, EIA530, RS-449, X.21, or V.35			
OS support: AIX operating system			
	192 per system		
PCI 2-Line WAN IOA (FC 6805; CCIN 2742)	192 per system		
PCI 2-Line WAN IOA (FC 6805; CCIN 2742) • Short, 32-bit, 66 MHz	192 per system		
PCI 2-Line WAN IOA (FC 6805; CCIN 2742) • Short, 32-bit, 66 MHz • No IOP	192 per system		
PCI 2-Line WAN IOA (FC 6805; CCIN 2742) • Short, 32-bit, 66 MHz • No IOP • OS support: and Linux operating systems	. ,		
PCI 2-Line WAN IOA (FC 6805; CCIN 2742) • Short, 32-bit, 66 MHz • No IOP • OS support: and Linux operating systems PCI 2-Line WAN with Modem No IOP (FC 6833; CCIN 2793)	192 per system 192 per system		
PCI 2-Line WAN IOA (FC 6805; CCIN 2742) • Short, 32-bit, 66 MHz • No IOP • OS support: and Linux operating systems	. ,		
	PCI-X Disk Controller (FC 5777; CCIN 571F) Long, 64-bit, 266 MHz Extra-high bandwidth Dual-mode capable adapter The controller must be mirrored to be supported OS support: operating system PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary Write Cache (double-wide) (FC 5778; CCIN 571F) Long, 64-bit, 3.3 V, 266 MHz Dual-mode capable adapter Extra-high bandwidth Double-wide adapter, requires two, adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side is the side with the external SCSI connectors. When used in a logical partition (LPAR) environment, this double-wide adapter must have both slots of the adapter assigned to the same logical partition. When using DLPAR, both slots of the adapter must be managed together. Because of the complexity of this adapter, concurrent maintenance is not supported through the HMC. Concurrent maintenance must be done from the Hardware Service Manager (HSM). OS support: operating system PCI-X Dual Channel Ultra320 SCSI RAID Adapter with Auxiliary Write Cache (double-wide) (FC 5782; CCIN 571F and 575B) Long, 64-bit, 3.3 V, 266 MHz Dual-mode capable adapter Extra-high bandwidth Double-wide adapter, requires two adjacent slots. The SCSI controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of the adapter pair requires a 64-bit slot. The controller side of		

Table 12. Adapter slot priorities and maximums for PCI and PCI-X adapters (continued)

Feature code	Description	Maximum number of adapters supported
6834	PCI 2-Line WAN with Modem No IOP CIM (FC 6834; CCIN 2793) • Two lines per port WAN with modem adapter • CIM	192 per system
	OS support: and Linux operating systems	

¹High bandwidth adapter. See the "Performance notes" on page 41 before installing this adapter.

PCle adapters

Use this information to identify slot placement priorities and the maximum number of specified adapters allowed. In the following table, adapters are sorted in descending order by priority. Verify whether the adapter is supported for your system. For details about the supported adapters, see "Supported PCI adapters for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD" on page 1

Table 13. Adapter slot priorities and maximums for PCIe adapters

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
5289	PCIe 2-port Async EIA-232 PCIe 1X LPC Adapter (FC 5289; CCIN 57D4)	1, 5, 2, 6, 3, 4	56 per system
	• Short, x1		
	• PCIe 1.1		
	Two ports through RJ45 by using the DB9 connector		
	• EIA-232 Compatible		
	OS support: AIX and Linux operating systems		
5785	4 Port Async EIA-232 PCIe Adapter (FC 5785; CCIN 57D2)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x1		
	OS support: AIX and Linux operating systems		
5729 ^{2, 4}	PCIe2 FH 4-port 8 Gb Fibre Channel Adapter (FC 5729; CCIN 5729)	1, 5, 2, 6, 3, 4	24 per system
	• PCIe 2.1, x8		
	Full-height, full length adapter with standard-size bracket		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
5773 ¹	4 Gb PCI Express Single Port Fibre Channel Adapter (FC 5773; CCIN 5773)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	High bandwidth		
	OS support: AIX and Linux operating systems		
5774 ²	4 Gb PCI Express Dual-port Fibre Channel Adapter (FC 5774; CCIN 5774)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
	+		

²Extra-high bandwidth adapter. See the "Performance notes" on page 41 before installing this adapter.

Table 13. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
5748	POWER GXT145 PCI Express Graphics Accelerator (FC 5748; CCIN 5748)	1, 5, 2, 6, 3, 4	8 per system
	• Short, x1		
	Not hot-pluggable		
	OS support: AIX and Linux operating systems		
5287 ⁴	PCIe2 2-port 10 GbE SR Adapter (FC 5287; CCIN 5287)	1, 5, 2, 6, 3, 4	24 per system
	• Generation 2, x8		
	Full-height adapter		
	Two 10 Gb Ethernet ports		
	• 10 GBASE- Direct attach SFP+ twinax cable		
	OS support: AIX and Linux operating systems		
5288 ⁴	PCIe2 LP 2-port 10 GbE SFP+ Copper Adapter (FC 5288; CCIN 5288)	1, 5, 2, 6, 3, 4	24 per system
	Generation 2, full-height adapter		
	• Two 10 Gb Ethernet ports		
	• Requires available PCIe generation 2 slot		
	OS support: AIX and Linux operating systems		
5708 ²	10 Gb FCoE PCIe Dual-port Adapter (FC 5708; CCIN 2B3B)	1, 5, 2, 6, 3, 4	184 per systemIf only one port is
	Regular full-height		planned to be active
	Extra-high bandwidth		in normal operation,
	PCIe 2.0 adapter with x8 generation 1		the adapter is
	Convergence enhanced Ethernet (CEE) supported		counted as an extra-high
	OS support: AIX, , and Linux operating systems		bandwidth adapter. If both ports are planned to be active, the adapter needs to be treated as two extra-high bandwidth adapters.
5717 ¹	4-port 10/100/1000 Base-TX PCI Express Adapter (FC 5717; CCIN 5717)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	High bandwidth		
	OS support: AIX and Linux operating systems		
5732 ²	10 Gb Ethernet-CX4 PCI Express Adapter (FC 5732; CCIN 2B43)	1, 5, 2, 6, 3, 4	128 per system
	• Short, x8		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		

Table 13. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
5744 ^{2, 4}	PCIe2 2x10 GbE SR 2x1 GbE UTP Adapter (FC 5744; CCIN 2B44)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x8		
	Full-height adapter		
	Extra-high bandwidth		
	PCIe generation 2		
	OS support: Linux operating system		
5745 ^{2, 4}	PCIe2 2x10 GbE SFP+ Copper 2x1 GbE UTP Adapter (FC 5745; CCIN 2B43)	1, 5, 2, 6, 3, 4	24 per system
	• Short, x8		
	• PCIe 2		
	Extra-high bandwidth		
	OS support: Linux operating system		
5767 ¹	2-port 10/100/1000 Base-TX Ethernet PCI Express Adapter (FC 5767; CCIN 5767)	1, 5, 2, 6, 3, 4	184 per system64 per system for
	• Short, x4		04 per system for
	High bandwidth		
	OS support: AIX, , and Linux operating systems		
5768 ¹	2-port Gigabit Ethernet-SX PCI Express Adapter (FC 5768; CCIN 5768)	1, 5, 2, 6, 3, 4	184 per system64 per system for
	• Short, x4		04 per system for
	High bandwidth		
	OS support: AIX, , and Linux operating systems		
5769 ²	10 Gb Ethernet-SR PCI Express Adapter (FC 5769; CCIN 2B44)	1, 5, 2, 6, 3, 4	128 per system
	Short, full-high, x8		
	Low-profile capable		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
5772 ²	10 Gb Ethernet-LR PCI Express Adapter (FC 5772; CCIN 576E)	1, 5, 2, 6, 3, 4	48 per system
	• Short, x8		
	Low-profile capable		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
5899 ^{1, 4}	PCIe2 4-port 1 GbE Adapter (FC 5899; CCIN 576F)	1, 5, 2, 6, 3, 4	184 per system
	Regular-height adapter		
	PCIe generation 1 or generation 2, x4		
	High bandwidth		
	Four-port 1 Gb Ethernet		
	OS support: AIX, , and Linux operating systems		

Table 13. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported	
EC28 ^{2, 4}	PCIe2 2-port 10 GbE RoCE SFP+ adapter (FC EC28; CCIN EC27)	Supported only in the 58/02 and 58/77	24 per system	
	Regular-height adapter	expansion units		
	PCIe generation 2, x8			
	Extra-high bandwidth, low latency 10 Gb Ethernet			
	OS support: AIX and Linux operating systems			
	Firmware level 7.6 or later			
EC30 ^{2, 4}	PCIe2 2-port 10 GbE RoCE SR adapter (FC EC30; CCIN EC29)	1, 5, 2, 6, 3, 4	24 per system	
	Regular-height adapter			
	PCIe generation 2, x8			
	Extra-high bandwidth, low latency 10 Gb Ethernet			
	OS support: AIX and Linux operating systems			
	• Firmware level 7.6 or later			
2728	4-port USB PCIe Adapter (FC 2728; CCIN 57D1)	1, 5, 2, 6, 3, 4	8 per system	
	Low-profile adapter			
	Single-slot, half-length PCIe adapter			
	• PCIe 1.1			
	OS support: AIX and Linux operating systems			
4808	PCIe Cryptographic Coprocessor (FC 4808; CCIN 4765)	1, 5, 2, 6, 3, 4	10 per system	
	Generation 3 blind-swap cassette			
	PCIe x4, full-height, half-length			
	OS support: AIX and operating systems			
4809	PCIe Cryptographic Coprocessor (FC 4809; CCIN 4765)	1, 5, 2, 6, 3, 4	10 per system	
	Generation 4 blind-swap cassette			
	PCIe x4, full-height, half-length			
	OS support: AIX and operating systems			
5285 ^{2, 4}	PCIe2 2-port 4X InfiniBand QDR Adapter (FC 5285; CCIN 58E2)	1, 5	2 per system	
	Generation 2 full-height adapter			
	Extra-high bandwidth			
	OS support: AIX and Linux operating systems			
2055	PCIe RAID and SSD SAS Adapter 3 Gb with Blind-Swap Cassette (FC 2055; CCIN 57CD)	1, 5, 2, 6, 3, 4	80 per system	
	Low-profile adapter, requires two slots			
	• Short, x8			
	OS support: AIX, , and Linux operating systems			
	VIOS attachment requires version 2.2, or later			
5805	PCIe 380 MB Cache Dual - x4 3 Gb SAS RAID Adapter (FC 5805; CCIN 574E)	1, 5, 2, 6, 3, 4	184 per system	
	• Short, dual x4			
	SAS RAID adapter			
	Installed in pairs			
	OS support: AIX, , and Linux operating systems			

Table 13. Adapter slot priorities and maximums for PCIe adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported
5901 ²	PCIe Dual - x4 SAS Adapter (FC 5901; CCIN 57B3)	1, 5, 2, 6, 3, 4	184 per system
	• Short		
	Extra-high bandwidth		
	OS support: AIX, , and Linux operating systems		
5903 ²	PCIe 380 MB Cache Dual x4 3 Gb SAS RAID Adapter (FC 5903; CCIN 574E)	1, 5, 2, 6, 3, 4	184 per system
	• Short		
	Extra-high bandwidth		
	Installed in pairs		
	OS support: AIX and Linux operating systems		
5909 ²	PCI Express x8 Ext Dual-x4 3 Gb SAS Adapter and cable card (FC 5909; CCIN 57B9)	1, 5, 2, 6, 3, 4	Supported only in expansion units
	Short, 8x, PCIe adapter combined with a cable card assembly		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
5911 ²	SAS adapter for internal Split DASD option (FC5911; CCIN 57BA)	1, 5, 2, 6, 3, 4	Supported only in expansion units
	Short, 8x, PCIe adapter combined with a cable card assembly		
	Extra-high bandwidth		
	OS support: AIX and Linux operating systems		
5913 ⁴	PCIe2 1.8-GB Cache RAID SAS Tri-port 6 Gb Adapter (FC 5913; CCIN 57B5)	1, 5, 2, 6, 3, 4	136 per system
	• Full-height, short, PCIe2 x8		
	Transfer speed of 6 Gbps		
	Write cache backup of 1.8 GB		
	One PCIe x8 slot per adapter		
	Adapters are installed in pairs		
	OS support: AIX, , and Linux operating systems		
ESA1 ⁴	PCIe2 RAID SAS Adapter Dual-port 6 Gb (FC ESA1; CCIN 57B4)	1, 5, 2, 6, 3, 4	184 per system
	Regular-height adapter		
	• PCIe generation 2, x8		
	OS support: AIX, , and Linux operating systems		
2893	PCI Express 2-Line WAN with Modem (FC 2893; CCIN 576C)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	Non-CIM		
	OS support: AIX, , and Linux operating systems		
2894	PCI Express 2-Line WAN with Modem (FC 2894; CCIN 576C)	1, 5, 2, 6, 3, 4	184 per system
	• Short, x4		
	• CIM		
	OS support: AIX, , and Linux operating systems		

Table 13. Adapter slot priorities and maximums for PCle adapters (continued)

Feature code	Description	System unit slot priority ³	Maximum number of adapters supported			
¹ High-ba	¹ High-bandwidth adapter. See the "Performance notes" before installing this adapter.					
² Extra-hig	² Extra-high bandwidth adapter. See the "Performance notes" before installing this adapter.					
³ The adap	³ The adapters are spread across the system unit and the slot in this order for the best performance.					
⁴ PCIe2 ad	apters must only be installed in generation-2 PCIe slots. The	e PCIe2 adapters are no	t supported in the			

Performance notes

79M/HB system and 58/02 and 58/77 expansion units.

Use the information in this section to help determine the maximum number of adapters that can be placed in a system while still maintaining optimum performance.

Performance notes for GX++ channel adapters and I/O expansion units

Notes:

- Feature code (FC) 1808 (GX++ 12X DDR Dual-port IB adapter) is supported for the 17M/MB, 17M/MC, 17M/MD, 79M/HB, 79M/HC, or 79M/HD system.
- FC 1914 (GX++ 2-port PCIe2 x8 adapter) is supported for the 17M/MD or 79M/HD system.

When using extra-high bandwidth adapters, follow these guidelines:

- The I/O expansion units must be limited to one expansion unit per GX++ adapter. Do not connect multiple expansion units to the same GX++ adapter.
- When using multiple GX++ adapters on a system with multiple system units, spread the GX++ adapter across the system units. For example, on a system with two system units attached to two FC 58/02 expansion units, use two GX++ adapters, and install one in the P1-C2 slot of one system and then place the second GX++ in P1-C2 slot in the second system (rather than installing both GX++ adapters in one system). Installing of the GX++ adapters in separate systems ensures a better spread of the I/O devices across the systems for best performance.

Table 12 on page 30 and Table 13 on page 36 identify the slot placement priorities and the maximum number of specified adapters allowed for connectivity. However, for optimum performance, you can further limit the total number of high bandwidth and extra-high bandwidth adapters. If you must expand the I/O capacity of the system for extra-high bandwidth adapters, consider attaching high-performance I/O expansion units like the 57/96, 58/02, or 58/77.

The following tables provide guidelines on the maximum number of high bandwidth and extra-high bandwidth adapters you can use and still maintain optimum performance.

Note: Because of the many types of application workloads, these guidelines cannot cover all cases. The numbers in the following tables are suggestions for single types of adapters that are running exclusively. For systems with mixed adapter types or that have high aggregate bandwidth requirements, consult with a support representative for additional guidelines.

Extra-high bandwidth storage adapters

Table 14. Maximum number of extra-high bandwidth storage adapters for best performance

System configuration	PCIe adapters in system units ¹	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ²	Adapters in system units plus I/O expansion FC 57/96 ²	PCIe adapters in 58/02 or 58/77 I/O Expansion units ²	
One system unit	6	3	6	4	10
Two system units	12	6	12	8	20
Three system units	18	9	18	12	30
Four system units	24	12	24	16	40

¹For best performance, extra-high bandwidth Ethernet adapters must be installed in 58/02 or 58/77 expansion drawers when available, instead of using internal system unit slots.

High-bandwidth storage adapters

Table 15. Maximum number of high-bandwidth storage adapters for best performance

System configuration	PCIe adapters in system units	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ¹	Adapters in system units plus I/O expansion FC 57/96 ¹	PCIe adapters in 58/02 or 58/77 I/O Expansion units ¹	
One system unit	6	6	12	8	20
Two system units	12	12	24	16	40
Three system units	18	18	36	24	60
Four system units	24	24	48	32	80

¹

- For optimum performance, no more than one 10 Gb Ethernet port per two processors must be used in a system. If one 10 Gb Ethernet port is present per POWER7 processor, no other 10 Gb or 1-Gb ports must be used.
- If 5708 or 5735 adapters are used in an application with both ports active, each adapter counts as two extra-high bandwidth adapters.

Extra-high bandwidth Ethernet adapters

Table 16. Maximum number of extra-high bandwidth Ethernet adapters for best performance

System configuration	PCIe adapters in system units	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ¹	Adapters in system units plus I/O expansion FC 57/96 ¹	PCIe adapters in 58/02 or 58/77 I/O Expansion units ¹	
One system unit	2	2	2	2	2
Two system units	4	4	4	4	4
Three system units	6	6	6	6	6
Four system units	8	8	8	8	8

²If 5708 or 5735 adapters are used in an application with both ports active, each adapter counts as two extra-high bandwidth adapters.

Table 16. Maximum number of extra-high bandwidth Ethernet adapters for best performance (continued)

		PCI, PCI-X	Adapters in		
		adapters in I/O	system units plus	PCIe adapters in	
System	PCIe adapters in	expansion unit	I/O expansion FC	58/02 or 58/77 I/O	System
configuration	system units	FC 57/96 ¹	57/96 ¹	Expansion units ¹	maximum

1

High bandwidth Ethernet adapters

Table 17. Maximum number of high bandwidth Ethernet adapters for best performance

System configuration	PCIe adapters in system units	PCI, PCI-X adapters in I/O expansion unit FC 57/96 ¹	Adapters in system units plus I/O expansion FC 57/96 ¹	PCIe adapters in 58/02 or 58/77 I/O Expansion units ¹	System maximum
One system unit	6	6	6	6	8
Four processor features, two system units	12	12	12	12	16
Three system units	18	18	18	18	24
Four system units	24	24	24	24	32

¹For optimum performance, no more than two 1 Gb Ethernet ports per processor must be used in a system. If two 1 Gb Ethernet ports are present per processor, no other 1 Gb or 10-Gb ports must be used.

I/O expansion units

Find information about the Peripheral Component Interconnect (PCI), PCI-X, and PCI Express (PCIe) adapters supported in the I/O expansion units that are supported for the systems servers that contain the POWER7 processor.

PCI slot priorities for the 57/96 expansion unit

Find information about the PCI slots in the 57/96 expansion unit.

System description

The 57/96 expansion unit is a 19-inch, rack-mountable, I/O expansion drawer that is designed to be attached to the system unit using the 12X channel bus and 12X cables.

The 57/96 can accommodate six generation 3 blind-swap adapter cassettes. Cassettes can be installed and removed without removing the drawer from the rack.

The following figure shows the rear view of the expansion unit.

[•] For optimum performance, no more than one 10 Gb Ethernet port per two processors must be used in a system. If one 10 Gb Ethernet port is present per POWER7 processor, no other 10 Gb or 1-Gb ports must be used.

[•] If 5708 or 5735 adapters are used in an application with both ports active, each adapter counts as two extra-high bandwidth adapters.

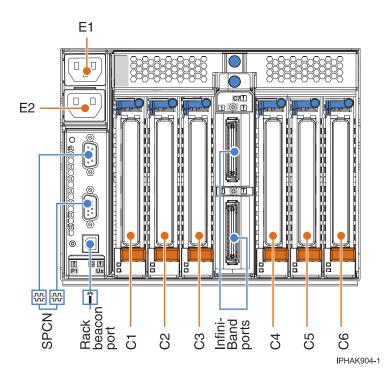


Figure 3. Rear view

Table 18. Location code descriptions. This table describes the location codes that are shown in Figure 3.

Location code	Description
C1, C2, C3, C4, C5, and C6	PCI-X DDR slots. See also "PCI slot descriptions."
C7-T1 and C7-T2	12X Channel remote I/O ports.
C8-T1 and C8-T2	Dual port system power control network (SPCN) connectors.
E1 and E2	Power supply connectors.

PCI slot descriptions

Table 19. Slot properties. This table describes the PCI-X DDR slots.

PHB2 A	РНВЗ А	PHB4 A	PHB1 B	PHB2 B	РНВЗ В
Slot 1	Slot 2	Slot 3	Slot 4	Slot 5	Slot 6
Long	Long	Long	Long	Long	Long
64 bit 3.3V, 266 MHz					
C1	C2	C3	C4	C5	C6

- Each PCI-X DDR slot is a separate PCI host bridge (PHB).
- All slots are compatible with PCI and PCI-X DDR adapters.
- Short adapters can go in long slots.

Slot priorities

Slot priority for all adapters is 1, 4, 2, 5, 3, and 6. For a list of supported adapters, see the placement information for the base system unit to which the expansion unit is attached.

PCI slot priorities for the 58/02 and 58/77 expansion units

Learn about the PCI Express (PCIe) slots in the 58/02 and 58/77 expansion units.

System description

The 58/02 and 58/77 expansion units are 19-inch, rack-mountable, I/O expansion drawers that are designed to be attached to the system using 12X double data rate (DDR) cables.

The expansion units can accommodate 10 generation-3 cassettes. These cassettes can be installed and removed without removing the drawer from the rack. The expansion units do not support I/O processor (IOP) adapters.

Note: PCIe2 adapters that provide extra-high bandwidths are not supported in the 58/02 and 58/77 expansion units.

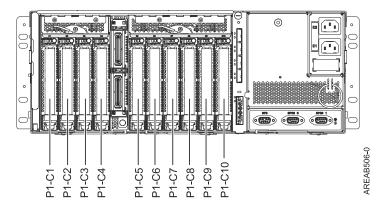


Figure 4. Rear view. This figure shows the rear view of the expansion unit.

Table 20. Location code descriptions. This table describes the location codes that are shown in Figure 4.

Location code	I/O chip	PCI host bridge (PHB)	Description
P1-C1	I/O chip 1	PHB1	PCIe x8 slot
P1-C2		PHB2	
P1-C3		РНВ3	
P1-C4	I/O chip 2	PHB4	
P1-C5		PHB5	
P1-C6		РНВ6	
P1-C7	I/O chip 3	PHB7	
P1-C8		PHB8	
P1-C9		РНВ9	
P1-C10		PHB10	

Slot priority

The slot priority for all adapters is P1-C1, P1-C4, P1-C2, P1-C5, P1-C3, P1-C6, P1-C7, P1-C8, P1-C9, and P1-C10.

There are three I/O chips. Each I/O chip controls three or 4 PCI host bridges (PHBs) and each PCIe slot connects directly to a PHB.

- One I/O chip controls slots P1-C1, P1-C2, and P1-C3.
- A second I/O chip controls slots P1-C4, P1-C5, and P1-C6.
- A third I/O chips controls slots P1-C7, P1-C8, P1-C9, and P1-C10.

For best performance, fill P1-C1, P1-C4, P1-C2, P1-C5, P1-C3, and P1-C6 first with the highest bandwidth adapters. Then fill the remaining slots.

Notices

This information was developed for products and services offered in the U.S.A.

The manufacturer may not offer the products, services, or features discussed in this document in other countries. Consult the manufacturer's representative for information on the products and services currently available in your area. Any reference to the manufacturer's product, program, or service is not intended to state or imply that only that product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any intellectual property right of the manufacturer may be used instead. However, it is the user's responsibility to evaluate and verify the operation of any product, program, or service.

The manufacturer may have patents or pending patent applications covering subject matter described in this document. The furnishing of this document does not grant you any license to these patents. You can send license inquiries, in writing, to the manufacturer.

The following paragraph does not apply to the United Kingdom or any other country where such provisions are inconsistent with local law: THIS PUBLICATION IS PROVIDED "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This information could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. The manufacturer may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time without notice.

Any references in this information to websites not owned by the manufacturer are provided for convenience only and do not in any manner serve as an endorsement of those websites. The materials at those websites are not part of the materials for this product and use of those websites is at your own risk.

The manufacturer may use or distribute any of the information you supply in any way it believes appropriate without incurring any obligation to you.

Any performance data contained herein was determined in a controlled environment. Therefore, the results obtained in other operating environments may vary significantly. Some measurements may have been made on development-level systems and there is no guarantee that these measurements will be the same on generally available systems. Furthermore, some measurements may have been estimated through extrapolation. Actual results may vary. Users of this document should verify the applicable data for their specific environment.

Information concerning products not produced by this manufacturer was obtained from the suppliers of those products, their published announcements or other publicly available sources. This manufacturer has not tested those products and cannot confirm the accuracy of performance, compatibility or any other claims related to products not produced by this manufacturer. Questions on the capabilities of products not produced by this manufacturer should be addressed to the suppliers of those products.

All statements regarding the manufacturer's future direction or intent are subject to change or withdrawal without notice, and represent goals and objectives only.

The manufacturer's prices shown are the manufacturer's suggested retail prices, are current and are subject to change without notice. Dealer prices may vary.

This information is for planning purposes only. The information herein is subject to change before the products described become available.

This information contains examples of data and reports used in daily business operations. To illustrate them as completely as possible, the examples include the names of individuals, companies, brands, and products. All of these names are fictitious and any similarity to the names and addresses used by an actual business enterprise is entirely coincidental.

If you are viewing this information in softcopy, the photographs and color illustrations may not appear.

The drawings and specifications contained herein shall not be reproduced in whole or in part without the written permission of the manufacturer.

The manufacturer has prepared this information for use with the specific machines indicated. The manufacturer makes no representations that it is suitable for any other purpose.

The manufacturer's computer systems contain mechanisms designed to reduce the possibility of undetected data corruption or loss. This risk, however, cannot be eliminated. Users who experience unplanned outages, system failures, power fluctuations or outages, or component failures must verify the accuracy of operations performed and data saved or transmitted by the system at or near the time of the outage or failure. In addition, users must establish procedures to ensure that there is independent data verification before relying on such data in sensitive or critical operations. Users should periodically check the manufacturer's support websites for updated information and fixes applicable to the system and related software.

Homologation statement

This product may not be certified in your country for connection by any means whatsoever to interfaces of public telecommunications networks. Further certification may be required by law prior to making any such connection. Contact an IBM representative or reseller for any questions.

Trademarks

IBM, the IBM logo, and ibm.com are trademarks or registered trademarks of International Business Machines Corp., registered in many jurisdictions worldwide. Other product and service names might be trademarks of IBM or other companies. A current list of IBM trademarks is available on the web at Copyright and trademark information at www.ibm.com/legal/copytrade.shtml.

INFINIBAND, InfiniBand Trade Association, and the INFINIBAND design marks are trademarks and/or service marks of the INFINIBAND Trade Association.

Linux is a registered trademark of Linus Torvalds in the United States, other countries, or both.

Electronic emission notices

When attaching a monitor to the equipment, you must use the designated monitor cable and any interference suppression devices supplied with the monitor.

Class A Notices

The following Class A statements apply to the servers.

Federal Communications Commission (FCC) statement

Note: This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against

harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference, in which case the user will be required to correct the interference at his own expense.

Properly shielded and grounded cables and connectors must be used in order to meet FCC emission limits. IBM is not responsible for any radio or television interference caused by using other than recommended cables and connectors or by unauthorized changes or modifications to this equipment. Unauthorized changes or modifications could void the user's authority to operate the equipment.

This device complies with Part 15 of the FCC rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Industry Canada Compliance Statement

This Class A digital apparatus complies with Canadian ICES-003.

Avis de conformité à la réglementation d'Industrie Canada

Cet appareil numérique de la classe A est conforme à la norme NMB-003 du Canada.

European Community Compliance Statement

This product is in conformity with the protection requirements of EU Council Directive 2004/108/EC on the approximation of the laws of the Member States relating to electromagnetic compatibility. IBM® cannot accept responsibility for any failure to satisfy the protection requirements resulting from a non-recommended modification of the product, including the fitting of non-IBM option cards.

This product has been tested and found to comply with the limits for Class A Information Technology Equipment according to European Standard EN 55022. The limits for Class A equipment were derived for commercial and industrial environments to provide reasonable protection against interference with licensed communication equipment.

European Community contact: IBM Deutschland GmbH Technical Regulations, Department M372 IBM-Allee 1, 71139 Ehningen, Germany Tele: +49 7032 15 2941

email: lugi@de.ibm.com

Warning: This is a Class A product. In a domestic environment, this product may cause radio interference, in which case the user may be required to take adequate measures.

VCCI Statement - Japan

この装置は、クラスA 情報技術装置です。この装置を家庭環境で使用すると電波妨害を引き起こすことがあります。この場合には使用者が適切な対策を講ずるよう要求されることがあります。 VCCI-A

The following is a summary of the VCCI Japanese statement in the box above:

This is a Class A product based on the standard of the VCCI Council. If this equipment is used in a domestic environment, radio interference may occur, in which case, the user may be required to take corrective actions.

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline (products less than or equal to 20 A per phase)

高調波ガイドライン適合品

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline with Modifications (products greater than 20 A per phase)

高調波ガイドライン準用品

Electromagnetic Interference (EMI) Statement - People's Republic of China

声 眀

此为 A 级产品,在生活环境中, 该产品可能会造成无线电干扰, 在这种情况下,可能需要用户对其 干扰采取切实可行的措施.

Declaration: This is a Class A product. In a domestic environment this product may cause radio interference in which case the user may need to perform practical action.

Electromagnetic Interference (EMI) Statement - Taiwan

警告使用者: 這是甲類的資訊產品,在 居住的環境中使用時,可 能會造成射頻干擾,在這 種情況下,使用者會被要 求採取某些適當的對策。

The following is a summary of the EMI Taiwan statement above.

Warning: This is a Class A product. In a domestic environment this product may cause radio interference in which case the user will be required to take adequate measures.

Electromagnetic Interference (EMI) Statement - Korea

이 기기는 업무용(A급)으로 전자파적합기기로 서 판매자 또는 사용자는 이 점을 주의하시기 바라며, 가정외의 지역에서 사용하는 것을 목 적으로 합니다.

Germany Compliance Statement

Deutschsprachiger EU Hinweis: Hinweis für Geräte der Klasse A EU-Richtlinie zur Elektromagnetischen Verträglichkeit

Dieses Produkt entspricht den Schutzanforderungen der EU-Richtlinie 2004/108/EG zur Angleichung der Rechtsvorschriften über die elektromagnetische Verträglichkeit in den EU-Mitgliedsstaaten und hält die Grenzwerte der EN 55022 Klasse A ein.

Um dieses sicherzustellen, sind die Geräte wie in den Handbüchern beschrieben zu installieren und zu betreiben. Des Weiteren dürfen auch nur von der IBM empfohlene Kabel angeschlossen werden. IBM übernimmt keine Verantwortung für die Einhaltung der Schutzanforderungen, wenn das Produkt ohne Zustimmung von IBM verändert bzw. wenn Erweiterungskomponenten von Fremdherstellern ohne Empfehlung von IBM gesteckt/eingebaut werden.

EN 55022 Klasse A Geräte müssen mit folgendem Warnhinweis versehen werden: "Warnung: Dieses ist eine Einrichtung der Klasse A. Diese Einrichtung kann im Wohnbereich Funk-Störungen verursachen; in diesem Fall kann vom Betreiber verlangt werden, angemessene Maßnahmen zu ergreifen und dafür aufzukommen."

Deutschland: Einhaltung des Gesetzes über die elektromagnetische Verträglichkeit von Geräten

Dieses Produkt entspricht dem "Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG)". Dies ist die Umsetzung der EU-Richtlinie 2004/108/EG in der Bundesrepublik Deutschland.

Zulassungsbescheinigung laut dem Deutschen Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG) (bzw. der EMC EG Richtlinie 2004/108/EG) für Geräte der Klasse A

Dieses Gerät ist berechtigt, in Übereinstimmung mit dem Deutschen EMVG das EG-Konformitätszeichen - CE - zu führen.

Verantwortlich für die Einhaltung der EMV Vorschriften ist der Hersteller: International Business Machines Corp. New Orchard Road Armonk, New York 10504 Tel: 914-499-1900

Der verantwortliche Ansprechpartner des Herstellers in der EU ist: IBM Deutschland GmbH Technical Regulations, Abteilung M372 IBM-Allee 1, 71139 Ehningen, Germany Tel: +49 7032 15 2941

Tel: +49 7032 15 2941 email: lugi@de.ibm.com

Generelle Informationen:

Das Gerät erfüllt die Schutzanforderungen nach EN 55024 und EN 55022 Klasse A.

Electromagnetic Interference (EMI) Statement - Russia

ВНИМАНИЕ! Настоящее изделие относится к классу А. В жилых помещениях оно может создавать радиопомехи, для снижения которых необходимы дополнительные меры

Class B Notices

The following Class B statements apply to features designated as electromagnetic compatibility (EMC) Class B in the feature installation information.

Federal Communications Commission (FCC) statement

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation.

This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation.

If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- · Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult an IBM-authorized dealer or service representative for help.

Properly shielded and grounded cables and connectors must be used in order to meet FCC emission limits. Proper cables and connectors are available from IBM-authorized dealers. IBM is not responsible for any radio or television interference caused by unauthorized changes or modifications to this equipment. Unauthorized changes or modifications could void the user's authority to operate this equipment.

This device complies with Part 15 of the FCC rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Industry Canada Compliance Statement

This Class B digital apparatus complies with Canadian ICES-003.

Avis de conformité à la réglementation d'Industrie Canada

Cet appareil numérique de la classe B est conforme à la norme NMB-003 du Canada.

European Community Compliance Statement

This product is in conformity with the protection requirements of EU Council Directive 2004/108/EC on the approximation of the laws of the Member States relating to electromagnetic compatibility. IBM cannot accept responsibility for any failure to satisfy the protection requirements resulting from a non-recommended modification of the product, including the fitting of non-IBM option cards.

This product has been tested and found to comply with the limits for Class B Information Technology Equipment according to European Standard EN 55022. The limits for Class B equipment were derived for typical residential environments to provide reasonable protection against interference with licensed communication equipment.

European Community contact: IBM Deutschland GmbH Technical Regulations, Department M372 IBM-Allee 1, 71139 Ehningen, Germany Tele: +49 7032 15 2941 email: lugi@de.ibm.com

VCCI Statement - Japan

この装置は、クラスB情報技術装置です。この装置は、家庭環境で使用することを目的としていますが、この装置がラジオやテレビジョン受信機に近接して使用されると、受信障害を引き起こすことがあります。 取扱説明書に従って正しい取り扱いをして下さい。 VCCI-B

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline (products less than or equal to 20 A per phase)

高調波ガイドライン適合品

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline with Modifications (products greater than 20 A per phase)

高調波ガイドライン準用品

Electromagnetic Interference (EMI) Statement - Korea

이 기기는 가정용(B급)으로 전자파적합기기로 서 주로 가정에서 사용하는 것을 목적으로 하 며, 모든 지역에서 사용할 수 있습니다.

Germany Compliance Statement

Deutschsprachiger EU Hinweis: Hinweis für Geräte der Klasse B EU-Richtlinie zur Elektromagnetischen Verträglichkeit

Dieses Produkt entspricht den Schutzanforderungen der EU-Richtlinie 2004/108/EG zur Angleichung der Rechtsvorschriften über die elektromagnetische Verträglichkeit in den EU-Mitgliedsstaaten und hält die Grenzwerte der EN 55022 Klasse B ein.

Um dieses sicherzustellen, sind die Geräte wie in den Handbüchern beschrieben zu installieren und zu betreiben. Des Weiteren dürfen auch nur von der IBM empfohlene Kabel angeschlossen werden. IBM übernimmt keine Verantwortung für die Einhaltung der Schutzanforderungen, wenn das Produkt ohne Zustimmung von IBM verändert bzw. wenn Erweiterungskomponenten von Fremdherstellern ohne Empfehlung von IBM gesteckt/eingebaut werden.

Deutschland: Einhaltung des Gesetzes über die elektromagnetische Verträglichkeit von Geräten

Dieses Produkt entspricht dem "Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG)". Dies ist die Umsetzung der EU-Richtlinie 2004/108/EG in der Bundesrepublik Deutschland.

Zulassungsbescheinigung laut dem Deutschen Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG) (bzw. der EMC EG Richtlinie 2004/108/EG) für Geräte der Klasse B

Dieses Gerät ist berechtigt, in Übereinstimmung mit dem Deutschen EMVG das EG-Konformitätszeichen - CE - zu führen.

Verantwortlich für die Einhaltung der EMV Vorschriften ist der Hersteller: International Business Machines Corp. New Orchard Road Armonk, New York 10504

Tel: 914-499-1900

Der verantwortliche Ansprechpartner des Herstellers in der EU ist: IBM Deutschland GmbH Technical Regulations, Abteilung M372 IBM-Allee 1, 71139 Ehningen, Germany

Tel: +49 7032 15 2941 email: lugi@de.ibm.com

Generelle Informationen:

Das Gerät erfüllt die Schutzanforderungen nach EN 55024 und EN 55022 Klasse B.

Terms and conditions

Permissions for the use of these publications are granted subject to the following terms and conditions.

Applicability: These terms and conditions are in addition to any terms of use for the manufacturer website.

Personal Use: You may reproduce these publications for your personal, noncommercial use provided that all proprietary notices are preserved. You may not distribute, display or make derivative works of these publications, or any portion thereof, without the express consent of the manufacturer.

Commercial Use: You may reproduce, distribute and display these publications solely within your enterprise provided that all proprietary notices are preserved. You may not make derivative works of these publications, or reproduce, distribute or display these publications or any portion thereof outside your enterprise, without the express consent of the manufacturer.

Rights: Except as expressly granted in this permission, no other permissions, licenses or rights are granted, either express or implied, to the Publications or any information, data, software or other intellectual property contained therein.

The manufacturer reserves the right to withdraw the permissions granted herein whenever, in its discretion, the use of the publications is detrimental to its interest or, as determined by the manufacturer, the above instructions are not being properly followed.

You may not download, export or re-export this information except in full compliance with all applicable laws and regulations, including all United States export laws and regulations.

THE MANUFACTURER MAKES NO GUARANTEE ABOUT THE CONTENT OF THESE PUBLICATIONS. THE PUBLICATIONS ARE PROVIDED "AS-IS" AND WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO IMPLIED WARRANTIES OF MERCHANTABILITY, NON-INFRINGEMENT, AND FITNESS FOR A PARTICULAR PURPOSE.

Printed in USA