

Service Request Numbers

ESCALA Power7



REFERENCE
86 A1 46FF 03

ESCALA Power7

Service Request Numbers

The ESCALA Power7 publications concern the following models:

- Bull Escala E5-700 (Power 750 / 8233-E8B)
- Bull Escala M6-700 (Power 770 / 9117-MMB)
- Bull Escala M6-705 (Power 770 / 9117-MMC)
- Bull Escala M7-700 (Power 780 / 9179-MHB)
- Bull Escala M7-705 (Power 780 / 9179-MHC)
- Bull Escala E1-700 (Power 710 / 8231-E2B)
- Bull Escala E1-705 (Power 710 / 8231-E1C)
- Bull Escala E2-700 / E2-700T (Power 720 / 8202-E4B)
- Bull Escala E2-705 / E2-705T (Power 720 / 8202-E4C)
- Bull Escala E3-700 (Power 730 / 8231-E2B)
- Bull Escala E3-705 (Power 730 / 8231-E2C)
- Bull Escala E4-700 / E4-700T (Power 740 / 8205-E6B)
- Bull Escala E4-705 (Power 740 / 8205-E6C)

References to Power 755 / 8236-E8C models are irrelevant.

Hardware

October 2011

BULL CEDOC
357 AVENUE PATTON
B.P.20845
49008 ANGERS CEDEX 01
FRANCE

REFERENCE
86 A1 46FF 03

The following copyright notice protects this book under Copyright laws which prohibit such actions as, but not limited to, copying, distributing, modifying, and making derivative works.

Copyright © Bull SAS 2011

Printed in France

Suggestions and criticisms concerning the form, content, and presentation of this book are invited. A form is provided at the end of this book for this purpose.

To order additional copies of this book or other Bull Technical Publications, you are invited to use the Ordering Form also provided at the end of this book.

Trademarks and Acknowledgements

We acknowledge the right of proprietors of trademarks mentioned in this book.

The information in this document is subject to change without notice. Bull will not be liable for errors contained herein, or for incidental or consequential damages in connection with the use of this material.

Contents

Safety notices	v	Trademarks	986
Service request numbers	1	Electronic emission notices	986
SRNs	1	Class A Notices.	987
		Class B Notices.	990
Notices	985	Terms and conditions.	993

Safety notices

Safety notices may be printed throughout this guide:

- **DANGER** notices call attention to a situation that is potentially lethal or extremely hazardous to people.
- **CAUTION** notices call attention to a situation that is potentially hazardous to people because of some existing condition.
- **Attention** notices call attention to the possibility of damage to a program, device, system, or data.

World Trade safety information

Several countries require the safety information contained in product publications to be presented in their national languages. If this requirement applies to your country, a safety information booklet is included in the publications package shipped with the product. The booklet contains the safety information in your national language with references to the U.S. English source. Before using a U.S. English publication to install, operate, or service this product, you must first become familiar with the related safety information in the booklet. You should also refer to the booklet any time you do not clearly understand any safety information in the U.S. English publications.

German safety information

Das Produkt ist nicht für den Einsatz an Bildschirmarbeitsplätzen im Sinne § 2 der Bildschirmarbeitsverordnung geeignet.

Laser safety information

IBM® servers can use I/O cards or features that are fiber-optic based and that utilize lasers or LEDs.

Laser compliance

IBM servers may be installed inside or outside of an IT equipment rack.

DANGER

When working on or around the system, observe the following precautions:

Electrical voltage and current from power, telephone, and communication cables are hazardous. To avoid a shock hazard:

- Connect power to this unit only with the IBM provided power cord. Do not use the IBM provided power cord for any other product.
- Do not open or service any power supply assembly.
- Do not connect or disconnect any cables or perform installation, maintenance, or reconfiguration of this product during an electrical storm.
- The product might be equipped with multiple power cords. To remove all hazardous voltages, disconnect all power cords.
- Connect all power cords to a properly wired and grounded electrical outlet. Ensure that the outlet supplies proper voltage and phase rotation according to the system rating plate.
- Connect any equipment that will be attached to this product to properly wired outlets.
- When possible, use one hand only to connect or disconnect signal cables.
- Never turn on any equipment when there is evidence of fire, water, or structural damage.
- Disconnect the attached power cords, telecommunications systems, networks, and modems before you open the device covers, unless instructed otherwise in the installation and configuration procedures.
- Connect and disconnect cables as described in the following procedures when installing, moving, or opening covers on this product or attached devices.

To Disconnect:

1. Turn off everything (unless instructed otherwise).
2. Remove the power cords from the outlets.
3. Remove the signal cables from the connectors.
4. Remove all cables from the devices

To Connect:

1. Turn off everything (unless instructed otherwise).
2. Attach all cables to the devices.
3. Attach the signal cables to the connectors.
4. Attach the power cords to the outlets.
5. Turn on the devices.

(D005)

DANGER

Observe the following precautions when working on or around your IT rack system:

- Heavy equipment—personal injury or equipment damage might result if mishandled.
- Always lower the leveling pads on the rack cabinet.
- Always install stabilizer brackets on the rack cabinet.
- To avoid hazardous conditions due to uneven mechanical loading, always install the heaviest devices in the bottom of the rack cabinet. Always install servers and optional devices starting from the bottom of the rack cabinet.
- Rack-mounted devices are not to be used as shelves or work spaces. Do not place objects on top of rack-mounted devices.



- Each rack cabinet might have more than one power cord. Be sure to disconnect all power cords in the rack cabinet when directed to disconnect power during servicing.
- Connect all devices installed in a rack cabinet to power devices installed in the same rack cabinet. Do not plug a power cord from a device installed in one rack cabinet into a power device installed in a different rack cabinet.
- An electrical outlet that is not correctly wired could place hazardous voltage on the metal parts of the system or the devices that attach to the system. It is the responsibility of the customer to ensure that the outlet is correctly wired and grounded to prevent an electrical shock.

CAUTION

- Do not install a unit in a rack where the internal rack ambient temperatures will exceed the manufacturer's recommended ambient temperature for all your rack-mounted devices.
- Do not install a unit in a rack where the air flow is compromised. Ensure that air flow is not blocked or reduced on any side, front, or back of a unit used for air flow through the unit.
- Consideration should be given to the connection of the equipment to the supply circuit so that overloading of the circuits does not compromise the supply wiring or overcurrent protection. To provide the correct power connection to a rack, refer to the rating labels located on the equipment in the rack to determine the total power requirement of the supply circuit.
- *(For sliding drawers.)* Do not pull out or install any drawer or feature if the rack stabilizer brackets are not attached to the rack. Do not pull out more than one drawer at a time. The rack might become unstable if you pull out more than one drawer at a time.
- *(For fixed drawers.)* This drawer is a fixed drawer and must not be moved for servicing unless specified by the manufacturer. Attempting to move the drawer partially or completely out of the rack might cause the rack to become unstable or cause the drawer to fall out of the rack.

(R001)

CAUTION:

Removing components from the upper positions in the rack cabinet improves rack stability during relocation. Follow these general guidelines whenever you relocate a populated rack cabinet within a room or building:

- Reduce the weight of the rack cabinet by removing equipment starting at the top of the rack cabinet. When possible, restore the rack cabinet to the configuration of the rack cabinet as you received it. If this configuration is not known, you must observe the following precautions:
 - Remove all devices in the 32U position and above.
 - Ensure that the heaviest devices are installed in the bottom of the rack cabinet.
 - Ensure that there are no empty U-levels between devices installed in the rack cabinet below the 32U level.
- If the rack cabinet you are relocating is part of a suite of rack cabinets, detach the rack cabinet from the suite.
- Inspect the route that you plan to take to eliminate potential hazards.
- Verify that the route that you choose can support the weight of the loaded rack cabinet. Refer to the documentation that comes with your rack cabinet for the weight of a loaded rack cabinet.
- Verify that all door openings are at least 760 x 230 mm (30 x 80 in.).
- Ensure that all devices, shelves, drawers, doors, and cables are secure.
- Ensure that the four leveling pads are raised to their highest position.
- Ensure that there is no stabilizer bracket installed on the rack cabinet during movement.
- Do not use a ramp inclined at more than 10 degrees.
- When the rack cabinet is in the new location, complete the following steps:
 - Lower the four leveling pads.
 - Install stabilizer brackets on the rack cabinet.
 - If you removed any devices from the rack cabinet, repopulate the rack cabinet from the lowest position to the highest position.
- If a long-distance relocation is required, restore the rack cabinet to the configuration of the rack cabinet as you received it. Pack the rack cabinet in the original packaging material, or equivalent. Also lower the leveling pads to raise the casters off of the pallet and bolt the rack cabinet to the pallet.

(R002)


(L001)



(L002)



(L003)

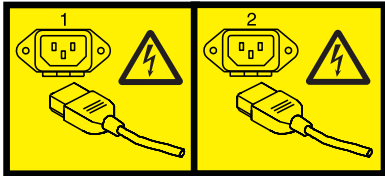

or



All lasers are certified in the U.S. to conform to the requirements of DHHS 21 CFR Subchapter J for class 1 laser products. Outside the U.S., they are certified to be in compliance with IEC 60825 as a class 1 laser product. Consult the label on each part for laser certification numbers and approval information.

CAUTION:

This product might contain one or more of the following devices: CD-ROM drive, DVD-ROM drive, DVD-RAM drive, or laser module, which are Class 1 laser products. Note the following information:

- Do not remove the covers. Removing the covers of the laser product could result in exposure to hazardous laser radiation. There are no serviceable parts inside the device.
- Use of the controls or adjustments or performance of procedures other than those specified herein might result in hazardous radiation exposure.

(C026)

CAUTION:

Data processing environments can contain equipment transmitting on system links with laser modules that operate at greater than Class 1 power levels. For this reason, never look into the end of an optical fiber cable or open receptacle. (C027)

CAUTION:

This product contains a Class 1M laser. Do not view directly with optical instruments. (C028)

CAUTION:

Some laser products contain an embedded Class 3A or Class 3B laser diode. Note the following information: laser radiation when open. Do not stare into the beam, do not view directly with optical instruments, and avoid direct exposure to the beam. (C030)

CAUTION:

The battery contains lithium. To avoid possible explosion, do not burn or charge the battery.

Do Not:

- ___ Throw or immerse into water
- ___ Heat to more than 100°C (212°F)
- ___ Repair or disassemble

Exchange only with the IBM-approved part. Recycle or discard the battery as instructed by local regulations. In the United States, IBM has a process for the collection of this battery. For information, call 1-800-426-4333. Have the IBM part number for the battery unit available when you call. (C003)

Power and cabling information for NEBS (Network Equipment-Building System) GR-1089-CORE

The following comments apply to the IBM servers that have been designated as conforming to NEBS (Network Equipment-Building System) GR-1089-CORE:

The equipment is suitable for installation in the following:

- Network telecommunications facilities
- Locations where the NEC (National Electrical Code) applies

The intrabuilding ports of this equipment are suitable for connection to intrabuilding or unexposed wiring or cabling only. The intrabuilding ports of this equipment *must not* be metallically connected to the interfaces that connect to the OSP (outside plant) or its wiring. These interfaces are designed for use as intrabuilding interfaces only (Type 2 or Type 4 ports as described in GR-1089-CORE) and require isolation from the exposed OSP cabling. The addition of primary protectors is not sufficient protection to connect these interfaces metallically to OSP wiring.

Note: All Ethernet cables must be shielded and grounded at both ends.

The ac-powered system does not require the use of an external surge protection device (SPD).

The dc-powered system employs an isolated DC return (DC-I) design. The DC battery return terminal *shall not* be connected to the chassis or frame ground.

Service request numbers

Service request numbers (SRNs) serve as diagnostic aids to help users determine the source of a hardware problem. Diagnostic applications report problems by using SRNs. The SRN identifies the component that detected the error code and describes the error condition. Use this publication to identify a list of possible failing items and to find information about any additional isolation procedures.

Service request number formats

If your System reference code (SRC) is a 5-digit hexadecimal number or contains a hyphen in the following formats (xxxxx, xxx-xxx, xxx-xxxx, xxxx-xxx, xxxx-xxxx), it is an SRN.

Using Service request numbers

The SRN tables use the following format:

- The Service Request Number (SRN) contains numbers that represent specific failures of specific functions.
- SRNs contain Failing Function Codes (FFCs). The FFC represents field replaceable units (FRUs) of the system unit. When available, the FFC links to the FRU that contains this function for each specific system unit.
- The SRN also contains an action or service response. Typically it is brief description of the failure that this SRN represents and an isolation procedure that should be used when servicing the system.

SRNs

This topic contains descriptions of Service request numbers.

Table 1. SRNs

Type of SRN:	Action to perform																														
Five-digit SRNs	<p>Replace FRU parts in the order by which they appear in the list.</p> <p>For SRNs listed as xxPAA:</p> <p>△P△ denotes the adapter port number.</p> <p>△AA△ denotes the SSA address.</p>																														
SRNs 1xx-xxx through 9xx-xxx, 1xx-xxxx through 9xx-xxxx, and 2xx-xxx	<p>Replace FRU parts in the order by which they are listed.</p>																														
SRNs Axx-xxx and Axx-xxxx	<p>When an "X" appears as the last digit of an SRN in this group, it is encoded as follows:</p> <div style="border: 1px solid black; border-radius: 10px; padding: 10px; margin: 10px 0;"> <table style="border-collapse: collapse; margin: 0 auto;"> <tr> <td style="padding: 0 5px;">8</td> <td style="padding: 0 5px;">4</td> <td style="padding: 0 5px;">2</td> <td style="padding: 0 5px;">1</td> <td style="padding: 0 5px;"> </td> <td></td> </tr> <tr> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td>Replace all FRUs listed</td> </tr> <tr> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td>Hot swap supported</td> </tr> <tr> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td>Software might be the cause</td> </tr> <tr> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td style="padding: 0 5px;"> </td> <td>Reserved</td> </tr> </table> </div> <p>Use the physical location codes and FRU numbers listed on the diagnostics Problem Report Screen. FRUs are not used in this group of SRNs.</p>	8	4	2	1								Replace all FRUs listed						Hot swap supported						Software might be the cause						Reserved
8	4	2	1																												
					Replace all FRUs listed																										
					Hot swap supported																										
					Software might be the cause																										
					Reserved																										

10104 **10104**

Explanation: Format in progress.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

10112 **10112**

Explanation: Format Degraded. A format operation ended before it completed.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

1XXXX **1XXXX**

Explanation: Disk drive module error.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

Note : In this SRN, an *x* represents a digit 0 through F.

101-000 **101-000**

Explanation: The system hung while attempting to configure a device.

Response: Use PFW1540 : Problem isolation procedures.

101-185 **101-185**

Explanation: A checkstop occurred.

Response: Use PFW1540 : Problem isolation procedures.

101-517 **101-517**

Explanation: The system unit failed to IPL.

Response: Use PFW1540 : Problem isolation procedures.

101-518 **101-518**

Explanation: CD-ROM read problems after boot.

Response: Go to MAP0050 SCSI Bus Problems. Note: The boot record was read from the CD-ROM disk. However, errors occurred when trying to mount the CD-ROM file system. This problem can be caused by SCSI device addressing, SCSI terminator, open PTC, SCSI cable, etc.

101-521 **101-521**

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged

data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-522 **101-522**

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-523 **101-523**

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-524 **101-524**

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-525 101-525

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-526 101-526

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-527 101-527

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-528 101-528

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running

standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-529 101-529

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-530 101-530

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-531 101-531

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-532 101-532

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone

diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-533 101-533

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-534 101-534

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-535 101-535

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-536 101-536

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-537 101-537

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-538 101-538

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-544 101-544

Explanation: Disk read problems occurred after booting.

Response: Go to MAP0050 SCSI Bus Problems. Note: The boot record was read from the disk. However, errors occurred when trying to open the disk drive. This problem can be caused by SCSI device addressing, SCSI terminator, open PTC, SCSI cable, etc.

101-551 **101-551**

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-552 **101-552**

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-553 **101-553**

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-554 **101-554**

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a

different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-555 **101-555**

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-556 **101-556**

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-557 **101-557**

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-558 **101-558**

Explanation: There is not enough memory to execute diagnostics.

Response: There must be a minimum of 16 MB of installed memory. If the system has 16 MB or more of

101-559 • 101-566

memory installed, suspect a problem with a memory card.

101-559 101-559

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-560 101-560

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-561 101-561

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-562 101-562

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem

occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-563 101-563

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-564 101-564

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-565 101-565

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-566 101-566

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-567 101-567

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-568 101-568

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-569 101-569

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-570 101-570

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-571 101-571

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-572 101-572

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-573 101-573

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

101-574 • 101-580

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-574 101-574

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-575 101-575

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-576 101-576

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-577 101-577

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation

procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-578 101-578

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-579 101-579

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-580 101-580

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-581 **101-581**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-582 **101-582**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-583 **101-583**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-584 **101-584**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-585 **101-585**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-586 **101-586**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-587 **101-587**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-588 **101-588**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation

procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-589 101-589

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-590 101-590

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-591 101-591

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-592 101-592

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-593 101-593

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-594 101-594

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-595 101-595

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-596 **101-596**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures> for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-597 **101-597**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-598 **101-598**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-599 **101-599**

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation

procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-662 **101-662**

Explanation: An unexpected system interrupt.

Response: Use PFW1540 : Problem isolation procedures.

101-711 **101-711**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_711

101-712 **101-712**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, refer to the FRU List. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_712

101-713 **101-713**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

101-714 • 101-720

- FFC_713

101-714 101-714

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_714

101-715 101-715

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_715

101-716 101-716

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_716

101-717 101-717

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the

failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_717

101-718 101-718

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_718

101-719 101-719

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_719

101-720 101-720

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_720

101-721 **101-721**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_721
-

101-722 **101-722**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_722
-

101-723 **101-723**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_723
-

101-724 **101-724**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the

same value in the three-digit display.

Failing Item:

- FFC_724
-

101-725 **101-725**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_725
-

101-726 **101-726**

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_726
-

101-727 **101-727**

Explanation: The system hung while trying to configure an asynchronous adapter.

Response: Use PFW1540 : Problem isolation procedures. Suspect a problem with one of the async adapters.

101-7C1 **101-7C1**

Explanation: The system unit halted while configuring an audio subsystem.

Failing Item:

- FFC_7C1
-

101-80C **101-80C**

Explanation: A potential problem with an SSA device exists.

Response: If the system has external SSA devices refer to the SSA Adapters User's Guide and Maintenance

101-840 • 110-924

Information . If the system has internal SSA devices, go to the SSA MAP in either the system unit's service guide or user's guide.

Failing Item:

- FFC_80C

101-840 101-840

Explanation: An unexpected system interrupt.

Response: Use PFW1540 : Problem isolation procedures. Suspect either a SCSI adapter or integrated SCSI if so equipped.

101-888 101-888

Explanation: The system does not IPL.

Failing Item:

- FFC_210
- FFC_227
- FFC_E10

101-C32 101-C32

Explanation: The system hung while indicating that a direct-attached display was selected as the console.

Response: Use PFW1540 : Problem isolation procedures. Suspect the graphics adapter being used for the display console first.

101-C33 101-C33

Explanation: The system hung while indicating that a TTY terminal is the system console.

Response: Use PFW1540 : Problem isolation procedures. Suspect the graphics adapter being used for the display console first.

101-C70 101-C70

Explanation: A problem was encountered mounting the CD-ROM.

Response: Use PFW1540 : Problem isolation procedures.

103-151 103-151

Explanation: The time-of-day battery failed.

Failing Item:

- FFC_151

109-200 109-200

Explanation: The system crashed while being run by the customer.

Response: Use general problem determination procedures, and get a new SRN.

110-101 110-101

Explanation: The diagnostics did not detect an installed resource.

Response: If this SRN appeared when running concurrent diagnostics, then run concurrent using the diag -a command, otherwise use *Missing resource problem resolution* .

110-908 110-908

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_908
- FFC_C33
- FFC_C36

110-921 110-921

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_921
- FFC_812

110-922 110-922

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_922
- FFC_812

110-923 110-923

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_923
- FFC_812

110-924 110-924

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_924
- FFC_812

110-925 **110-925**

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_925
- FFC_812

110-926 **110-926**

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_926
- FFC_812

110-935 **110-935**

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_935
- FFC_812

110-946 **110-946**

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_946
- FFC_221

111-107 **111-107**

Explanation: A machine check occurred.

Response: Go to MAP0020 Problem determination procedure.

111-108 **111-108**

Explanation: An encoded SRN was displayed.

Response: Go to MAP0020 Problem determination procedure.

111-121 **111-121**

Explanation: There is a display problem. Action: Do problem determination on the display.

111-259 **111-259**

Explanation: Cannot display readable information on the terminal.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 3.

111-725 **111-725**

Explanation: Cannot display readable information on the display.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution. Note: Suspect the display adapter attached to the console display.

Failing Item:

- FFC_725

111-736 **111-736**

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_736
- FFC_821

111-78C **111-78C**

Explanation: I/O bus problem.

Problem determination: PCI adapter refers to the adapters you made note of when using Console and keyboard problem resolution.

Failing Item:

- PCI_ADAPTER
- FFC_227
- FFC_E10

111-82C **111-82C**

Explanation: Cannot display readable information on the display.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 2.

111-921 **111-921**

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_921
- FFC_821

111-922 **111-922**

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_922
 - FFC_821
-

111-923 **111-923**

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_923
 - FFC_821
-

111-947 **111-947**

Explanation: System beeper not functioning correctly.

Failing Item:

- FFC_221
-

111-999 **111-999**

Explanation: System does not perform a soft reset.

Failing Item:

- FFC_210
-

199-102 **199-102**

Explanation: A critical failure has occurred on an undefined element.

Response: Go to MAP2010 : I/O enclosure problem determination. This MAP is located in "Common service procedures " chapter of the " *Service Guide for the 5786, 5787, 7031-D24, and 7031-T24* ", order number SA76-0118-xx

Failing Item:

- FFC_199
-

199-103 **199-103**

Explanation: Non-critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-104 **199-104**

Explanation: An unrecoverable failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-122 **199-122**

Explanation: A critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

199-123 **199-123**

Explanation: A non-critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

199-124 **199-124**

Explanation: An unrecoverable power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

199-132 **199-132**

Explanation: A critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_199
-

199-133 **199-133**

Explanation: A non-critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
-

- FFC_199

199-134 **199-134**

Explanation: An unrecoverable fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_199

199-148 **199-148**

Explanation: The enclosure indicates a temperature threshold warning.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_199

199-149 **199-149**

Explanation: The enclosure indicates a temperature threshold failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_199

199-152 **199-152**

Explanation: A critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-153 **199-153**

Explanation: A non-critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-154 **199-154**

Explanation: An unrecoverable repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-162 **199-162**

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-163 **199-163**

Explanation: A non-critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-164 **199-164**

Explanation: An unrecoverable VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-172 **199-172**

Explanation: A critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-173 **199-173**

Explanation: A non-critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

199-174 • 199-204

- FFC_199

199-174 199-174

Explanation: An unrecoverable enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-182 199-182

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-183 199-183

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-184 199-184

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-192 199-192

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-193 199-193

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-194 199-194

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-201 199-201

Explanation: Device configuration error.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
- FFC_891

199-202 199-202

Explanation: The enclosure failed to open.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
- FFC_891

199-203 199-203

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
- FFC_891

199-204 199-204

Explanation: There is a critical power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

199-205 **199-205**

Explanation: There is a redundant power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
 - FFC_166
-

101-2004 **101-2004**

Explanation: Maximum memory size of partition is too large with respect to the current partition memory size.

Response: Specify a maximum memory size for the partition no larger than 64 times the starting memory size of the partition.

101-2020 **101-2020**

Explanation: The system hung while trying to configure the InfiniBand communication manager. This problem may be attributed to software.

Response: Report this problem to the AIX support center.

101-2021 **101-2021**

Explanation: The system hung while trying to configure the InfiniB and TCP/IP interface. This problem may be attributed to software.

Response: Report this problem to the AIX support center.

101-XXXX **101-XXXX**

Explanation: The system hung while configuring a resource. The last three or four digits after the dash (-) identify the failing function code for the resource being configured.

Response: Go to MAP0260 : System hangs during resource configuration.

Failing Item:

- FFC_XXXX
 - FFC_E10
-

110-XXXX **110-XXXX**

Explanation: The system halted while diagnostics were executing.

Problem determination: xxxx corresponds to the last three or four digits of the SRN following the dash (-). If your 110 SRN is not listed, substitute the last three or four digits of the SRN for xxxx, then proceed to the

FFC table using the substituted digits as your FFC.

Failing Item:

- FFC_221
-

20PAA **20PAA**

Explanation: An open SSA loop was detected.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

21PAA **21PAA**

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

22PAA **22PAA**

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

23PAA **23PAA**

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

24PAA **24PAA**

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

25PAA • 2504-720

AA denotes the SSA address.

25PAA 25PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

2502-101 2502-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502

2502-710 2502-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502

2502-713 2502-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502

2502-720 2502-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2503-101 2503-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503

2503-710 2503-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503

2503-713 2503-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503

2503-720 2503-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2504-101 2504-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504

2504-710 2504-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504

2504-713 2504-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504

2504-720 2504-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2505-101 2505-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-710 2505-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-713 2505-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-720 2505-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2512-710 2512-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2512
-

2512-711 2512-711

Explanation: Adapter failure.

Failing Item:

- FFC_2512
-

2512-712 2512-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2512
-

2512-713 2512-713

Explanation: Adapter failure.

Failing Item:

- FFC_2512
-

2512-714 2512-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2512
-

2512-715 2512-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2512
-

2512-716 2512-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2512
 - FFC_293
-

2512-717 2512-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2512
 - FFC_293
-

2512-718 2512-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2512
 - FFC_293
-

2512-719 2512-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2512-720 2512-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2512-721 • 2513-720

2512-721 2512-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2512-722 2512-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2512
-

2512-723 2512-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2512-724 2512-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2512
-

2512-725 2512-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2513-101 2513-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2513
-

2513-710 2513-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2513
-

2513-711 2513-711

Explanation: Adapter failure.

Failing Item:

- FFC_2513
-

2513-712 2513-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2513
-

2513-713 2513-713

Explanation: Adapter failure.

Failing Item:

- FFC_2513
-

2513-714 2513-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2513
-

2513-715 2513-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2513
-

2513-716 2513-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2513

- FFC_293
-

2513-717 2513-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2513

- FFC_293
-

2513-718 2513-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2513

- FFC_293
-

2513-719 2513-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2513-720 2513-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2513-721 2513-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2513-722 2513-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2513
-

2513-723 2513-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2513-724 2513-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2513
-

2513-725 2513-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2514-101 2514-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2514
-

2514-710 2514-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2514
-

2514-711 2514-711

Explanation: Adapter failure.

Failing Item:

- FFC_2514
-

2514-712 2514-712

Explanation: Adapter device bus configuration error.

Response: Use MAP0050.

Failing Item:

- FFC_2514
-

2514-713 2514-713

Explanation: Adapter failure.

Failing Item:

- FFC_2514
-

2514-714 2514-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2514
-

2514-715 2514-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2514
-

2514-716 2514-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2514
 - FFC_293
-

2514-717 2514-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2514
 - FFC_293
-

2514-718 2514-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2514
 - FFC_293
-

2514-719 2514-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2514-720 2514-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2514-721 • 2517-710

2514-721 2514-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2514-722 2514-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2514
-

2514-723 2514-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2514-724 2514-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2514
-

2514-725 2514-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2515-101 2515-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
-

2515-710 2515-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
-

2515-713 2515-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
-

2515-720 2515-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2516-101 2516-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-710 2516-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-713 2516-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-720 2516-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2517-101 2517-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-710 2517-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-713 2517-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-720 2517-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2518-101 2518-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-710 2518-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-713 2518-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-720 2518-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2519-101 2519-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-710 2519-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-713 2519-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-720 2519-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

251D-101 251D-101

Explanation: Adapter configuration error.

Response: Use MAP0210.

Failing Item:

- FFC_251D
-

251D-710 251D-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-713 251D-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-720 251D-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2520-101 2520-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

2520-102 2520-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

2520-103 2520-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_2520
 - FFC_221
-

2520-212 2520-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_2520
-

2520-213 2520-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_2520
-

2520-214 2520-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_2520
-

2520-215 2520-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_2520
-

2520-216 2520-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_2520
-

2520-217 2520-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_2520
-

2520-218 2520-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_2520
-

2520-219 2520-219

Explanation: SCSI parity error.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-220 2520-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_2520
-

2520-221 2520-221

Explanation: Miscompare during the write/read of configuration register.

Failing Item:

- FFC_2520
 - FFC_293
-

2520-222 2520-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_2520
-

2520-223 2520-223

Explanation: Miscompare during the write/read of the memory I/O register.

2520-224 2520-224

Explanation: SCSI configuration read or write error.

Failing Item:

- FFC_2520
 - FFC_221
-

2520-226 2520-226

Explanation: SCSI wrap or PTC error.

Failing Item:

- FFC_2520
-

2520-227 2520-227

Explanation: SCSI adapter interrupt test failure.

Failing Item:

- FFC_2520
 - FFC_221
-

2520-230 2520-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-231 2520-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-232 2520-232

Explanation: SCSI bus data miscompare.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-240 2520-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-242 2520-242

Explanation: SCSI bus error.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-301 2520-301

Explanation: Configuration open failed for parent bus.

Failing Item:

- FFC_2520
 - FFC_221
-

2520-801 2520-801

Explanation: Error Log Analysis indicates a terminator problem.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2520-802 2520-802

Explanation: Error Log Analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2520-803 2520-803

Explanation: Error Log Analysis indicates that multiple SCSI bus errors have occurred.

Response: Run diagnostic on the adapter and the devices in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2521-101 2521-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

2521-102 2521-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

2521-103 2521-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_2521
 - FFC_221
-

2521-227 2521-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_2521
 - FFC_221
-

2521-701 2521-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_2521

2521-801 2521-801

Explanation: Error Log Analysis indicates a terminator problem.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2521-802 2521-802

Explanation: Error Log Analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2521-803 2521-803

Explanation: Error Log Analysis indicates that multiple SCSI bus errors have occurred.

Response: Run diagnostic on the adapter and the devices in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2522-101 2522-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2522

2522-710 2522-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2522

2522-711 2522-711

Explanation: Adapter failure.

Failing Item:

- FFC_2522

2522-712 2522-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2522

2522-713 2522-713

Explanation: Adapter failure.

Failing Item:

- FFC_2522

2522-714 2522-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2522

2522-715 2522-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2522

2522-716 2522-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2522
- FFC_293

2522-717 2522-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2522
- FFC_293

2522-718 2522-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2522
- FFC_293

2522-719 2522-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2522-720 2522-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2522-721 2522-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2522-722 2522-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2522
-

2522-723 2522-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2522-724 2522-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2522
-

2522-725 2522-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2523-101 2523-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2523
-

2523-710 2523-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2523
-

2523-711 2523-711

Explanation: Adapter failure.

Failing Item:

- FFC_2523
-

2523-712 2523-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2523
-

2523-713 2523-713

Explanation: Adapter failure.

Failing Item:

- FFC_2523
-

2523-714 2523-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2523
-

2523-715 2523-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2523
-

2523-716 2523-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2523
 - FFC_293
-

2523-717 2523-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2523
 - FFC_293
-

2523-718 2523-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2523
 - FFC_293
-

2523-719 2523-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2523-720 2523-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2523-721 2523-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2523-722 2523-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2523
-

2523-723 2523-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2523-724 2523-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2523
-

2523-725 2523-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2524-101 2524-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2524
-

2524-701 2524-701

Explanation: Error Log Analysis indicates adapter hardware error.

Failing Item:

- FFC_2524
-

2524-702 2524-702

Explanation: Error Log Analysis indicates SCSI device error.

Response: Use MAP0050 : SCSI Bus Problems.

2524-703 2524-703

Explanation: Error Log Analysis indicates hardware system error due to EEH reset problem.

Failing Item:

- FFC_2524
 - FFC_221
-

2524-704 2524-704

Explanation: Error Log Analysis indicates hardware system error from EEH event.

Failing Item:

- FFC_2524
 - FFC_221
-

2524-705 2524-705

Explanation: Error Log Analysis indicates PCI bus error.

Failing Item:

- FFC_2524
 - FFC_221
-

2524-706 2524-706

Explanation: Error Log Analysis indicates adapter hardware error.

Failing Item:

- FFC_2524
-

2524-707 2524-707

Explanation: Error Log Analysis indicates PCI bus error.

Failing Item:

- FFC_2524
 - FFC_221
-

2524-708 2524-708

Explanation: Error Log Analysis indicates adapter register timeout error.

Failing Item:

- FFC_2524
-

2527-101 2527-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2527
-

2527-710 2527-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2527
-

2527-711 2527-711

Explanation: Adapter failure.

Failing Item:

- FFC_2527
-

2527-712 2527-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-713 2527-713

Explanation: Adapter failure.

Failing Item:

- FFC_2527
-

2527-714 2527-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2527
-

2527-715 2527-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2527
-

2527-716 2527-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2527
 - FFC_293
-

2527-717 2527-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2527
 - FFC_293
-

2527-718 2527-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2527
 - FFC_293
-

2527-719 2527-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2527-720 2527-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2527-721 2527-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2527-722 2527-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2527
-

2527-723 2527-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2527-724 2527-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2527
-

2527-725 2527-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054..

2528-101 2528-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2528
-

2528-710 2528-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2528
-

2528-711 • 2529-710

2528-711 2528-711

Explanation: Adapter failure.

Failing Item:

- FFC_2528
-

2528-712 2528-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2528
-

2528-713 2528-713

Explanation: Adapter failure.

Failing Item:

- FFC_2528
-

2528-714 2528-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2528
-

2528-715 2528-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2528
-

2528-716 2528-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2528
 - FFC_293
-

2528-717 2528-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2528
 - FFC_293
-

2528-718 2528-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2528
 - FFC_293
-

2528-719 2528-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2528-720 2528-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2528-721 2528-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2528-722 2528-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2528
-

2528-723 2528-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2528-724 2528-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2528
-

2528-725 2528-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2529-101 2529-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2529
-

2529-710 2529-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2529
-

2529-711 2529-711

Explanation: Adapter failure.

Failing Item:

- FFC_2529
-

2529-712 2529-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2529
-

2529-713 2529-713

Explanation: Adapter failure.

Failing Item:

- FFC_2529
-

2529-714 2529-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2529
-

2529-715 2529-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2529
-

2529-716 2529-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2529
 - FFC_293
-

2529-717 2529-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2529
 - FFC_293
-

2529-718 2529-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2529
 - FFC_293
-

2529-719 2529-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2529-720 2529-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2529-721 2529-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2529-722 2529-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2529
-

2529-723 2529-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2529-724 2529-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2529
-

2529-725 2529-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

252B-101 252B-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_252B
-

252B-710 252B-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_252B
-

252B-711 • 252D-710

252B-711 252B-711

Explanation: Adapter failure.

Failing Item:

- FFC_252B
-

252B-712 252B-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_252B
-

252B-713 252B-713

Explanation: Adapter failure.

Failing Item:

- FFC_252B
-

252B-714 252B-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252B
-

252B-715 252B-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252B
-

252B-716 252B-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_252B
 - FFC_293
-

252B-717 252B-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_252B
 - FFC_293
-

252B-718 252B-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_252B
 - FFC_293
-

252B-719 252B-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

252B-720 252B-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

252B-721 252B-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

252B-722 252B-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_252B
-

252B-723 252B-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

252B-724 252B-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_252B
-

252B-725 252B-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

252D-101 252D-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_252D
-

252D-710 252D-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_252D
-

252D-711 252D-711

Explanation: Adapter failure.

Failing Item:

- FFC_252D
-

252D-712 252D-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_252D
-

252D-713 252D-713

Explanation: Adapter failure.

Failing Item:

- FFC_252D
-

252D-714 252D-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252D
-

252D-715 252D-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252D
-

252D-716 252D-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_252D
 - FFC_293
-

252D-717 252D-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_252D
 - FFC_293
-

252D-718 252D-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_252D
 - FFC_293
-

252D-719 252D-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

252D-720 252D-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

252D-721 252D-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

252D-722 252D-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_252D
-

252D-723 252D-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

252D-724 252D-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_252D
-

252D-725 252D-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

252E-101 252E-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_252E
-

252E-710 252E-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_252E
-

252E-711 252E-711

Explanation: Adapter failure.

Failing Item:

- FFC_252E
-

252E-712 252E-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_252E
-

252E-713 252E-713

Explanation: Adapter failure.

Failing Item:

- FFC_252E
-

252E-714 252E-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252E
-

252E-715 252E-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252E
-

252E-716 252E-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_252E
 - FFC_293
-

252E-717 252E-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_252E
 - FFC_293
-

252E-718 252E-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_252E
 - FFC_293
-

252E-719 252E-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

252E-720 252E-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

252E-721 252E-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

252E-722 252E-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_252E
-

252E-723 252E-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

252E-724 252E-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_252E
-

252E-725 252E-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2530-101 2530-101

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221
-

2530-102 2530-102

Explanation: Enhanced Error Handling logic failure.

Failing Item:

- FFC_221
-

2530-103 **2530-103**

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_2530
-

2530-104 **2530-104**

Explanation: Port command test failure.

Failing Item:

- FFC_2530
-

2530-105 **2530-105**

Explanation: CU command test failure.

Failing Item:

- FFC_2530
-

2530-106 **2530-106**

Explanation: External wrap test failure.

Failing Item:

- FFC_2530
-

2530-107 **2530-107**

Explanation: A non-critical error occurred.

Response: Replace the adapter during scheduled maintenance. An encryption authentication problem has been detected.

Failing Item:

- FFC_2530
-

2530-201 **2530-201**

Explanation: EEPROM test failure.

Failing Item:

- FFC_2530
 - FFC_221
-

2530-202 **2530-202**

Explanation: Internal wrap test failure.

Failing Item:

- FFC_2530
 - FFC_221
-

2530-701 **2530-701**

Explanation: Error log analysis indicates that this device has failed to initialize due to a self-test failure.

Failing Item:

- FFC_2530
-

2530-702 **2530-702**

Explanation: Error log analysis indicates that this device has failed to initialize due to an EEH hardware error.

Failing Item:

- FFC_2530
-

2530-703 **2530-703**

Explanation: Error log analysis indicates that this device has failed to initialize due to a problem with the EEPROM on the adapter.

Failing Item:

- FFC_2530
-

2530-704 **2530-704**

Explanation: Error log analysis indicates that this device has failed to initialize due to EEH errors.

Failing Item:

- FFC_2530
 - FFC_221
-

2531-101 **2531-101**

Explanation: VPD test failure

Failing Item:

- FFC_2531
-

2531-102 **2531-102**

Explanation: Flash ROM test

Failing Item:

- FFC_2531
-

2531-103 **2531-103**

Explanation: Internal wrap test failure

Failing Item:

- FFC_2531
-

2531-104 **2531-104**

Explanation: External wrap test failure.

Failing Item:

- FFC_2531
-

2531-105 2531-105

Explanation: External wrap test with checksum IP offload failure.

Failing Item:

- FFC_2531

2531-106 2531-106

Explanation: External wrap test with checksum TCP offload failure.

Failing Item:

- FFC_2531

2531-201 2531-201

Explanation: Registers test failure

Failing Item:

- FFC_2531
- FFC_221

2531-202 2531-202

Explanation: Enhanced Error Handling Failure while testing adapter

Failing Item:

- FFC_2531
- FFC_221

2531-203 2531-203

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_2531
- FFC_221

2531-204 2531-204

Explanation: Link test failure, Wrap test ok

Failing Item:

- CABLE
- NETWORK

2531-301 2531-301

Explanation: Link test failure without wrap test

Failing Item:

- FFC_2531
- CABLE
- NETWORK

2531-701 2531-701

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2531

2531-702 2531-702

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Failing Item:

- FFC_2531

2531-703 2531-703

Explanation: Transmit error due to timeout.

Failing Item:

- FFC_2531

2532-101 2532-101

Explanation: VPD test failure

Failing Item:

- FFC_2532

2532-102 2532-102

Explanation: Flash ROM test

Failing Item:

- FFC_2532

2532-103 2532-103

Explanation: Internal wrap test failure

Failing Item:

- FFC_2532

2532-104 2532-104

Explanation: External wrap test failure

Failing Item:

- FFC_2532

2532-105 2532-105

Explanation: External wrap test with checksum IP offload failure

Failing Item:

- FFC_2532
-

2532-106 2532-106

Explanation: External wrap test with checksum TCP offload failure

Failing Item:

- FFC_2532
-

2532-201 2532-201

Explanation: Registers test failure

Failing Item:

- FFC_2532
 - FFC_221
-

2532-202 2532-202

Explanation: Enhanced Error Handling Failure while testing adapter

Failing Item:

- FFC_2532
 - FFC_221
-

2532-203 2532-203

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_2532
 - FFC_221
-

2532-204 2532-204

Explanation: Link test failure, Wrap test ok

Failing Item:

- CABLE
 - NETWORK
-

2532-301 2532-301

Explanation: Link test failure without wrap test

Failing Item:

- FFC_2532
 - CABLE
 - NETWORK
-

2532-701 2532-701

Explanation: Failure to initialize due to a self-test failure.

Failing Item:

- FFC_2532
-

2532-702 2532-702

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter.

Failing Item:

- FFC_2532
-

2532-703 2532-703

Explanation: Transmit error due to timeout.

Failing Item:

- FFC_2532
-

2533-101 2533-101

Explanation: Enhanced Error Handling Failure

Failing Item:

- FFC_2533
-

2533-102 2533-102

Explanation: Memory Test Failure

Failing Item:

- FFC_2533
-

2533-103 2533-103

Explanation: CA Memory Test Failure

Failing Item:

- FFC_2533
-

2533-104 2533-104

Explanation: EEPROM Test Failure

Failing Item:

- FFC_2533
-

2533-105 2533-105

Explanation: Flash ROM Test Failure

Failing Item:

- FFC_2533
-

2533-106 2533-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2533
-

2533-107 2533-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2533
-

2533-108 2533-108

Explanation: External Wrap with IP Checksum Test Failure

Failing Item:

- FFC_2533
-

2533-109 2533-109

Explanation: External Wrap with UDP Checksum Test Failure

Failing Item:

- FFC_2533
-

2533-110 2533-110

Explanation: External Wrap with TCP Checksum Test Failure

Failing Item:

- FFC_2533
-

2533-111 2533-111

Explanation: Network link test failure. (Wrap tests passed. Check ethernet network and cables.)

Failing Item:

- FFC_241
-

2533-201 2533-201

Explanation: PCI Configuration I/O Test Failure

Failing Item:

- FFC_2533
 - FFC_221
-

2533-202 2533-202

Explanation: Network link test failure. (Wrap tests not performed.)

Failing Item:

- FFC_241
 - FFC_2533
-

2533-601 2533-601

Explanation: Error log analysis indicates that this adapter has failed due to a hardware error.

Failing Item:

- FFC_2533
-

2533-602 2533-602

Explanation: Error log analysis indicates that this adapter has failed due to an EEPROM error.

Failing Item:

- FFC_2533
-

2533-603 2533-603

Explanation: Error log analysis indicates that this adapter has failed due to transmission errors.

Failing Item:

- FFC_2533
-

2534-101 2534-101

Explanation: Enhanced Error Handling Failure

Failing Item:

- FFC_2534
-

2534-102 2534-102

Explanation: Memory Test Failure

Failing Item:

- FFC_2534
-

2534-103 2534-103

Explanation: CA Memory Test Failure

Failing Item:

- FFC_2534
-

2534-104 2534-104

Explanation: EEPROM Test Failure

Failing Item:

- FFC_2534
-

2534-105 2534-105

Explanation: Flash ROM Test Failure

Failing Item:

- FFC_2534
-

2534-106 2534-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2534
-

2534-107 2534-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2534
-

2534-108 2534-108

Explanation: External Wrap with IP Checksum Test Failure

Failing Item:

- FFC_2534
-

2534-109 2534-109

Explanation: External Wrap with UDP Checksum Test Failure

Failing Item:

- FFC_2534
-

2534-110 2534-110

Explanation: External Wrap with TCP Checksum Test Failure

Failing Item:

- FFC_2534
-

2534-111 2534-111

Explanation: Network link test failure. (Wrap tests passed. Check ethernet network and cables.)

Failing Item:

- FFC_241
-

2534-201 2534-201

Explanation: PCI Configuration I/O Test Failure

Failing Item:

- FFC_2534
 - FFC_221
-

2534-202 2534-202

Explanation: Network link test failure. (Wrap tests not performed.)

Failing Item:

- FFC_241
-

- FFC_2534
-

2534-601 2534-601

Explanation: Error log analysis indicates that this adapter has failed due to a hardware error.

Failing Item:

- FFC_2534
-

2534-602 2534-602

Explanation: Error log analysis indicates that this adapter has failed due to an EEPROM error.

Failing Item:

- FFC_2534
-

2534-603 2534-603

Explanation: Error log analysis indicates that this adapter has failed due to transmission errors.

Failing Item:

- FFC_2534
-

2535-101 2535-101

Explanation: Enhanced Error Handling Failure on bus.

Failing Item:

- FFC_221
-

2535-103 2535-103

Explanation: Enhanced Error Handling Failure while testing adapter.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-104 2535-104

Explanation: Internal wrap test failure (10 Mbps).

Failing Item:

- FFC_2535
-

2535-105 2535-105

Explanation: Internal wrap test failure (100 Mbps).

Failing Item:

- FFC_2535
-

2535-106 2535-106

Explanation: Internal wrap test failure (1000 Mbps).

Failing Item:

- FFC_2535
-

2535-107 2535-107

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_2535
-

2535-108 2535-108

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_2535
-

2535-201 2535-201

Explanation: Registers test failure.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-701 2535-701

Explanation: Failure to initialize due to a self-test failure.

Failing Item:

- FFC_2535
-

2535-702 2535-702

Explanation: Failure to recover from an EEH event.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-703 2535-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter.

Failing Item:

- FFC_2535
-

2535-704 2535-704

Explanation: Device has attempted error recovery.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-705 2535-705

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_25C3
 - FFC_221
-

2537-102 2537-102

Explanation: Internal wrap test failure (1000 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-103 2537-103

Explanation: Internal wrap test failure (100 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-104 2537-104

Explanation: Internal wrap test failure (10 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-105 2537-105

Explanation: External wrap test failure (1000 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-106 2537-106

Explanation: External wrap test failure (100 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-107 2537-107

Explanation: External wrap test failure (10 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-111 **2537-111****Explanation:** Enhanced Error Handling Failure on bus**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_221
-

2537-112 **2537-112****Explanation:** Enhanced error handling failure while testing the adapter.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
 - FFC_221
-

2537-201 **2537-201****Explanation:** Registers test failure.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
 - FFC_221
-

2537-210 **2537-210****Explanation:** TU 10 interrupt test failure.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
 - FFC_221
-

2537-701 **2537-701****Explanation:** Failure to initialize due to a self-test failure**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-702 **2537-702****Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-703 **2537-703****Explanation:** EEH service error**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
 - FFC_221
-

2538-102 **2538-102****Explanation:** Internal wrap test failure (1000 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-103 **2538-103****Explanation:** Internal wrap test failure (100 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-104 **2538-104****Explanation:** Internal wrap test failure (10 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-105 **2538-105****Explanation:** External wrap test failure (1000 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-106 **2538-106****Explanation:** External wrap test failure (100 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-107 **2538-107****Explanation:** External wrap test failure (10 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-111 2538-111

Explanation: Enhanced Error Handling Failure on bus

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_221
-

2538-112 2538-112

Explanation: Enhanced error handling failure while testing the adapter.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
 - FFC_221
-

2538-201 2538-201

Explanation: Registers test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
 - FFC_221
-

2538-210 2538-210

Explanation: TU 10 interrupt test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
 - FFC_221
-

2538-701 2538-701

Explanation: Failure to initialize due to a self-test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
-

2538-702 2538-702

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
-

2538-703 2538-703

Explanation: EEH service error

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
 - FFC_221
-

254E-201 254E-201

Explanation: Adapter configuration error.

Failing Item:

- FFC_254E
 - FFC_221
-

254E-601 254E-601

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_254E
-

254E-602 254E-602

Explanation: Error log analysis indicates an error attention condition.

Failing Item:

- FFC_254E
-

254E-603 254E-603

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Failing Item:

- FFC_254E
-

254E-604 254E-604

Explanation: Error log analysis indicates a permanent adapter failure.

Failing Item:

- FFC_254E
-

254E-605 254E-605

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_254E
-

254E-606 254E-606

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_254E
-

254E-701 254E-701

Explanation: Error log analysis indicates permanent adapter failure.

Failing Item:

- FFC_254E
 - FFC_221
-

254E-702 254E-702

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_254E
 - FFC_221
-

2550-001 2550-001

Explanation: Software error.

Failing Item:

- SOFTWARE
-

2550-002 2550-002

Explanation: Adapter failure.

Failing Item:

- FFC_2550
 - SOFTWARE
-

2550-003 2550-003

Explanation: Adapter failure.

Failing Item:

- FFC_2550
 - FFC_227
-

2550-004 2550-004

Explanation: Adapter or display failure.

Failing Item:

- FFC_2550
 - MONITOR
 - CABLE
-

2550-005 2550-005

Explanation: Adapter or display failure.

Failing Item:

- FFC_2550
 - FFC_227
 - MONITOR
 - CABLE
-

2551-001 2551-001

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_2551
-

2551-002 2551-002

Explanation: Adapter failure.

Failing Item:

- FFC_2551
 - SOFTWARE
-

2551-003 2551-003

Explanation: Adapter failure.

Failing Item:

- FFC_2551
 - FFC_227
-

2551-004 2551-004

Explanation: Adapter or display failure.

Failing Item:

- FFC_2551
 - MONITOR
 - CABLE
-

2551-005 2551-005

Explanation: Adapter or display failure.

Failing Item:

- FFC_2551
 - FFC_227
 - MONITOR
 - CABLE
-

2555-102 2555-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2555
-

2555-104 2555-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2555
-

2555-105 2555-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2555
-

2555-106 2555-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2555
-

2555-108 2555-108

Explanation: The bus test failed.

Failing Item:

- FFC_2555
-

2555-110 2555-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2555
-

2555-112 2555-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2555
-

2555-114 2555-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2555
-

2555-116 2555-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2555
-

2555-117 2555-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2555
-

2555-118 2555-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2555
 - FFC_B88
-

2555-120 2555-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2555
-

2555-122 2555-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2555
-

2555-124 2555-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2555
-

2555-126 2555-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2555
 - FFC_B88
-

2555-128 2555-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2555
 - SOFTWARE
-

2555-129 2555-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2555
 - SOFTWARE
-

2555-130 2555-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2555
-

2555-132 2555-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2555
-

2555-133 2555-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2555-134 2555-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2555-135 2555-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2555
 - FFC_B88
 - SOFTWARE
-

2555-136 2555-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2555

2555-137 2555-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2555
 - FFC_B88
 - FFC_190
-

2555-138 2555-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2555
-

2555-140 2555-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2555
-

2555-640 2555-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2556-102 2556-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2556
-

2556-104 2556-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2556
-

2556-105 2556-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2556

2556-106 2556-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2556
-

2556-108 2556-108

Explanation: The bus test failed.

Failing Item:

- FFC_2556
-

2556-110 2556-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2556
-

2556-112 2556-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2556
-

2556-114 2556-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2556
-

2556-116 2556-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2556
-

2556-117 2556-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2556
-

2556-118 2556-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2556
 - FFC_B88
-

2556-120 2556-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2556
-

2556-122 2556-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2556
-

2556-124 2556-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2556
-

2556-126 2556-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2556
 - FFC_B88
-

2556-128 2556-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2556
 - SOFTWARE
-

2556-129 2556-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2556
 - SOFTWARE
-

2556-130 2556-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2556
-

2556-132 2556-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2556
-

2556-133 2556-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2556-134 2556-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2556-135 2556-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2556
 - FFC_B88
 - SOFTWARE
-

2556-136 2556-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2556
-

2556-137 2556-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2556
 - FFC_B88
 - FFC_190
-

2556-138 2556-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2556
-

2556-140 2556-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2556
-

2556-640 2556-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2557-102 2557-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2557
-

2557-104 2557-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2557
-

2557-105 2557-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2557
-

2557-106 2557-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2557
-

2557-108 2557-108

Explanation: The bus test failed.

Failing Item:

- FFC_2557
-

2557-110 2557-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2557

2557-112 2557-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2557
-

2557-114 2557-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2557
-

2557-116 2557-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2557
-

2557-117 2557-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2557
-

2557-118 2557-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2557
 - FFC_B88
-

2557-120 2557-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2557
-

2557-122 2557-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2557
-

2557-124 2557-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2557
-

2557-126 2557-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2557
 - FFC_B88
-

2557-128 2557-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2557
 - SOFTWARE
-

2557-129 2557-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2557
 - SOFTWARE
-

2557-130 2557-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2557
-

2557-132 2557-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2557
-

2557-133 2557-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2557-134 2557-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

2557-135 2557-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2557
 - FFC_B88
 - SOFTWARE
-

2557-136 2557-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2557
-

2557-137 2557-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2557
 - FFC_B88
 - FFC_190
-

2557-138 2557-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2557
-

2557-140 2557-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2557
-

2557-640 2557-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2562-601 2562-601

Explanation: Error Log Analysis indicates adapter function failure.

Failing Item:

- FFC_2562
-

2564-101 2564-101

Explanation: Diagnostics indicates adapter configuration failure.

2564-601 2564-601

Explanation: Error log analysis indicates adapter function failure.

Failing Item:

- FFC_2564
-

2564-602 2564-602

Explanation: Diagnostics indicates adapter configuration failure.

Failing Item:

- FFC_2564
-

2566-101 2566-101

Explanation: The diskette-drive selected or deselected failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-102 2566-102

Explanation: The diskette-drive selected or deselected failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-103 2566-103

Explanation: The diskette failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-107 2566-107

Explanation: The diskette failed.

Failing Item:

- FFC_2566

2566-108 • 2568-201

- FFC_2D02

2566-108 2566-108

Explanation: The diskette read test failed.

Failing Item:

- FFC_2566

2566-109 2566-109

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_2566
- FFC_2D02

2566-110 2566-110

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_2566
- FFC_2D02

2566-111 2566-111

Explanation: A diskette drive test failed.

Failing Item:

- FFC_2566

2566-114 2566-114

Explanation: A diskette drive test failed.

Failing Item:

- FFC_2566

2566-115 2566-115

Explanation: The diskette drive test failed.

Failing Item:

- FFC_2566
- FFC_2D02

2566-121 2566-121

Explanation: The diskette drive test failed.

Failing Item:

- FFC_2566
- FFC_2D02

2566-124 2566-124

Explanation: Unable to configure the device.

Failing Item:

- FFC_2566

2566-125 2566-125

Explanation: Diagnostics was unable to detect the device.

Failing Item:

- FFC_2566
- FFC_2D02

2566-601 2566-601

Explanation: ELA detected a non-recoverable Hardware failure on diskette drive.

Failing Item:

- FFC_2566

2566-701 2566-701

Explanation: ELA detected a Hardware failure on diskette drive.

Failing Item:

- FFC_2566
- FFC_2D02

2566-702 2566-702

Explanation: ELA detected a communication failure to the diskette drive.

Failing Item:

- FFC_2566
- FFC_2D02

2568-101 2568-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2568

2568-201 2568-201

Explanation: Unable to configure the adapter.

Failing Item:

- FFC_2D02
-

2568-202 2568-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2568
 - FFC_2D02
 - MEDIA
-

2568-203 2568-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_2D02
-

2568-204 2568-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2568
-

2568-205 2568-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2568
 - MEDIA
-

2568-206 2568-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2568
-

2568-207 2568-207

Explanation: A media error was detected

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2568
-

2568-208 2568-208

Explanation: The CD-ROM Play Audio command failed.

Failing Item:

- FFC_2568
 - MEDIA
-

2568-209 2568-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2568
-

2568-210 2568-210

Explanation: The Prevent Media Removal or Allow media removal command failed.

Failing Item:

- FFC_2568
-

2568-211 2568-211

Explanation: CD-ROM drive indicates an error.

Failing Item:

- FFC_2568
-

2568-212 2568-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2568
 - MEDIA
-

2568-701 2568-701

Explanation: ELA indicates Drive Hardware failure.

Failing Item:

- FFC_2568
-

2568-702 2568-702

Explanation: ELA indicates Drive Hardware failure.

Failing Item:

- FFC_2568
-

256D-201 256D-201

Explanation: Adapter configuration error.

Failing Item:

- FFC_256D
 - FFC_221
-

256D-601 256D-601

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_256D
-

256D-602 256D-602

Explanation: Error log analysis indicates an error attention condition.

Failing Item:

- FFC_256D

256D-603 256D-603

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Failing Item:

- FFC_256D

256D-604 256D-604

Explanation: Error log analysis indicates a permanent adapter failure.

Failing Item:

- FFC_256D

256D-605 256D-605

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_256D

256D-606 256D-606

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_256D

256D-701 256D-701

Explanation: Error log analysis indicates permanent adapter failure.

Failing Item:

- FFC_256D
- FFC_221

256D-702 256D-702

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_256D
- FFC_221

2570-101 2570-101

Explanation: DES test failed.

Failing Item:

- FFC_2570

2570-102 2570-102

Explanation: RSA test failed.

Failing Item:

- FFC_2570

2570-103 2570-103

Explanation: MAC test failed.

Failing Item:

- FFC_2570

2570-104 2570-104

Explanation: DES and SHA test failed.

Failing Item:

- FFC_2570

2570-105 2570-105

Explanation: DES to SHA test failed.

Failing Item:

- FFC_2570

2570-106 2570-106

Explanation: Enhanced Error Handling Circuitry failure.

Failing Item:

- FFC_221

2570-107 2570-107

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221

2570-108 2570-108

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_221
-

2570-201 2570-201

Explanation: Register test failed.

Failing Item:

- FFC_2570
 - FFC_221
-

2570-601 2570-601

Explanation: ELA indicates hardware failure has occurred.

Failing Item:

- FFC_2570
-

2570-602 2570-602

Explanation: ELA indicates hardware timeout has occurred.

Failing Item:

- FFC_2570
-

2570-603 2570-603

Explanation: ELA indicates hardware failure and timeout has occurred.

Failing Item:

- FFC_2570
-

2571-101 2571-101

Explanation: Enhanced Error Handling Failure on Bus

Failing Item:

- FFC_2571
-

2571-102 2571-102

Explanation: Adapter I/O Register Test Failure

Failing Item:

- FFC_2571
-

2571-103 2571-103

Explanation: Timer Test Failure

Failing Item:

- FFC_2571
-

2571-104 2571-104

Explanation: Interrupt Test Failure

Failing Item:

- FFC_2571
-

2571-105 2571-105

Explanation: Internal Loop Back Test Failure

Failing Item:

- FFC_2571
-

2571-106 2571-106

Explanation: External Loop Back Test Failure

Failing Item:

- FFC_2571
-

2571-201 2571-201

Explanation: PCI COnfiguration I/O Test Failure

Failing Item:

- FFC_2571
 - FFC_221
-

2571-601 2571-601

Explanation: Error log analysis indicates that this device has failed due to an adapter reset failure.

Failing Item:

- FFC_2571
-

2571-602 2571-602

Explanation: Error log analysis indicates that this device has failed due to a hardware error.

Failing Item:

- FFC_2571
-

2572-100 2572-100

Explanation: POST failed: Catastrophic error detected.

Failing Item:

- FFC_2572
-

2572-601 2572-601

Explanation: ELA indicates: Low Battery Warning.

Failing Item:

- FFC_11A
-

2572-602 2572-602

Explanation: ELA indicates: Mesh Violation - Tamper.

Failing Item:

- FFC_2572
-

2572-603 2572-603

Explanation: ELA indicates: 4764 is held in the Reset condition.

Failing Item:

- FFC_2572
-

2572-604 2572-604

Explanation: ELA indicates: +3, +5, or +12v Overvoltage condition.

Failing Item:

- FFC_2572
-

2572-605 2572-605

Explanation: ELA indicates: Out of Temperature Specification.

Failing Item:

- FFC_2572
-

2572-606 2572-606

Explanation: ELA indicates: X-ray or Dead Battery.

Failing Item:

- FFC_2572
-

2572-607 2572-607

Explanation: ELA indicates: Intrusion latch.

Failing Item:

- FFC_2572
-

2576-101 2576-101

Explanation: Enhanced Error Handling Failure on Bus

Failing Item:

- FFC_2576
-

2576-102 2576-102

Explanation: Adapter I/O Register Test Failure

Failing Item:

- FFC_2576
-

2576-103 2576-103

Explanation: Timer Test Failure

Failing Item:

- FFC_2576
-

2576-104 2576-104

Explanation: Interrupt Test Failure

Failing Item:

- FFC_2576
-

2576-105 2576-105

Explanation: Internal Loop Back Test Failure

Failing Item:

- FFC_2576
-

2576-106 2576-106

Explanation: External Loop Back Test Failure

Failing Item:

- FFC_2576
-

2576-201 2576-201

Explanation: PCI COnfiguration I/O Test Failure

Failing Item:

- FFC_2576
 - FFC_221
-

2576-601 2576-601

Explanation: Error log analysis indicates that this device has failed due to an adapter reset failure.

Failing Item:

- FFC_2576
-

2576-602 2576-602

Explanation: Error log analysis indicates that this device has failed due to a hardware error.

Failing Item:

- FFC_2576
-

2578-101 2578-101

Explanation: POST TU Failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578
-

2578-601 2578-601

Explanation: Error Log Analysis indicates that this adapter has failed due to an Adapter OS Error

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2578-602 2578-602

Explanation: Error Log Analysis indicates that this adapter has failed due to a POST Failed

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578
-

2578-603 2578-603

Explanation: Error Log Analysis indicates that this adapter has failed due to a Tamper Error

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578
-

2578-604 2578-604

Explanation: Error Log Analysis indicates that this adapter has failed due to a Low Battery

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2579
-

2578-605 2578-605

Explanation: Error Log Analysis indicates that this adapter has failed due to a Request Timeout

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578
-

2578-606 2578-606

Explanation: Error Log Analysis indicates that this adapter has failed due to a MB (Mini Boot) Request Timeout

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578
-

2578-607 2578-607

Explanation: Error Log Analysis indicates that this adapter has failed due to a DMA Timeout

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578
-

2580-102 2580-102

Explanation: A critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-103 2580-103

Explanation: Non-critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-104 2580-104

Explanation: An unrecoverable failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-122 2580-122

Explanation: A critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

2580-123 2580-123

Explanation: A non-critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

2580-124 2580-124

Explanation: An unrecoverable power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

2580-132 • 2580-164

- FFC_152

2580-132 2580-132

Explanation: A critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166

2580-133 2580-133

Explanation: A non-critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166

2580-134 2580-134

Explanation: An unrecoverable fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_2580

2580-148 2580-148

Explanation: The enclosure indicates a temperature threshold warning.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_2580

2580-149 2580-149

Explanation: The enclosure indicates a temperature threshold failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_2580

2580-152 2580-152

Explanation: A critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-153 2580-153

Explanation: A non-critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-154 2580-154

Explanation: An unrecoverable repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-162 2580-162

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-163 2580-163

Explanation: A non-critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-164 2580-164

Explanation: An unrecoverable VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-172 **2580-172**

Explanation: A critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-173 **2580-173**

Explanation: A non-critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-174 **2580-174**

Explanation: An unrecoverable enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-182 **2580-182**

Explanation: A critical failure has occurred on a user defined element.

Failing Item:

- FFC_2580

2580-183 **2580-183**

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-184 **2580-184**

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-192 **2580-192**

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-193 **2580-193**

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-194 **2580-194**

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-201 **2580-201**

Explanation: Device configuration error.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
- FFC_891

2580-202 **2580-202**

Explanation: The enclosure failed to open.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
- FFC_891

2580-203 **2580-203**

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

2580-204 • 2581-602

- FFC_2580
- FFC_891

2580-204 2580-204

Explanation: There is a critical power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

2580-205 2580-205

Explanation: There is a redundant power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

2581-101 2581-101

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2581

2581-102 2581-102

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2581

2581-103 2581-103

Explanation: Memory Test Failure

Failing Item:

- FFC_2581

2581-104 2581-104

Explanation: NVRAM Test Failure

Failing Item:

- FFC_2581

2581-105 2581-105

Explanation: Flash Test Failure

Failing Item:

- FFC_2581

2581-106 2581-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2581

2581-107 2581-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2581

2581-108 2581-108

Explanation: DMA Test Failure

Failing Item:

- FFC_2581

2581-109 2581-109

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221

2581-110 2581-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2581

2581-201 2581-201

Explanation: Configuration and I/O Register Test Failure

Failing Item:

- FFC_2581
- FFC_221

2581-601 2581-601

Explanation: Error log analysis indicates that the adapter self-test failed.

Failing Item:

- FFC_2581

2581-602 2581-602

Explanation: Error log analysis indicates that an NVRAM failure on the adapter has occurred.

Failing Item:

- FFC_2581

2581-603 2581-603

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2581
-

2581-604 2581-604

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2581
-

2581-605 2581-605

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2581
-

2581-606 2581-606

Explanation: Error log analysis indicates that an unknown adapter hardware error has occurred.

Failing Item:

- FFC_2581
-

2583-101 2583-101

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2583
-

2583-102 2583-102

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2583
-

2583-103 2583-103

Explanation: Memory Test Failure

Failing Item:

- FFC_2583
-

2583-104 2583-104

Explanation: NVRAM Test Failure

Failing Item:

- FFC_2583
-

2583-105 2583-105

Explanation: Flash Test Failure

Failing Item:

- FFC_2583
-

2583-106 2583-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2583
-

2583-107 2583-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2583
-

2583-108 2583-108

Explanation: DMA Test Failure

Failing Item:

- FFC_2583
-

2583-109 2583-109

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2583-110 2583-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2583
-

2583-201 2583-201

Explanation: Configuration and I/O Register Test Failure

Failing Item:

- FFC_2583
 - FFC_221
-

2583-601 2583-601

Explanation: Error log analysis indicates that the adapter self-test failed.

Failing Item:

- FFC_2583
-

2583-602 2583-602

Explanation: Error log analysis indicates that an NVRAM failure on the adapter has occurred.

Failing Item:

- FFC_2583
-

2583-603 2583-603

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2583
-

2583-604 2583-604

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2583
-

2583-605 2583-605

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2583
-

2583-606 2583-606

Explanation: Error log analysis indicates that an unknown adapter hardware error has occurred.

Failing Item:

- FFC_2583
-

2584-101 2584-101

Explanation: Unable to open DVD-ROM device driver.

Failing Item:

- FFC_2584
-

2584-201 2584-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2584-202 2584-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2584
 - FFC_25A0
-

- MEDIA
-

2584-203 2584-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2584-204 2584-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2584
-

2584-205 2584-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2584
 - MEDIA
-

2584-206 2584-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2584
-

2584-207 2584-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2584
-

2584-210 2584-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2584
-

2584-701 2584-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2584
-

2584-702 2584-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2584
-

2585-101 2585-101

Explanation: Unable to open DVD-ROM device driver.

Failing Item:

- FFC_2585
-

2585-201 2585-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2585-202 2585-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2585
 - FFC_25A0
 - MEDIA
-

2585-203 2585-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2585-204 2585-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2585
-

2585-205 2585-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2585
 - MEDIA
-

2585-206 2585-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2585
-

2585-207 2585-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2585
-

2585-210 2585-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2585
-

2585-701 2585-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2585
-

2585-702 2585-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2585
-

2587-101 2587-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2587
-

2587-201 2587-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2587-202 2587-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2587
 - FFC_25A0
 - MEDIA
-

2587-203 2587-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A0
-

2587-204 2587-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2587
-

2587-205 2587-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2587
 - MEDIA
-

2587-206 2587-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2587
-

2587-208 2587-208

Explanation: The DVD-ROM Play Audio command failed.

Failing Item:

- FFC_2587
 - MEDIA
-

2587-209 2587-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2587
-

2587-210 2587-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_2587
-

2587-211 2587-211

Explanation: DVD-ROM drive indicates an error.

Failing Item:

- FFC_2587
-

2587-212 2587-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2587
 - MEDIA
-

2587-701 2587-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2587
-

2587-702 2587-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2587
-

2588-101 2588-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2588
-

2588-201 2588-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2588-202 2588-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2588
 - FFC_25A0
 - MEDIA
-

2588-203 2588-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A0
-

2588-204 2588-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2588
-

2588-205 2588-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2588
 - MEDIA
-

2588-206 2588-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2588
-

2588-207 2588-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2588
-

2588-208 2588-208

Explanation: The DVD-ROM Play Audio command failed.

Failing Item:

- FFC_2588
 - MEDIA
-

2588-209 2588-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2588
-

2588-210 2588-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_2588
-

2588-211 2588-211

Explanation: DVD-ROM drive indicates an error.

Failing Item:

- FFC_2588
-

2588-212 2588-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2588
 - MEDIA
-

2588-701 2588-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2588
-

2588-702 2588-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2588
-

2590-101 2590-101

Explanation: Unable to open CD-ROM device driver.

Failing Item:

- FFC_2590
-

2590-201 2590-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2590-202 2590-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2590
 - FFC_25A0
 - MEDIA
-

2590-203 2590-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2590-204 2590-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2590
-

2590-205 2590-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2590
 - MEDIA
-

2590-206 2590-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2590
-

2590-207 2590-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2590
-

2590-208 2590-208

Explanation: The CD-ROM Play Audio command failed.

Failing Item:

- FFC_2590
 - MEDIA
-

2590-209 2590-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2590
-

2590-210 2590-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2590
-

2590-211 2590-211

Explanation: CD-ROM drive indicates an error.

Failing Item:

- FFC_2590
-

2590-701 2590-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2590
-

2590-702 2590-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2590
-

2591-101 2591-101

Explanation: Unable to open DVD-ROM device driver.

Failing Item:

- FFC_2591
-

2591-201 2591-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2591-202 2591-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2591
 - FFC_25A0
 - MEDIA
-

2591-203 2591-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2591-204 2591-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2591
-

2591-205 2591-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2591
 - MEDIA
-

2591-206 2591-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2591
-

2591-207 2591-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2591
-

2591-210 2591-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2591
-

2591-701 2591-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2591
-

2591-702 2591-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2591
-

2592-101 2592-101

Explanation: Unable to open slimline DVD-ROM device driver.

Failing Item:

- FFC_2592
-

2592-201 2592-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2592-202 2592-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2592
 - FFC_25A0
-

- MEDIA
-

2592-203 2592-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2592-204 2592-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2592
-

2592-205 2592-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2592
 - MEDIA
-

2592-206 2592-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2592
-

2592-207 2592-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2592
-

2592-210 2592-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2592
-

2592-701 2592-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2592
-

2592-702 2592-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2592
-

2593-101 2593-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2593
-

2593-201 2593-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2593-202 2593-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2593
 - FFC_25A0
 - MEDIA
-

2593-203 2593-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A0
-

2593-204 2593-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2593
-

2593-205 2593-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2593
 - MEDIA
-

2593-206 2593-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2593
-

2593-207 2593-207

Explanation: A media error was detected.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2593
-

2593-208 2593-208

Explanation: The DVD-ROM Play Audio command failed.

Failing Item:

- FFC_2593
 - MEDIA
-

2593-209 2593-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2593
-

2593-210 2593-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_2593
-

2593-211 2593-211

Explanation: DVD-ROM drive indicates an error.

Failing Item:

- FFC_2593
-

2593-212 2593-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2593
 - MEDIA
-

2593-701 2593-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2593
-

2593-702 2593-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2593
-

25A2-101 25A2-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A2
-

25A2-201 25A2-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_2D02
-

25A2-202 25A2-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_25A2
 - FFC_2D02
 - MEDIA
-

25A2-203 25A2-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_2D02
-

25A2-204 25A2-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_25A2
-

25A2-205 25A2-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_25A2
 - MEDIA
-

25A2-206 25A2-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_25A2
-

25A2-207 25A2-207

Explanation: A media error was detected.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_25A2
-

25A2-208 25A2-208

Explanation: The Play Audio command failed.

Failing Item:

- FFC_25A2
 - MEDIA
-

25A2-209 25A2-209

Explanation: No tone during audio test.

Failing Item:

- FFC_25A2
-

25A2-210 25A2-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_25A2
-

25A2-211 25A2-211

Explanation: Drive indicates an error.

Failing Item:

- FFC_25A2
-

25A2-212 25A2-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_25A2
 - MEDIA
-

25A2-701 25A2-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_25A2
-

25A2-702 • 25A4-106

25A2-702 25A2-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_25A2
-

25A3-101 25A3-101

Explanation: Enhanced Error Handling Failure on Bus

Failing Item:

- FFC_25A3
-

25A3-102 25A3-102

Explanation: Adapter I/O Register Test Failure

Failing Item:

- FFC_25A3
-

25A3-103 25A3-103

Explanation: Timer Test Failure

Failing Item:

- FFC_25A3
-

25A3-104 25A3-104

Explanation: Interrupt Test Failure

Failing Item:

- FFC_25A3
-

25A3-105 25A3-105

Explanation: Internal Loop Back Test Failure

Failing Item:

- FFC_25A3
-

25A3-106 25A3-106

Explanation: External Loop Back Test Failure

Failing Item:

- FFC_25A3
-

25A3-201 25A3-201

Explanation: PCI COnfiguration I/O Test Failure

Failing Item:

- FFC_25A3
 - FFC_221
-

25A3-601 25A3-601

Explanation: Error log analysis indicates that this device has failed due to an adapter reset failure.

Failing Item:

- FFC_25A3
-

25A3-602 25A3-602

Explanation: Error log analysis indicates that this device has failed due to a hardware error.

Failing Item:

- FFC_25A3
-

25A4-101 25A4-101

Explanation: Enhanced Error Handling Failure on Bus

Failing Item:

- FFC_25A4
-

25A4-102 25A4-102

Explanation: Adapter I/O Register Test Failure

Failing Item:

- FFC_25A4
-

25A4-103 25A4-103

Explanation: Timer Test Failure

Failing Item:

- FFC_25A4
-

25A4-104 25A4-104

Explanation: Interrupt Test Failure

Failing Item:

- FFC_25A4
-

25A4-105 25A4-105

Explanation: Internal Loop Back Test Failure

Failing Item:

- FFC_25A4
-

25A4-106 25A4-106

Explanation: External Loop Back Test Failure

Failing Item:

- FFC_25A4
-

25A4-201 25A4-201

Explanation: PCI Configuration I/O Test Failure

Failing Item:

- FFC_25A4
 - FFC_221
-

25A4-601 25A4-601

Explanation: Error log analysis indicates that this device has failed due to an adapter reset failure.

Failing Item:

- FFC_25A4
-

25A4-602 25A4-602

Explanation: Error log analysis indicates that this device has failed due to a hardware error.

Failing Item:

- FFC_25A4
-

25B9-101 25B9-101

Explanation: Local Memory Test Failure

Failing Item:

- FFC_25B9
-

25B9-102 25B9-102

Explanation: Local Memory Test Failure

Failing Item:

- FFC_25B9
-

25B9-103 25B9-103

Explanation: Memory Test Failure

Failing Item:

- FFC_25B9
-

25B9-104 25B9-104

Explanation: NVRAM Test Failure

Failing Item:

- FFC_25B9
-

25B9-105 25B9-105

Explanation: Flash Test Failure

Failing Item:

- FFC_25B9
-

25B9-106 25B9-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_25B9
-

25B9-107 25B9-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_25B9
-

25B9-108 25B9-108

Explanation: DMA Test Failure

Failing Item:

- FFC_25B9
-

25B9-109 25B9-109

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

25B9-110 25B9-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_25B9
-

25B9-201 25B9-201

Explanation: Configuration and I/O Register Test Failure

Failing Item:

- FFC_25B9
 - FFC_221
-

25B9-601 25B9-601

Explanation: Error log analysis indicates that the adapter self-test failed.

Failing Item:

- FFC_25B9
-

25B9-602 25B9-602

Explanation: Error log analysis indicates that an NVRAM failure on the adapter has occurred.

Failing Item:

- FFC_25B9
-

25B9-603 25B9-603

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_25B9

25B9-604 25B9-604

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_25B9

25B9-605 25B9-605

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_25B9

25B9-606 25B9-606

Explanation: Error log analysis indicates that an unknown adapter hardware error has occurred.

Failing Item:

- FFC_25B9

25C0-101 25C0-101

Explanation: Enhanced Error Handling Failure on bus.

Failing Item:

- FFC_221

25C0-102 25C0-102

Explanation: Enhanced Error Handling Logic Failure.

Failing Item:

- FFC_293

25C0-103 25C0-103

Explanation: Enhanced Error Handling Failure while testing adapter.

Failing Item:

- FFC_25C0
- FFC_221

25C0-104 25C0-104

Explanation: Internal wrap test failure (10 Mbps).

Failing Item:

- FFC_25C0

25C0-105 25C0-105

Explanation: Internal wrap test failure (100 Mbps).

Failing Item:

- FFC_25C0

25C0-106 25C0-106

Explanation: Internal wrap test failure (1000 Mbps).

Failing Item:

- FFC_25C0

25C0-107 25C0-107

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_25C0

25C0-108 25C0-108

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_25C0

25C0-201 25C0-201

Explanation: Registers test failure.

Failing Item:

- FFC_25C0
- FFC_221

25C0-701 25C0-701

Explanation: Failure to initialize due to a self-test failure.

Failing Item:

- FFC_25C0

25C0-702 25C0-702

Explanation: Failure to recover from an EEH event.

Failing Item:

- FFC_25C0
- FFC_221

25C0-703 25C0-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter.

Failing Item:

- FFC_25C0
-

25C0-704 **25C0-704****Explanation:** Device has attempted error recover.**Failing Item:**

- FFC_25C0
 - FFC_221
-

25C0-705 **25C0-705****Explanation:** Device has attempted error recovery.**Failing Item:**

- FFC_25C0
 - FFC_221
-

25C1-101 **25C1-101****Explanation:** Enhanced Error Handling Failure on bus.**Failing Item:**

- FFC_221
-

25C1-102 **25C1-102****Explanation:** Enhanced Error Handling Logic Failure.**Failing Item:**

- FFC_293
-

25C1-103 **25C1-103****Explanation:** Enhanced Error Handling Failure while testing adapter.**Failing Item:**

- FFC_25C1
 - FFC_221
-

25C1-104 **25C1-104****Explanation:** Internal wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-105 **25C1-105****Explanation:** Internal wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-106 **25C1-106****Explanation:** Internal wrap test failure (1000 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-107 **25C1-107****Explanation:** External wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-108 **25C1-108****Explanation:** External wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-201 **25C1-201****Explanation:** Registers test failure.**Failing Item:**

- FFC_25C1
 - FFC_221
-

25C1-701 **25C1-701****Explanation:** Failure to initialize due to a self-test failure.**Failing Item:**

- FFC_25C1
-

25C1-702 **25C1-702****Explanation:** Failure to recover from an EEH event.**Failing Item:**

- FFC_25C1
 - FFC_221
-

25C1-703 **25C1-703****Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter.**Failing Item:**

- FFC_25C1
-

25C1-704 **25C1-704****Explanation:** Device has attempted error recovery.**Failing Item:**

- FFC_25C1
 - FFC_221
-

25C1-705 **25C1-705****Explanation:** Device has attempted error recovery.**Failing Item:**

- FFC_25C1
 - FFC_221
-

25C2-101 • 25C3-103

25C2-101 25C2-101

Explanation: Enhanced Error Handling Failure on bus.

Failing Item:

- FFC_221
-

25C2-103 25C2-103

Explanation: Enhanced Error Handling Failure while testing adapter.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-104 25C2-104

Explanation: Internal wrap test failure (10 Mbps).

Failing Item:

- FFC_25C2
-

25C2-105 25C2-105

Explanation: Internal wrap test failure (100 Mbps).

Failing Item:

- FFC_25C2
-

25C2-106 25C2-106

Explanation: Internal wrap test failure (1000 Mbps).

Failing Item:

- FFC_25C2
-

25C2-107 25C2-107

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_25C2
-

25C2-108 25C2-108

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_25C2
-

25C2-201 25C2-201

Explanation: Registers test failure.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-701 25C2-701

Explanation: Failure to initialize due to a self-test failure.

Failing Item:

- FFC_25C2
-

25C2-702 25C2-702

Explanation: Failure to recover from an EEH event.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-703 25C2-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter.

Failing Item:

- FFC_25C2
-

25C2-704 25C2-704

Explanation: Device has attempted error recovery.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-705 25C2-705

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_25C3
 - FFC_221
-

25C3-101 25C3-101

Explanation: Enhanced Error Handling Failure on bus.

Failing Item:

- FFC_25C3
-

25C3-103 25C3-103

Explanation: Enhanced Error Handling Failure while testing adapter.

Failing Item:

- FFC_25C3
 - FFC_221
-

25C3-104 **25C3-104****Explanation:** Internal wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-105 **25C3-105****Explanation:** Internal wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-106 **25C3-106****Explanation:** Internal wrap test failure (1000 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-107 **25C3-107****Explanation:** External wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-108 **25C3-108****Explanation:** External wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-201 **25C3-201****Explanation:** Registers test failure.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-701 **25C3-701****Explanation:** Failure to initialize due to a self-test failure.**Failing Item:**

- FFC_25C3
-

25C3-702 **25C3-702****Explanation:** Failure to recover from an EEH event.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-703 **25C3-703****Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter.**Failing Item:**

- FFC_25C3
-

25C3-704 **25C3-704****Explanation:** Device has attempted error recovery.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-705 **25C3-705****Explanation:** Enhanced Error Handling failure on bus.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C4-201 **25C4-201****Explanation:** Configuration Error.**Failing Item:**

- FFC_25C4
 - FFC_221
-

25C4-601 **25C4-601****Explanation:** Download firmware error.**Failing Item:**

- FFC_25C4
-

25C4-602 **25C4-602****Explanation:** EEPROM read error.**Failing Item:**

- FFC_25C4
-

25C4-701 **25C4-701****Explanation:** Permanent adapter failure.**Failing Item:**

- FFC_25C4
 - FFC_221
-

25D0-099 **25D0-099****Explanation:** Audio System error log entry.**Failing Item:**

- FFC_25D0
-

25D0-101 • 25E5-003

25D0-101 25D0-101

Explanation: Audio Subsystem failed.

Failing Item:

- FFC_25D0
 - SOFTWARE
-

25D0-102 25D0-102

Explanation: CS4232 failed.

Failing Item:

- FFC_25D0
-

25D0-103 25D0-103

Explanation: Clock control failed.

Failing Item:

- FFC_25D0
-

25D0-108 25D0-108

Explanation: Loop back failed.

Failing Item:

- FFC_25D0
-

25D2-101 25D2-101

Explanation: Adapter configuration error .

Failing Item:

- FFC_25D2
-

25D2-710 25D2-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_25D2
-

25D2-711 25D2-711

Explanation: Excessive temporary adapter failures.

Failing Item:

- FFC_25D2
-

25D3-101 25D3-101

Explanation: Adapter configuration error .

Failing Item:

- FFC_25D3
-

25D3-710 25D3-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_25D3
-

25D3-711 25D3-711

Explanation: Excessive temporary adapter failures.

Failing Item:

- FFC_25D3
-

25D5-101 25D5-101

Explanation: Adapter configuration error .

Failing Item:

- FFC_25D5
-

25D5-710 25D5-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_25D5
-

25D5-711 25D5-711

Explanation: Excessive temporary adapter failures.

Failing Item:

- FFC_25D5
-

25E5-001 25E5-001

Explanation: Adapter problem

Failing Item:

- FFC_25E5
 - FFC_221
 - MONITOR
 - CABLE
-

25E5-002 25E5-002

Explanation: Display problem

Failing Item:

- FFC_25E5
 - MONITOR
 - CABLE
-

25E5-003 25E5-003

Explanation: Software error

Failing Item:

- SOFTWARE

- FFC_25E5

25E6-001 25E6-001

Explanation: Adapter problem

Failing Item:

- FFC_25E6
- FFC_221
- MONITOR_OR_CABLE
- FFC_25E7

25E6-002 25E6-002

Explanation: Display problem

Failing Item:

- FFC_25E6
- MONITOR_OR_CABLE
- FFC_25E7

25E6-003 25E6-003

Explanation: Software error

Failing Item:

- SOFTWARE
- FFC_25E6

2502-102E 2502-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2502-3002 2502-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2502-3010 2502-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2502-3020 2502-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2502-3100 2502-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2502-3109 2502-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2502-3110 2502-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2502-4010 2502-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2502-4020 2502-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2502-4030 2502-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2502-4040 2502-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2502-4041 2502-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2502-4050 2502-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2502-4060 2502-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2502-4100 2502-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2502-4101 2502-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2502-4110 2502-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2502-4150 2502-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
 - FFC_221
-

2502-4160 2502-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
 - FFC_221
-

2502-7001 2502-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2502-8150 2502-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-8157 2502-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-9000 2502-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2502-9001 2502-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2502-9002 2502-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2502-9008 2502-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2502-9010 2502-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2502-9011 2502-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2502-9020 2502-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2502-9021 2502-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2502-9022 2502-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2502-9023 2502-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2502-9024 2502-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2502-9025 2502-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2502-9026 2502-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2502-9027 2502-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2502-9028 2502-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2502-9029 2502-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2502-9030 2502-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2502-9031 2502-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2502-9032 2502-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2502-9041 2502-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2502-9042 2502-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2502-9050 2502-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2502-9051 2502-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2502-9052 2502-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2502-9054 • 2502-FFF4

2502-9054 2502-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2502-9060 2502-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2502-9061 2502-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2502-9062 2502-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2502-9063 2502-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2502-9073 2502-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2502-9074 2502-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2502-9075 2502-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2502-9076 2502-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2502-9081 2502-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2502-9082 2502-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2502-9090 2502-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2502-9091 2502-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2502-9092 2502-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2502-FF3D 2502-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-FFF3 2502-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2502-FFF4 2502-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2502-FFF6 **2502-FFF6**

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2502-FFFA **2502-FFFA**

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2502-FFFE **2502-FFFE**

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2503-102E **2503-102E**

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-3002 **2503-3002**

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-3010 **2503-3010**

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-3020 **2503-3020**

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2503-3100 **2503-3100**

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2503-3109 **2503-3109**

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2503-3110 **2503-3110**

Explanation: Disk bus interface error.

Response: Use MAP3150.

2503-4010 **2503-4010**

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2503-4020 **2503-4020**

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2503-4030 **2503-4030**

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2503-4040 **2503-4040**

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2503-4041 **2503-4041**

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2503-4050 2503-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2503-4060 2503-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2503-4100 2503-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2503-4101 2503-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2503-4110 2503-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2503-4150 2503-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
 - FFC_221
-

2503-4160 2503-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
 - FFC_221
-

2503-7001 2503-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-8008 2503-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2503-8009 2503-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2503-8150 2503-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-8157 2503-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-9000 2503-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2503-9001 2503-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2503-9002 2503-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2503-9008 2503-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2503-9010 2503-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2503-9011 2503-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2503-9020 2503-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2503-9021 2503-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2503-9022 2503-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2503-9023 2503-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2503-9024 2503-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2503-9025 2503-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2503-9026 2503-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2503-9027 2503-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2503-9028 2503-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2503-9029 2503-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2503-9030 2503-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2503-9031 2503-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2503-9032 2503-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2503-9041 2503-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2503-9042 2503-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2503-9050 2503-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2503-9051 2503-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2503-9052 2503-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2503-9054 2503-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2503-9060 2503-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2503-9061 2503-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2503-9062 2503-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2503-9063 2503-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2503-9073 2503-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2503-9074 2503-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2503-9075 2503-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2503-9076 2503-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2503-9081 2503-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2503-9082 2503-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2503-9090 2503-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2503-9091 2503-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2503-9092 2503-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2503-FF3D 2503-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-FFF3 2503-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2503-FFF4 2503-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-FFF6 2503-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-FFFA 2503-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-FFFE 2503-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2504-102E 2504-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-3002 2504-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2504-3010 2504-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-3020 2504-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2504-3100 2504-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2504-3109 2504-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2504-3110 2504-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2504-4010 2504-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2504-4020 2504-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2504-4030 2504-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2504-4040 2504-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2504-4041 2504-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2504-4050 2504-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2504-4060 2504-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2504-4100 2504-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2504-4101 2504-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2504-4110 2504-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2504-4150 2504-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
 - FFC_221
-

2504-4160 2504-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
 - FFC_221
-

2504-7001 2504-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-8008 2504-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2504-8009 2504-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2504-8150 2504-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-8157 2504-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-9000 2504-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2504-9001 2504-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2504-9002 2504-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2504-9008 2504-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2504-9010 2504-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2504-9011 2504-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2504-9020 2504-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2504-9021 2504-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2504-9022 2504-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2504-9023 2504-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2504-9024 2504-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2504-9025 2504-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2504-9026 2504-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2504-9027 2504-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2504-9028 2504-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2504-9029 2504-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2504-9030 2504-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2504-9031 2504-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2504-9032 2504-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2504-9041 2504-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2504-9042 2504-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2504-9050 2504-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2504-9051 2504-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2504-9052 2504-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2504-9054 2504-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2504-9060 2504-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2504-9061 2504-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2504-9062 2504-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2504-9063 2504-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2504-9073 2504-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2504-9074 2504-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2504-9075 2504-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2504-9076 2504-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2504-9081 2504-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2504-9082 2504-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2504-9090 2504-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2504-9091 2504-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2504-9092 2504-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2504-FF3D 2504-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-FFF3 2504-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2504-FFF4 2504-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-FFF6 2504-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-FFFA 2504-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-FFFE 2504-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2505-102E 2505-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-3002 2505-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-3010 2505-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-3020 2505-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2505-3100 2505-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2505-3109 2505-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2505-3110 2505-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2505-4010 2505-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2505-4020 2505-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2505-4030 2505-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2505-4040 2505-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2505-4041 2505-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2505-4050 2505-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2505-4060 2505-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2505-4100 2505-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2505-4101 2505-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2505-4110 2505-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2505-4150 2505-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505

- FFC_221
-

2505-4160 2505-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
 - FFC_221
-

2505-7001 2505-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-8150 2505-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-8157 2505-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-9000 2505-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2505-9001 2505-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2505-9002 2505-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2505-9008 2505-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2505-9010 2505-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2505-9011 2505-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2505-9020 2505-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2505-9021 2505-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2505-9022 2505-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2505-9023 2505-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2505-9024 2505-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2505-9025 2505-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2505-9026 2505-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2505-9027 2505-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2505-9028 2505-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2505-9029 2505-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2505-9030 2505-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2505-9031 2505-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2505-9032 2505-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2505-9041 2505-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2505-9042 2505-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2505-9050 2505-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2505-9051 2505-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2505-9052 2505-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2505-9054 2505-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2505-9060 2505-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2505-9061 2505-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2505-9062 2505-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2505-9063 2505-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2505-9073 2505-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2505-9074 2505-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2505-9075 2505-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2505-9076 2505-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2505-9081 2505-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2505-9082 2505-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2505-9090 2505-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2505-9091 2505-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2505-9092 2505-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2505-FF3D 2505-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-FFF3 2505-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2505-FFF4 2505-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2505-FFF6 2505-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2505-FFFA 2505-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2505-FFFE 2505-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2512-102E 2512-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

2512-3002 2512-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

2512-3010 2512-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

2512-3020 2512-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2512-3100 2512-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2512-3101 2512-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2512-3109 2512-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2512-3110 2512-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2512-7001 2512-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722

2512-8008 2512-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01

2512-8009 2512-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

2512-9000 • 2512-9031

- FFC_2D01

2512-9000 2512-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2512-9001 2512-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2512-9002 2512-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2512-9008 2512-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2512-9010 2512-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2512-9011 2512-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2512-9020 2512-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2512-9021 2512-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2512-9022 2512-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2512-9023 2512-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2512-9024 2512-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2512-9025 2512-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2512-9026 2512-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190. .

2512-9027 2512-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2512-9028 2512-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2512-9029 2512-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2512-9030 2512-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2512-9031 2512-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2512-9032 2512-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2512-9041 2512-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2512-9042 2512-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2512-9050 2512-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2512-9051 2512-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2512-9052 2512-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2512-9054 2512-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2512-9060 2512-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2512-9061 2512-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2512-9062 2512-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2512-9063 2512-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2512-9073 2512-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2512-9074 2512-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2512-9081 2512-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2512-9082 2512-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2512-9090 2512-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2512-9091 2512-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2512-9092 2512-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2512-9200 2512-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2512-FFF3 2512-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2512-FFF4 2512-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2512-FFF6 2512-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2512-FFFA 2512-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2512-FFFE 2512-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2513-102E 2513-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-3002 2513-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-3010 2513-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-3020 2513-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2513-3100 2513-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2513-3101 2513-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2513-3109 2513-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2513-3110 2513-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2513-7001 2513-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2513-8008 2513-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D06
-

2513-8009 2513-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D06

2513-9000 2513-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2513-9001 2513-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2513-9002 2513-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2513-9008 2513-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2513-9010 2513-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2513-9011 2513-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2513-9020 2513-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2513-9021 2513-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2513-9022 2513-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2513-9023 2513-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2513-9024 2513-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2513-9025 2513-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2513-9026 2513-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2513-9027 2513-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2513-9028 2513-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2513-9029 2513-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2513-9030 2513-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2513-9031 2513-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2513-9032 2513-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2513-9041 2513-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2513-9042 2513-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2513-9050 2513-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2513-9051 2513-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2513-9052 2513-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2513-9054 2513-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2513-9060 2513-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2513-9061 2513-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2513-9062 2513-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2513-9063 2513-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2513-9073 2513-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2513-9074 2513-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2513-9081 2513-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2513-9082 2513-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2513-9090 2513-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2513-9091 2513-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2513-9092 2513-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2513-9200 2513-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2513-FFF3 2513-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035

2513-FFF4 2513-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051

Failing Item:

- FFC_722
-

2513-FFF6 2513-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-FFFA 2513-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-FFFE 2513-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2514-102E 2514-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2514-3002 2514-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2514-3010 2514-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2514-3020 2514-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2514-3100 2514-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2514-3101 2514-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2514-3109 2514-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2514-3110 2514-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2514-7001 2514-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2514-8008 2514-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D03
-

2514-8009 2514-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

2514-9000 • 2514-9031

- FFC_2D03

2514-9000 2514-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2514-9001 2514-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2514-9002 2514-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2514-9008 2514-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2514-9010 2514-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2514-9011 2514-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2514-9020 2514-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2514-9021 2514-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2514-9022 2514-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2514-9023 2514-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2514-9024 2514-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2514-9025 2514-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2514-9026 2514-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2514-9027 2514-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2514-9028 2514-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2514-9029 2514-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2514-9030 2514-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2514-9031 2514-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2514-9032 2514-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2514-9041 2514-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2514-9042 2514-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2514-9050 2514-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2514-9051 2514-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2514-9052 2514-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2514-9054 2514-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2514-9060 2514-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2514-9061 2514-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2514-9062 2514-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2514-9063 2514-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2514-9073 2514-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2514-9074 2514-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2514-9081 2514-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2514-9082 2514-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2514-9090 2514-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2514-9091 2514-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2514-9092 2514-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2514-9200 **2514-9200****Explanation:** Identify disk to be replaced.**Response:** Use MAP3131.

2514-FFF3 **2514-FFF3****Explanation:** Disk media format bad.**Response:** If the problem persists, use MAP3035.

2514-FFF4 **2514-FFF4****Explanation:** Disk drive problem.**Response:** If the problem persists, use MAP3051.**Failing Item:**

- FFC_722

2514-FFF6 **2514-FFF6****Explanation:** Disk detected recoverable error.**Response:** If the problem persists, use MAP3150.**Failing Item:**

- FFC_722

2514-FFFA **2514-FFFA****Explanation:** Temporary disk bus error.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_722

2514-FFFE **2514-FFFE****Explanation:** Temporary disk bus error.**Response:** Use MAP3150.

2515-102E **2515-102E****Explanation:** Out of alternate disk storage for storage.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2515-3002 **2515-3002****Explanation:** Addressed device failed to respond to selection.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2515-3010 **2515-3010****Explanation:** Disk returned wrong response to adapter.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2515-3020 **2515-3020****Explanation:** Storage subsystem configuration error.**Response:** Use MAP3150.

2515-3100 **2515-3100****Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2515-3109 **2515-3109****Explanation:** Adapter timed out a disk command.**Response:** Use MAP3150.

2515-3110 **2515-3110****Explanation:** Disk bus interface error.**Response:** Use MAP3150.

2515-4010 **2515-4010****Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142.

2515-4020 **2515-4020****Explanation:** Configuration error, connections exceed IOA design limits.**Response:** Use MAP3143.

2515-4030 **2515-4030****Explanation:** Configuration error, incorrect multipath connection.**Response:** Use MAP3144.

2515-4040 **2515-4040****Explanation:** Configuration error, incomplete multipath connection between controller and enclosure detected.**Response:** Use MAP3144.

2515-4041 2515-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2515-4050 2515-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2515-4060 2515-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2515-4100 2515-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2515-4101 2515-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2515-4110 2515-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2515-4150 2515-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
 - FFC_221
-

2515-4160 2515-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
- FFC_221

2515-7001 2515-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2515-8150 2515-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
-

2515-8157 2515-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
-

2515-9000 2515-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2515-9001 2515-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2515-9002 2515-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2515-9008 2515-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2515-9010 2515-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2515-9011 2515-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2515-9020 2515-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2515-9021 2515-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2515-9022 2515-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2515-9023 2515-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2515-9024 2515-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2515-9025 2515-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2515-9026 2515-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2515-9027 2515-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2515-9028 2515-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2515-9029 2515-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2515-9030 2515-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2515-9031 2515-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2515-9032 2515-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2515-9041 2515-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2515-9042 2515-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2515-9050 2515-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2515-9051 2515-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2515-9052 2515-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2515-9054 2515-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2515-9060 2515-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2515-9061 2515-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2515-9062 2515-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2515-9063 2515-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2515-9073 2515-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2515-9074 2515-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2515-9075 2515-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2515-9076 2515-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2515-9081 2515-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2515-9082 2515-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2515-9090 2515-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2515-9091 2515-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2515-9092 2515-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2515-FF3D 2515-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
-

2515-FFF3 2515-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2515-FFF4 2515-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2515-FFF6 • 2516-4041

2515-FFF6 2515-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2515-FFFA 2515-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2515-FFFE 2515-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2516-102E 2516-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-3002 2516-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-3010 2516-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-3020 2516-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2516-3100 2516-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2516-3109 2516-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2516-3110 2516-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2516-4010 2516-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2516-4020 2516-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2516-4030 2516-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2516-4040 2516-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2516-4041 2516-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2516-4050 2516-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2516-4060 2516-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2516-4100 2516-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2516-4101 2516-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2516-4110 2516-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2516-4150 2516-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
 - FFC_221
-

2516-4160 2516-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
 - FFC_221
-

2516-7001 2516-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-8150 2516-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-8157 2516-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-9000 2516-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2516-9001 2516-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2516-9002 2516-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2516-9008 2516-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2516-9010 2516-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2516-9011 2516-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2516-9020 2516-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2516-9021 2516-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2516-9022 2516-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2516-9023 2516-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2516-9024 2516-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2516-9025 2516-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2516-9026 2516-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2516-9027 2516-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2516-9028 2516-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2516-9029 2516-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2516-9030 2516-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2516-9031 2516-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2516-9032 2516-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2516-9041 2516-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2516-9042 2516-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2516-9050 2516-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2516-9051 2516-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2516-9052 2516-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2516-9054 2516-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2516-9060 2516-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2516-9061 2516-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2516-9062 2516-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2516-9063 2516-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2516-9073 2516-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2516-9074 2516-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2516-9075 2516-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2516-9076 2516-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2516-9081 2516-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2516-9082 2516-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2516-9090 2516-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2516-9091 2516-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2516-9092 2516-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2516-FF3D 2516-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-FFF3 2516-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2516-FFF4 2516-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-FFF6 2516-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-FFFA 2516-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-FFFE 2516-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2517-102E 2517-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2517-3002 2517-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2517-3010 2517-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2517-3020 2517-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2517-3100 2517-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2517-3109 2517-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2517-3110 2517-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2517-4010 2517-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2517-4020 2517-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2517-4030 2517-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2517-4040 2517-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2517-4041 2517-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2517-4050 2517-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2517-4060 2517-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2517-4100 2517-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2517-4101 2517-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2517-4110 2517-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2517-4150 2517-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
 - FFC_221
-

2517-4160 2517-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
 - FFC_221
-

2517-7001 2517-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2517-8008 2517-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D03
-

2517-8009 2517-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D03
-

2517-8150 2517-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-8157 2517-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-9000 2517-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2517-9001 2517-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2517-9002 2517-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2517-9008 2517-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2517-9010 2517-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2517-9011 2517-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2517-9020 2517-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2517-9021 2517-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2517-9022 2517-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2517-9023 2517-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2517-9024 2517-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2517-9025 2517-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2517-9026 2517-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2517-9027 2517-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2517-9028 2517-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2517-9029 2517-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2517-9030 2517-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2517-9031 2517-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2517-9032 2517-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2517-9041 2517-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2517-9042 2517-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2517-9050 2517-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2517-9051 2517-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2517-9052 2517-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2517-9054 2517-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2517-9060 2517-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2517-9061 2517-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2517-9062 2517-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2517-9063 2517-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2517-9073 2517-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2517-9074 2517-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2517-9075 2517-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2517-9076 2517-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2517-9081 2517-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2517-9082 2517-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2517-9090 2517-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2517-9091 2517-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2517-9092 2517-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2517-FF3D 2517-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-FFF3 **2517-FFF3****Explanation:** Disk media format bad.**Response:** Use MAP3135.

2517-FFF4 **2517-FFF4****Explanation:** Disk drive problem.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2517-FFF6 **2517-FFF6****Explanation:** Disk detected recoverable error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2517-FFFA **2517-FFFA****Explanation:** Temporary disk error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2517-FFFE **2517-FFFE****Explanation:** Temporary disk bus error.**Response:** Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2518-102E **2518-102E****Explanation:** Out of alternate disk storage for storage.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2518-3002 **2518-3002****Explanation:** Addressed device failed to respond to selection.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2518-3010 **2518-3010****Explanation:** Disk returned wrong response to adapter.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2518-3020 **2518-3020****Explanation:** Storage subsystem configuration error.**Response:** Use MAP3150.

2518-3100 **2518-3100****Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2518-3109 **2518-3109****Explanation:** Adapter timed out a disk command.**Response:** Use MAP3150.

2518-3110 **2518-3110****Explanation:** Disk bus interface error.**Response:** Use MAP3150.

2518-4010 **2518-4010****Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142.

2518-4020 **2518-4020****Explanation:** Configuration error, connections exceed IOA design limits.**Response:** Use MAP3143.

2518-4030 **2518-4030****Explanation:** Configuration error, incorrect multipath connection.**Response:** Use MAP3144.

2518-4040 **2518-4040****Explanation:** Configuration error, incomplete multipath connection between controller and enclosure detected.**Response:** Use MAP3144.

2518-4041 2518-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2518-4050 2518-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2518-4060 2518-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2518-4100 2518-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2518-4101 2518-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2518-4110 2518-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2518-4150 2518-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
 - FFC_221
-

2518-4160 2518-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
- FFC_221

2518-7001 2518-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-8008 2518-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D0E
-

2518-8009 2518-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D0E
-

2518-8150 2518-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-8157 2518-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-9000 2518-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2518-9001 2518-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2518-9002 2518-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2518-9008 2518-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2518-9010 2518-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2518-9011 2518-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2518-9020 2518-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2518-9021 2518-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2518-9022 2518-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2518-9023 2518-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2518-9024 2518-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2518-9025 2518-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2518-9026 2518-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2518-9027 2518-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2518-9028 2518-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2518-9029 2518-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2518-9030 2518-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2518-9031 2518-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2518-9032 2518-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2518-9041 2518-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2518-9042 2518-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2518-9050 2518-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2518-9051 2518-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2518-9052 2518-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2518-9054 2518-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2518-9060 2518-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2518-9061 2518-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2518-9062 2518-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2518-9063 2518-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2518-9073 2518-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2518-9074 2518-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2518-9075 2518-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2518-9076 2518-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2518-9081 2518-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2518-9082 2518-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2518-9090 2518-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2518-9091 2518-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2518-9092 2518-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2518-FF3D 2518-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-FFF3 2518-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2518-FFF4 2518-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2518-FFF6 2518-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2518-FFFA 2518-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2518-FFFE 2518-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2519-102E 2519-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2519-3002 2519-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2519-3010 2519-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2519-3020 2519-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2519-3100 2519-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2519-3109 2519-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2519-3110 2519-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2519-4010 2519-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2519-4020 2519-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2519-4030 2519-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2519-4040 2519-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2519-4041 2519-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2519-4050 2519-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2519-4060 2519-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2519-4100 2519-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2519-4101 2519-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2519-4110 2519-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2519-4150 2519-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

- FFC_221
-

2519-4160 2519-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
 - FFC_221
-

2519-7001 2519-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-8008 2519-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D06
-

2519-8009 2519-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D06
-

2519-8150 2519-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-8157 2519-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-9000 2519-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2519-9001 2519-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2519-9002 2519-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2519-9008 2519-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2519-9010 2519-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2519-9011 2519-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2519-9020 2519-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2519-9021 2519-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2519-9022 2519-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2519-9023 2519-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2519-9024 2519-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2519-9025 2519-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2519-9026 2519-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2519-9027 2519-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2519-9028 2519-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2519-9029 2519-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2519-9030 2519-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2519-9031 2519-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2519-9032 2519-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2519-9041 2519-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2519-9042 2519-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2519-9050 2519-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2519-9051 2519-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2519-9052 2519-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2519-9054 2519-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2519-9060 2519-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2519-9061 2519-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2519-9062 2519-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2519-9063 2519-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2519-9073 2519-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2519-9074 2519-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2519-9075 2519-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2519-9076 2519-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2519-9081 2519-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2519-9082 2519-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2519-9090 2519-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2519-9091 2519-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2519-9092 2519-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2519-FF3D 2519-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-FFF3 2519-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2519-FFF4 2519-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-FFF6 2519-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-FFFA 2519-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-FFFE 2519-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

251D-102E 251D-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-3002 251D-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-3010 251D-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-3020 251D-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

251D-3100 251D-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

251D-3109 251D-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

251D-3110 251D-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

251D-4010 251D-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

251D-4020 251D-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

251D-4030 251D-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

251D-4040 251D-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

251D-4041 251D-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

251D-4050 251D-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

251D-4060 251D-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

251D-4100 251D-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

251D-4101 251D-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

251D-4110 251D-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

251D-4150 251D-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
 - FFC_221
-

251D-4160 251D-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
 - FFC_221
-

251D-7001 251D-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-8150 251D-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-8157 251D-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D

251D-9000 • 251D-9031

251D-9000 251D-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

251D-9001 251D-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

251D-9002 251D-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

251D-9008 251D-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

251D-9010 251D-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

251D-9011 251D-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

251D-9020 251D-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

251D-9021 251D-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

251D-9022 251D-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

251D-9023 251D-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

251D-9024 251D-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

251D-9025 251D-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

251D-9026 251D-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

251D-9027 251D-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

251D-9028 251D-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

251D-9029 251D-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

251D-9030 251D-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

251D-9031 251D-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

251D-9032 251D-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

251D-9041 251D-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

251D-9042 251D-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

251D-9050 251D-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

251D-9051 251D-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

251D-9052 251D-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

251D-9054 251D-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

251D-9060 251D-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

251D-9061 251D-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

251D-9062 251D-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

251D-9063 251D-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

251D-9073 251D-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

251D-9074 251D-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

251D-9075 251D-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

251D-9076 251D-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

251D-9081 251D-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

251D-9082 251D-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

251D-9090 251D-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

251D-9091 251D-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

251D-9092 251D-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

251D-FF3D 251D-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-FFF3 251D-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

251D-FFF4 251D-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-FFF6 251D-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-FFFA 251D-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-FFFE 251D-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2522-102E 2522-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2522-3002 2522-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2522-3010 2522-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2522-3020 2522-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2522-3100 2522-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2522-3101 2522-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2522-3109 2522-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2522-3110 2522-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2522-7001 2522-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2522-9000 2522-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2522-9001 2522-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2522-9002 2522-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2522-9008 2522-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2522-9010 2522-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2522-9011 2522-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2522-9020 2522-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2522-9021 2522-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2522-9022 2522-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2522-9023 2522-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012.

2522-9024 2522-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2522-9025 2522-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2522-9026 2522-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2522-9027 2522-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2522-9028 2522-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2522-9029 2522-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2522-9030 2522-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2522-9031 2522-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2522-9032 2522-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2522-9041 2522-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2522-9042 2522-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2522-9050 2522-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2522-9051 2522-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2522-9052 2522-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2522-9054 2522-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2522-9060 2522-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2522-9061 2522-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2522-9062 2522-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2522-9063 2522-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2522-9073 2522-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2522-9074 2522-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2522-9081 2522-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2522-9082 2522-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2522-9090 2522-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2522-9091 2522-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2522-9092 2522-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2522-9200 2522-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2522-FFF3 2522-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035

2522-FFF4 2522-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2522-FFF6 2522-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2522-FFFA 2522-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2522-FFFE 2522-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2523-102E 2523-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-3002 2523-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-3010 2523-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-3020 2523-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2523-3100 2523-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2523-3101 2523-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2523-3109 2523-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2523-3110 2523-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2523-7001 2523-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2523-8008 2523-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526
-

2523-8009 2523-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526
-

2523-9000 2523-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2523-9001 2523-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2523-9002 2523-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2523-9008 2523-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2523-9010 2523-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2523-9011 2523-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2523-9020 2523-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2523-9021 2523-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2523-9022 2523-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2523-9023 2523-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012.

2523-9024 2523-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2523-9025 2523-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2523-9026 2523-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2523-9027 2523-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2523-9028 2523-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2523-9029 2523-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2523-9030 2523-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2523-9031 2523-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2523-9032 2523-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2523-9041 2523-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2523-9042 2523-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2523-9050 2523-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2523-9051 2523-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2523-9052 2523-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2523-9054 2523-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2523-9060 2523-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2523-9061 2523-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2523-9062 2523-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2523-9063 2523-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2523-9073 2523-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2523-9074 2523-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2523-9081 2523-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2523-9082 2523-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2523-9090 2523-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2523-9091 2523-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2523-9092 2523-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2523-9200 2523-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2523-FFF3 2523-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2523-FFF4 2523-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2523-FFF6 2523-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-FFFA 2523-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

2523-FFFE 2523-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2527-102E 2527-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-3002 2527-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-3010 2527-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-3020 2527-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-3100 2527-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-3101 2527-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-3109 2527-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

Failing Item:

- FFC_2527

2527-3110 2527-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

Failing Item:

- FFC_2527

2527-7001 2527-7001

Explanation: Description: Temporary disk data error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

2527-8008 2527-8008

Explanation: Permanent Cache Battery Pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01

2527-8009 2527-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01

2527-9000 2527-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2527-9001 2527-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2527-9002 2527-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2527-9008 2527-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2527-9010 2527-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2527-9011 2527-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2527-9020 2527-9020

Explanation: Description: Two or more disks are missing from a RAID-5 Disk Array.

Response: Use MAP3111.

2527-9021 2527-9021

Explanation: Two or more disks are missing from a RAID-5 Disk Array.

Response: Use MAP3111.

2527-9022 2527-9022

Explanation: Two or more disks are missing from a RAID-5 Disk Array.

Response: Use MAP3111.

2527-9023 2527-9023

Explanation: Description: One or more Disk Array members are not at required physical locations.

Response: Use MAP3012.

2527-9024 2527-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3090.

2527-9025 2527-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2527-9026 2527-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2527-9027 2527-9027

Explanation: Description: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2527-9028 2527-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2527-9029 2527-9029

Explanation: Maximum number of functional Disk Array disks has been exceeded.

Response: Use MAP3190.

2527-9030 2527-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2527-9031 2527-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2527-9032 2527-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2527-9041 2527-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2527-9042 2527-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2527-9050 2527-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3031

2527-9051 2527-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2527-9052 2527-9052

Explanation: Description: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2527-9054 2527-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2527-9060 2527-9060

Explanation: Description: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2527-9061 2527-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2527-9062 2527-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2527-9063 2527-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2527-9073 2527-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2527-9074 2527-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2527-9081 2527-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3090.

2527-9082 2527-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3090.

2527-9090 2527-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2527-9091 2527-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3033.

2527-9092 2527-9092

Explanation: Description: Disk requires Format before use.

Response: Use MAP3134.

2527-9200 2527-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2527-FFF3 2527-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2527-FFF4 2527-FFF4

Explanation: Description: Disk drive problem.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-FFF6 2527-FFF6

Explanation: Description: Disk detected recoverable error.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2527-FFFA 2527-FFFA

Explanation: Temporary disk error.

Response: If the problem persists, use MAP3051.

2527-FFFE 2527-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Failing Item:

- FFC_722
-

2528-102E 2528-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-3002 2528-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-3010 2528-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-3020 2528-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2528-3100 2528-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2528-3101 2528-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2528-3109 2528-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2528-3110 2528-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2528-7001 2528-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2528-9000 2528-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2528-9001 2528-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2528-9002 2528-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2528-9008 2528-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2528-9010 2528-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2528-9011 2528-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2528-9020 2528-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2528-9021 2528-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2528-9022 2528-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2528-9023 2528-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012.

2528-9024 2528-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2528-9025 2528-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2528-9026 2528-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2528-9027 2528-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2528-9028 2528-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2528-9029 2528-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2528-9030 2528-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2528-9031 2528-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2528-9032 2528-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2528-9041 2528-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2528-9042 2528-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2528-9050 2528-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

2528-9051 2528-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2528-9052 2528-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2528-9054 2528-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2528-9060 2528-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2528-9061 2528-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2528-9062 2528-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2528-9063 2528-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2528-9073 2528-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2528-9074 2528-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2528-9081 2528-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2528-9082 2528-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2528-9090 2528-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2528-9091 2528-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2528-9092 2528-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2528-9200 2528-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2528-FFF3 2528-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2528-FFF4 2528-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2528-FFF6 2528-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-FFFA 2528-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

2528-FFFE 2528-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2529-102E 2529-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2529-3002 2529-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2529-3010 2529-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2529-3020 2529-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2529-3100 2529-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2529-3101 2529-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2529-3109 2529-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2529-3110 2529-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2529-7001 2529-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2529-8008 2529-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526
-

2529-8009 2529-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526
-

2529-9000 2529-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2529-9001 2529-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2529-9002 2529-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2529-9008 2529-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2529-9010 2529-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2529-9011 2529-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2529-9020 2529-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2529-9021 2529-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2529-9022 2529-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2529-9023 2529-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2529-9024 2529-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2529-9025 2529-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2529-9026 2529-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2529-9027 2529-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2529-9028 2529-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2529-9029 2529-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2529-9030 2529-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2529-9031 2529-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2529-9032 2529-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2529-9041 2529-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2529-9042 2529-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2529-9050 2529-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

2529-9051 2529-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2529-9052 2529-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2529-9054 2529-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2529-9060 2529-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2529-9061 2529-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2529-9062 2529-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2529-9063 2529-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2529-9073 2529-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2529-9074 2529-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2529-9081 2529-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2529-9082 2529-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2529-9090 2529-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2529-9091 2529-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2529-9092 2529-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2529-9200 2529-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2529-FFF3 2529-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2529-FFF4 2529-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2529-FFF6 2529-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

2529-FFFA 2529-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

2529-FFFE 2529-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

252B-102E 252B-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-3002 252B-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-3010 252B-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-3020 252B-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

252B-3100 252B-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252B-3101 252B-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252B-3109 252B-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

252B-3110 252B-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

252B-7001 252B-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

252B-9000 252B-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252B-9001 252B-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252B-9002 252B-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252B-9008 252B-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

252B-9010 252B-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

252B-9011 252B-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

252B-9020 252B-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252B-9021 252B-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252B-9022 252B-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252B-9023 252B-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

252B-9024 252B-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

252B-9025 252B-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

252B-9026 252B-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190. .

252B-9027 252B-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

252B-9028 252B-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252B-9029 252B-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252B-9030 252B-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

252B-9031 252B-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

252B-9032 252B-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

252B-9041 252B-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

252B-9042 252B-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

252B-9050 252B-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

252B-9051 252B-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

252B-9052 252B-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

252B-9054 252B-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

252B-9060 252B-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252B-9061 252B-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252B-9062 252B-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

252B-9063 252B-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252B-9073 252B-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

252B-9074 252B-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

252B-9081 252B-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252B-9082 252B-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252B-9090 **252B-9090**

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

252B-9091 **252B-9091**

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

252B-9092 **252B-9092**

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

252B-9200 **252B-9200**

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

252B-FFF3 **252B-FFF3**

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

252B-FFF4 **252B-FFF4**

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

252B-FFF6 **252B-FFF6**

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-FFFA **252B-FFFA**

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

252B-FFFE **252B-FFFE**

Explanation: Temporary disk bus error.

Response: Use MAP3150.

252D-102E **252D-102E**

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252D-3002 **252D-3002**

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252D-3010 **252D-3010**

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252D-3020 **252D-3020**

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

252D-3100 **252D-3100**

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252D-3101 **252D-3101**

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252D-3109 **252D-3109**

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

252D-3110 **252D-3110**

Explanation: Disk bus interface error.

Response: Use MAP3150.

252D-7001 252D-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

252D-9000 252D-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252D-9001 252D-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252D-9002 252D-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252D-9008 252D-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

252D-9010 252D-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

252D-9011 252D-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

252D-9020 252D-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252D-9021 252D-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252D-9022 252D-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252D-9023 252D-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

252D-9024 252D-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

252D-9025 252D-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

252D-9026 252D-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

252D-9027 252D-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

252D-9028 252D-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252D-9029 252D-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252D-9030 252D-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

252D-9031 • 252D-9091

252D-9031 252D-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

252D-9032 252D-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

252D-9041 252D-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

252D-9042 252D-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

252D-9050 252D-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

252D-9051 252D-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

252D-9052 252D-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

252D-9054 252D-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

252D-9060 252D-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252D-9061 252D-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252D-9062 252D-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

252D-9063 252D-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252D-9073 252D-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

252D-9074 252D-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

252D-9081 252D-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252D-9082 252D-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252D-9090 252D-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

252D-9091 252D-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

252D-9092 252D-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

252D-9200 252D-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

252D-FFF3 252D-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

252D-FFF4 252D-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722

252D-FFF6 252D-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

252D-FFFA 252D-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722

252D-FFFE 252D-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

252E-102E 252E-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

252E-3002 252E-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

252E-3010 252E-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

252E-3020 252E-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

252E-3100 252E-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252E-3101 252E-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252E-3109 252E-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

252E-3110 252E-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

252E-7001 252E-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722

252E-8008 252E-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D06

252E-8009 252E-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D06

252E-9000 252E-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252E-9001 252E-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252E-9002 252E-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252E-9008 252E-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

252E-9010 252E-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

252E-9011 252E-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

252E-9020 252E-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252E-9021 252E-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252E-9022 252E-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252E-9023 252E-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012.

252E-9024 252E-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

252E-9025 252E-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

252E-9026 252E-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190. .

252E-9027 252E-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

252E-9028 252E-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252E-9029 252E-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252E-9030 252E-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

252E-9031 252E-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

252E-9032 252E-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

252E-9041 252E-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

252E-9042 252E-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

252E-9050 252E-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

252E-9051 252E-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

252E-9052 252E-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

252E-9054 252E-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

252E-9060 252E-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252E-9061 252E-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252E-9062 252E-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

252E-9063 252E-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252E-9073 252E-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

252E-9074 252E-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

252E-9081 252E-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252E-9082 252E-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252E-9090 252E-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

252E-9091 252E-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

252E-9092 252E-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

252E-9200 252E-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

252E-FFF3 252E-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

252E-FFF4 252E-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

252E-FFF6 252E-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252E-FFFA 252E-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252E-FFFE 252E-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

256E-2101 256E-2101

Explanation: Error log analysis indicates an adapter failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
-

256E-2103 256E-2103

Explanation: Error log analysis indicates a hardware error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
 - FFC_221
-

256E-2202 256E-2202

Explanation: Error log analysis indicates an adapter failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
-

256E-2501 256E-2501

Explanation: Register Test Failed

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
-

256E-2502 256E-2502

Explanation: External wrap test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
-

256E-2503 256E-2503

Explanation: External wrap test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
-

256E-2504 256E-2504

Explanation: External wrap test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E

256E-2505 256E-2505

Explanation: Internal wrap test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
- FFC_221

256E-2506 256E-2506

Explanation: Internal wrap test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E

256E-2507 256E-2507

Explanation: Internal wrap test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E

256E-2511 256E-2511

Explanation: Enhanced error handling failure on bus.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_221

256E-2601 256E-2601

Explanation: Registers test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
- FFC_221

256E-2610 256E-2610

Explanation: Interrupt test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
- FFC_221

256E-2612 256E-2612

Explanation: Enhanced error handling failure while testing the adapter.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
- FFC_221

26PAA 26PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

27PAA 27PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

2600-101 2600-101

Explanation: The Fibre Channel Adapter configuration failed.

Failing Item:

- FFC_2600

2600-102 2600-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2600

2600-103 2600-103

Explanation: The Register test failed.

Failing Item:

- FFC_2600

2600-104 **2600-104****Explanation:** The SRAM test failed.**Failing Item:**

- FFC_2600
-

2600-105 **2600-105****Explanation:** The Internal Wrap test failed.**Failing Item:**

- FFC_2600
-

2600-106 **2600-106****Explanation:** The Gigabaud Link Module (GLM) Wrap Test Failure.**Failing Item:**

- FFC_2600
-

2600-107 **2600-107****Explanation:** The External Wrap test failed.**Failing Item:**

- FFC_2600
-

2600-109 **2600-109****Explanation:** Enhanced Error Handling Failure on EADs chip.**Failing Item:**

- FFC_221
-

2600-110 **2600-110****Explanation:** Enhanced Error Handling Failure on adapter.**Failing Item:**

- FFC_2600
-

2600-201 **2600-201****Explanation:** The Configuration Register test failed.**Failing Item:**

- FFC_2600
 - FFC_221
-

2600-202 **2600-202****Explanation:** The Interrupt test failed.**Failing Item:**

- FFC_2600
 - FFC_221
-

2600-203 **2600-203****Explanation:** The PCI Wrap test failed.**Failing Item:**

- FFC_2600
 - FFC_221
-

2600-204 **2600-204****Explanation:** The DMA test failed.**Failing Item:**

- FFC_2600
 - FFC_221
-

2600-205 **2600-205****Explanation:** I/O error on a read/write operation.**Failing Item:**

- FFC_2600
 - FFC_221
-

2600-701 **2600-701****Explanation:** Error log analysis indicates that an error has occurred with the adapter.**Failing Item:**

- FFC_2600
 - FFC_221
-

2600-703 **2600-703****Explanation:** Error log analysis indicates that an unknown adapter error has occurred.**Failing Item:**

- FFC_2600
-

2600-704 **2600-704****Explanation:** Error log analysis indicates that an adapter error has occurred.**Failing Item:**

- FFC_2600
-

2600-705 **2600-705****Explanation:** A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.**Failing Item:**

- FFC_2600
-

2600-706 **2600-706**

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2600
-

2601-102 **2601-102**

Explanation: The Reset test failed.

Failing Item:

- FFC_2601
-

2601-103 **2601-103**

Explanation: The Register test failed.

Failing Item:

- FFC_2601
-

2601-104 **2601-104**

Explanation: The SRAM test failed.

Failing Item:

- FFC_2601
-

2601-105 **2601-105**

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2601
-

2601-106 **2601-106**

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2601
-

2601-107 **2601-107**

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2601
-

2601-108 **2601-108**

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221

2601-110 **2601-110**

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2601
-

2601-201 **2601-201**

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-202 **2601-202**

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-203 **2601-203**

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2601
-

2601-204 **2601-204**

Explanation: The DMA test failed.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-205 **2601-205**

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-701 **2601-701**

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2601
-

2601-703 **2601-703**

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

2601-704 • 2602-204

- FFC_2601

2601-704 2601-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2601

2601-705 2601-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2601

2601-706 2601-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2601

2602-102 2602-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2602

2602-103 2602-103

Explanation: The Register test failed.

Failing Item:

- FFC_2602

2602-104 2602-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2602

2602-105 2602-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2602

2602-106 2602-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2602

2602-107 2602-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2602

2602-108 2602-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221

2602-110 2602-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2602

2602-201 2602-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2602
- FFC_221

2602-202 2602-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2602
- FFC_221

2602-203 2602-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2602

2602-204 2602-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2602
- FFC_221

2602-205 **2602-205**

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2602
 - FFC_221
-

2602-701 **2602-701**

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2602
-

2602-703 **2602-703**

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2602
-

2602-704 **2602-704**

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2602
-

2602-705 **2602-705**

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2602
-

2602-706 **2602-706**

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2602
-

2603-102 **2603-102**

Explanation: The Reset test failed.

Failing Item:

- FFC_2603
-

2603-103 **2603-103**

Explanation: The Register test failed.

Failing Item:

- FFC_2603
-

2603-104 **2603-104**

Explanation: The SRAM test failed.

Failing Item:

- FFC_2603
-

2603-105 **2603-105**

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2603
-

2603-106 **2603-106**

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2603
-

2603-107 **2603-107**

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2603
-

2603-108 **2603-108**

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2603-110 **2603-110**

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2603
-

2603-201 **2603-201**

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2603
 - FFC_221
-

2603-202 2603-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2603
 - FFC_221
-

2603-203 2603-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2603
-

2603-204 2603-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2603
 - FFC_221
-

2603-205 2603-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2603
 - FFC_221
-

2603-701 2603-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2603
-

2603-703 2603-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2603
-

2603-704 2603-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2603
-

2603-705 2603-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2603
-

2603-706 2603-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2603
-

2604-101 2604-101

Explanation: The fibre channel adapter configuration failed.

Failing Item:

- FFC_2604
-

2604-102 2604-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2604
-

2604-103 2604-103

Explanation: The Register test failed.

Failing Item:

- FFC_2604
-

2604-104 2604-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2604
-

2604-105 2604-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2604
-

2604-106 2604-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2604
-

2604-107 2604-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2604
-

2604-108 2604-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2604-110 2604-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2604
-

2604-201 2604-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2604
 - FFC_221
-

2604-202 2604-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2604
 - FFC_221
-

2604-203 2604-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2604
-

2604-204 2604-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2604
 - FFC_221
-

2604-205 2604-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2604
 - FFC_221
-

2604-701 2604-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2604
-

2604-703 2604-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2604
-

2604-704 2604-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2604
-

2604-705 2604-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2604
-

2604-706 2604-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2604
-

2606-102 2606-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2606
-

2606-103 2606-103

Explanation: The Register test failed.

Failing Item:

- FFC_2606
-

2606-104 **2606-104****Explanation:** The SRAM test failed.**Failing Item:**

- FFC_2606
-

2606-105 **2606-105****Explanation:** The Internal Wrap test failed.**Failing Item:**

- FFC_2606
-

2606-106 **2606-106****Explanation:** The Gigabaud Link Module (GLM) Wrap Test Failure.**Failing Item:**

- FFC_2606
-

2606-107 **2606-107****Explanation:** The External Wrap test failed.**Failing Item:**

- FFC_2606
-

2606-108 **2606-108****Explanation:** Enhanced Error Handling Failure on bus**Failing Item:**

- FFC_221
-

2606-110 **2606-110****Explanation:** Enhanced Error Handling Failure on adapter**Failing Item:**

- FFC_2606
-

2606-201 **2606-201****Explanation:** The Configuration Register test failed.**Failing Item:**

- FFC_2606
 - FFC_221
-

2606-202 **2606-202****Explanation:** The Interrupt test failed.**Failing Item:**

- FFC_2606
 - FFC_221
-

2606-203 **2606-203****Explanation:** The PCI Wrap test failed.**Failing Item:**

- FFC_2606
-

2606-204 **2606-204****Explanation:** The DMA test failed.**Failing Item:**

- FFC_2606
 - FFC_221
-

2606-205 **2606-205****Explanation:** I/O error on a read/write operation.**Failing Item:**

- FFC_2606
 - FFC_221
-

2606-701 **2606-701****Explanation:** Error log analysis indicates that an error has occurred with the adapter.**Failing Item:**

- FFC_2606
-

2606-703 **2606-703****Explanation:** Error log analysis indicates that an unknown adapter error has occurred.**Failing Item:**

- FFC_2606
-

2606-704 **2606-704****Explanation:** Error log analysis indicates that an adapter error has occurred.**Failing Item:**

- FFC_2606
-

2606-705 **2606-705****Explanation:** A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.**Failing Item:**

- FFC_2606
-

2606-706 **2606-706**

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2606
-

2608-102 **2608-102**

Explanation: The Reset test failed.

Failing Item:

- FFC_2608
-

2608-103 **2608-103**

Explanation: The Register test failed.

Failing Item:

- FFC_2608
-

2608-104 **2608-104**

Explanation: The SRAM test failed.

Failing Item:

- FFC_2608
-

2608-105 **2608-105**

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2608
-

2608-106 **2608-106**

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2608
-

2608-107 **2608-107**

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2608
-

2608-108 **2608-108**

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2608-110 **2608-110**

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2608
-

2608-201 **2608-201**

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-202 **2608-202**

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-203 **2608-203**

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2608
-

2608-204 **2608-204**

Explanation: The DMA test failed.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-205 **2608-205**

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-701 **2608-701**

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2608
-

2608-703 **2608-703**

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2608

2608-704 2608-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2608

2608-705 2608-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2608

2608-706 2608-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2608

2611-110 2611-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_2611

2611-120 2611-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_2611

2611-130 2611-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-131 2611-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-135 2611-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-136 2611-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-140 2611-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2611

2611-150 2611-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-151 **2611-151**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-160 **2611-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-161 **2611-161**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-168 **2611-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-169 **2611-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-170 **2611-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- FFC_B88
- MEDIA

2611-171 **2611-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611
- FFC_B88

2611-180 **2611-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-181 **2611-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2611-185 • 2611-300

- MEDIA
- FFC_2611

2611-185 2611-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-186 2611-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-190 2611-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2611

2611-200 2611-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-201 2611-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-210 2611-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-211 2611-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-220 2611-220

Explanation: The Release command failed.

Failing Item:

- FFC_2611

2611-230 2611-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2611

2611-240 2611-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2611

2611-300 2611-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2611
- SOFTWARE

2611-310 **2611-310**

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_2611
 - SOFTWARE
-

2611-320 **2611-320**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
 - MEDIA
-

2611-321 **2611-321**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2611
-

2611-411 **2611-411**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-412 **2611-412**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-413 **2611-413**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-414 **2611-414**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-415 **2611-415**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-416 **2611-416**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-417 **2611-417**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-418 **2611-418**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-419 2611-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-420 2611-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-421 2611-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-422 2611-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-423 2611-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-511 2611-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-512 2611-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-513 2611-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-514 2611-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-515 2611-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-516 2611-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-517 2611-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-518 2611-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-519 **2611-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-520 **2611-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-521 **2611-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-522 **2611-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-523 **2611-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-611 **2611-611**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-612 **2611-612**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-613 **2611-613**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-614 **2611-614**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-615 **2611-615**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-616 **2611-616**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-617 **2611-617**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-618 2611-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-619 2611-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-620 2611-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-621 2611-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-622 2611-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-623 2611-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-711 2611-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-712 2611-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-713 2611-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-714 2611-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-715 2611-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-716 2611-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-717 **2611-717**
Explanation: A device timeout error occurred.**Failing Item:**

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-718 **2611-718****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-719 **2611-719****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-720 **2611-720****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-721 **2611-721****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-722 **2611-722****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-723 **2611-723****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2612-110 **2612-110****Explanation:** The Reserve command failed.**Failing Item:**

- FFC_2612
-

2612-120 **2612-120****Explanation:** The Inquiry command failed.**Failing Item:**

- FFC_2612
-

2612-130 **2612-130****Explanation:** The Load command failed.**Response:** Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2612
 - MEDIA
-

2612-131 **2612-131****Explanation:** The Load command failed.**Response:** Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.**Failing Item:**

- MEDIA
 - FFC_2612
-

2612-135 **2612-135****Explanation:** The Unload command failed.**Response:** Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2612
- MEDIA

2612-136 2612-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-140 2612-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2612

2612-150 2612-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-151 2612-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-160 2612-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-161 2612-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-168 2612-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-169 2612-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-170 2612-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- FFC_B88
- MEDIA

2612-171 **2612-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
 - FFC_B88
-

2612-180 **2612-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-181 **2612-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-185 **2612-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-186 **2612-186**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-190 **2612-190**

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2612
-

2612-200 **2612-200**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-201 **2612-201**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-210 **2612-210**

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-211 2612-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-220 2612-220

Explanation: The Release command failed.

Failing Item:

- FFC_2612

2612-230 2612-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2612

2612-240 2612-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2612

2612-300 2612-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2612
- SOFTWARE

2612-310 2612-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_2612
- SOFTWARE

2612-320 2612-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-321 2612-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-411 2612-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-412 2612-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-413 2612-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-414 2612-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-415 **2612-415**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-416 **2612-416**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-417 **2612-417**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-418 **2612-418**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-419 **2612-419**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-420 **2612-420**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-421 **2612-421**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-422 **2612-422**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-423 **2612-423**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-511 **2612-511**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-512 **2612-512**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-513 **2612-513**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-514 2612-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-515 2612-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-516 2612-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-517 2612-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-518 2612-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-519 2612-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-520 2612-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-521 2612-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-522 2612-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-523 2612-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-611 2612-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-612 2612-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-613 2612-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-614 **2612-614**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-615 **2612-615**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-616 **2612-616**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-617 **2612-617**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-618 **2612-618**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-619 **2612-619**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-620 **2612-620**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-621 **2612-621**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-622 **2612-622**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-623 **2612-623**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-711 **2612-711**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-712 **2612-712**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-713 2612-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-714 2612-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-715 2612-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-716 2612-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-717 2612-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-718 2612-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-719 2612-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-720 2612-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-721 2612-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-722 2612-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-723 2612-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2613-110 2613-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_2613

2613-120 2613-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_2613

2613-130 **2613-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-131 **2613-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-135 **2613-135**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-136 **2613-136**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-140 **2613-140**

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2613

2613-150 **2613-150**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-151 **2613-151**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-160 **2613-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-161 **2613-161**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-168 **2613-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-169 2613-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-170 2613-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- FFC_B88
- MEDIA

2613-171 2613-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613
- FFC_B88

2613-180 2613-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-181 2613-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-185 2613-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-186 2613-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-190 2613-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2613

2613-200 2613-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-201 2613-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-210 2613-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-211 2613-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-220 2613-220

Explanation: The Release command failed.

Failing Item:

- FFC_2613

2613-230 2613-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2613

2613-240 2613-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2613

2613-300 2613-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2613
- SOFTWARE

2613-310 2613-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_2613
- SOFTWARE

2613-320 2613-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-321 2613-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-411 2613-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-412 2613-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-413 2613-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-414 2613-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-415 2613-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-416 2613-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-417 2613-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-418 2613-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-419 2613-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-420 2613-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-421 2613-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-422 2613-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-423 2613-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-511 **2613-511**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-512 **2613-512**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-513 **2613-513**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-514 **2613-514**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-515 **2613-515**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-516 **2613-516**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-517 **2613-517**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-518 **2613-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-519 **2613-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-520 **2613-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-521 **2613-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-522 **2613-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-523 **2613-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
 - FFC_B88
-

2613-611 2613-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-612 2613-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-613 2613-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-614 2613-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-615 2613-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-616 2613-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-617 2613-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-618 2613-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-619 2613-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-620 2613-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-621 2613-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-622 2613-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-623 **2613-623**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-711 **2613-711**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-712 **2613-712**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-713 **2613-713**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-714 **2613-714**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-715 **2613-715**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-716 **2613-716**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-717 **2613-717**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-718 **2613-718**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-719 **2613-719**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-720 **2613-720**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-721 **2613-721**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-722 2613-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-723 2613-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2614-110 2614-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_2614

2614-120 2614-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_2614

2614-130 2614-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-131 2614-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-135 2614-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-136 2614-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-140 2614-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2614

2614-150 2614-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-151 2614-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-160 **2614-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
 - MEDIA
-

2614-161 **2614-161**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2614
-

2614-168 **2614-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2614
-

2614-169 **2614-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
 - MEDIA
-

2614-170 **2614-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
 - FFC_B88
 - MEDIA
-

2614-171 **2614-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2614
 - FFC_B88
-

2614-180 **2614-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
 - MEDIA
-

2614-181 **2614-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2614
-

2614-185 **2614-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2614-186 • 2614-320

- FFC_2614
- MEDIA

2614-186 2614-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-190 2614-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2614

2614-200 2614-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-201 2614-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-210 2614-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-211 2614-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-220 2614-220

Explanation: The Release command failed.

Failing Item:

- FFC_2614

2614-230 2614-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2614

2614-240 2614-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2614

2614-300 2614-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2614
- SOFTWARE

2614-310 2614-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_2614
- SOFTWARE

2614-320 2614-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-321 2614-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-411 2614-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-412 2614-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-413 2614-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-414 2614-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-415 2614-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-416 2614-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-417 2614-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-418 2614-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-419 2614-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-420 2614-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-421 2614-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-422 2614-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-423 2614-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-511 2614-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-512 2614-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-513 2614-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-514 2614-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-515 2614-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-516 2614-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-517 2614-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-518 2614-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-519 2614-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-520 2614-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-521 **2614-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-522 **2614-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-523 **2614-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-611 **2614-611**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-612 **2614-612**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-613 **2614-613**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-614 **2614-614**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-615 **2614-615**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-616 **2614-616**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-617 **2614-617**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-618 **2614-618**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-619 **2614-619**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-620 2614-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-621 2614-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-622 2614-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-623 2614-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-711 2614-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-712 2614-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-713 2614-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-714 2614-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-715 2614-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-716 2614-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-717 2614-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-718 2614-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-719 **2614-719**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-720 **2614-720**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-721 **2614-721**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-722 **2614-722**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-723 **2614-723**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2615-110 **2615-110**

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-120 **2615-120**

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-130 **2615-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-131 **2615-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2615
-

2615-135 **2615-135**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-136 **2615-136**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2615-140 • 2615-171

- MEDIA
- FFC_2615

2615-140 2615-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

2615-150 2615-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-151 2615-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-160 2615-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-161 2615-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-168 2615-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-169 2615-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-170 2615-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- MEDIA

2615-171 2615-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA

- FFC_2615
- FFC_B88

2615-180 2615-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-181 2615-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-185 2615-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-186 2615-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-190 2615-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

2615-200 2615-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-201 2615-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-210 2615-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-211 2615-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2615-220 • 2615-414

- MEDIA
- FFC_2615

2615-220 2615-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

2615-230 2615-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

2615-240 2615-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

2615-300 2615-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- SOFTWARE

2615-310 2615-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_B88
- FFC_2615
- SOFTWARE

2615-320 2615-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-321 2615-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-411 2615-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-412 2615-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-413 2615-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-414 2615-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-415 **2615-415**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-416 **2615-416**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-417 **2615-417**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-418 **2615-418**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-419 **2615-419**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

- FFC_B88
- SOFTWARE

2615-420 **2615-420**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-421 **2615-421**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-422 **2615-422**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-423 **2615-423**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-511 **2615-511**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

2615-512 • 2615-521

- FFC_B88

2615-512 2615-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-513 2615-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-514 2615-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-515 2615-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-516 2615-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-517 2615-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-518 2615-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-519 2615-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-520 2615-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-521 2615-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
-

2615-522 **2615-522**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
-

2615-523 **2615-523**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
-

2615-611 **2615-611**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-612 **2615-612**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-613 **2615-613**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-614 **2615-614**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-615 **2615-615**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-616 **2615-616**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-617 **2615-617**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-618 **2615-618**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-619 2615-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-620 2615-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-621 2615-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-622 2615-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-623 2615-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-711 2615-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-712 2615-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-713 2615-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-714 2615-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-715 2615-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-716 **2615-716**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-717 **2615-717**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-718 **2615-718**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-719 **2615-719**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-720 **2615-720**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-721 **2615-721**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-722 **2615-722**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-723 **2615-723**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2616-110 **2616-110**

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
-

2616-120 **2616-120**

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
-

2616-130 **2616-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-131 2616-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-135 2616-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-136 2616-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-140 2616-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-150 2616-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-151 2616-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-160 2616-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-161 2616-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-168 2616-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-169 2616-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-170 2616-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- MEDIA

2616-171 2616-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616
- FFC_B88

2616-180 2616-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-181 2616-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-185 2616-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-186 2616-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-190 2616-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-200 2616-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-201 2616-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-210 2616-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-211 2616-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-220 2616-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-230 2616-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-240 2616-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-300 2616-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- SOFTWARE

2616-310 2616-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_B88
- FFC_2616
- SOFTWARE

2616-320 2616-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-321 2616-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-411 2616-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-412 2616-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-413 2616-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-414 2616-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-415 2616-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-416 2616-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-417 2616-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-418 2616-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-419 2616-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-420 2616-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-421 2616-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-422 2616-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-423 2616-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-511 2616-511

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-512 2616-512

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-513 2616-513

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-514 2616-514

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-515 2616-515

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-516 2616-516

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-517 **2616-517**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-518 **2616-518**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-519 **2616-519**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-520 **2616-520**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-521 **2616-521**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-522 **2616-522**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-523 **2616-523**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-611 **2616-611**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-612 **2616-612**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-613 **2616-613**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-614 2616-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-615 2616-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-616 2616-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-617 2616-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-618 2616-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-619 2616-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-620 2616-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-621 2616-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-622 2616-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-623 2616-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-711 **2616-711**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-712 **2616-712**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-713 **2616-713**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-714 **2616-714**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-715 **2616-715**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-716 **2616-716**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-717 **2616-717**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-718 **2616-718**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-719 **2616-719**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-720 **2616-720**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-721 2616-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-722 2616-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-723 2616-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2617-110 2617-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-120 2617-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-130 2617-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-131 2617-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-135 2617-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-136 2617-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-140 2617-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
-

2617-150 **2617-150**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - MEDIA
-

2617-151 **2617-151**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2617
-

2617-160 **2617-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - MEDIA
-

2617-161 **2617-161**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2617
-

2617-168 **2617-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2617
-

2617-169 **2617-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - MEDIA
-

2617-170 **2617-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - MEDIA
-

2617-171 **2617-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2617
 - FFC_B88
-

2617-180 **2617-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2617-181 • 2617-220

- FFC_2617
- MEDIA

2617-181 **2617-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-185 **2617-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-186 **2617-186**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-190 **2617-190**

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-200 **2617-200**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-201 **2617-201**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-210 **2617-210**

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-211 **2617-211**

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-220 **2617-220**

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-230 **2617-230**

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
-

2617-240 **2617-240**

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
-

2617-300 **2617-300**

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - SOFTWARE
-

2617-310 **2617-310**

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_B88
 - FFC_2617
 - SOFTWARE
-

2617-320 **2617-320**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - MEDIA
-

2617-321 **2617-321**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2617
-

2617-411 **2617-411**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-412 **2617-412**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-413 **2617-413**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-414 **2617-414**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-415 2617-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-416 2617-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-417 2617-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-418 2617-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-419 2617-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-420 2617-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-421 2617-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-422 2617-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-423 2617-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-511 2617-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-512 **2617-512**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-513 **2617-513**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-514 **2617-514**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-515 **2617-515**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-516 **2617-516**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-517 **2617-517**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-518 **2617-518**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-519 **2617-519**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-520 **2617-520**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-521 **2617-521**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-522 2617-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88

2617-523 2617-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88

2617-611 2617-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-612 2617-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-613 2617-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-614 2617-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-615 2617-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-616 2617-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-617 2617-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-618 2617-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-619 **2617-619**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-620 **2617-620**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-621 **2617-621**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-622 **2617-622**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-623 **2617-623**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-711 **2617-711**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-712 **2617-712**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-713 **2617-713**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-714 **2617-714**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-715 **2617-715**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-716 2617-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-717 2617-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-718 2617-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-719 2617-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-720 2617-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-721 2617-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-722 2617-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-723 2617-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2618-110 2618-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-120 2618-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-130 2618-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-131 2618-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-135 2618-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-136 2618-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-140 2618-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-150 2618-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-151 2618-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-160 2618-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-161 2618-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-168 2618-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-169 2618-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-170 2618-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_B88
- MEDIA

2618-171 2618-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618
- FFC_B88

2618-180 2618-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-181 2618-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-185 2618-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-186 2618-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-190 2618-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-200 2618-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-201 2618-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-210 2618-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-211 2618-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-220 2618-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-230 2618-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-240 2618-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-300 2618-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- SOFTWARE

2618-310 2618-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
- FFC_2618
- SOFTWARE

2618-320 2618-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-321 2618-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

2618-411 • 2618-419

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-411 2618-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-412 2618-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-413 2618-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-414 2618-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-415 2618-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-416 2618-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-417 2618-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-418 2618-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-419 2618-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-420 **2618-420**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-421 **2618-421**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-422 **2618-422**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-423 **2618-423**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-511 **2618-511**

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-512 **2618-512**

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-513 **2618-513**

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-514 **2618-514**

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-515 **2618-515**

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-516 **2618-516**

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-517 2618-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-518 2618-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-519 2618-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-520 2618-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-521 2618-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-522 2618-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-523 2618-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-611 2618-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-612 2618-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-613 2618-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-614 **2618-614**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-615 **2618-615**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-616 **2618-616**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-617 **2618-617**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-618 **2618-618**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-619 **2618-619**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-620 **2618-620**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-621 **2618-621**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-622 **2618-622**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-623 **2618-623**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-711 2618-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-712 2618-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-713 2618-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-714 2618-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-715 2618-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-716 2618-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-717 2618-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-718 2618-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-719 2618-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-720 2618-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-721 **2618-721**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-722 **2618-722**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-723 **2618-723**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2619-110 **2619-110**

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
-

2619-120 **2619-120**

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
-

2619-130 **2619-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - MEDIA
-

2619-131 **2619-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2619
-

2619-135 **2619-135**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - MEDIA
-

2619-136 **2619-136**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2619
-

2619-140 **2619-140**

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
-

2619-150 2619-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-151 2619-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-160 2619-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-161 2619-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-168 2619-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-169 2619-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-170 2619-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_B88
- MEDIA

2619-171 2619-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619
- FFC_B88

2619-180 2619-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-181 2619-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-185 2619-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-186 2619-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-190 2619-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-200 2619-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-201 2619-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-210 2619-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-211 2619-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-220 2619-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-230 2619-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-240 2619-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-300 2619-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- SOFTWARE

2619-310 2619-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
- FFC_2619
- SOFTWARE

2619-320 2619-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-321 2619-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-411 2619-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-412 2619-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-413 2619-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-414 2619-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-415 **2619-415**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-416 **2619-416**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-417 **2619-417**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-418 **2619-418**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-419 **2619-419**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-420 **2619-420**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-421 **2619-421**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-422 **2619-422**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-423 **2619-423**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-511 **2619-511**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-512 2619-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-513 2619-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-514 2619-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-515 2619-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-516 2619-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-517 2619-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-518 2619-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-519 2619-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-520 2619-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-521 2619-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-522 **2619-522**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-523 **2619-523**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-611 **2619-611**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-612 **2619-612**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-613 **2619-613**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-614 **2619-614**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-615 **2619-615**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-616 **2619-616**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-617 **2619-617**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-618 **2619-618**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-619 2619-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-620 2619-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-621 2619-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-622 2619-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-623 2619-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-711 2619-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-712 2619-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-713 2619-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-714 2619-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-715 2619-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-716 **2619-716**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-717 **2619-717**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-718 **2619-718**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-719 **2619-719**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-720 **2619-720**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-721 **2619-721**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-722 **2619-722**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-723 **2619-723**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2621-101 **2621-101**

Explanation: Configuration failed.

Failing Item:

- FFC_2621
-

2621-102 **2621-102**

Explanation: Queue pair create failure.

Failing Item:

- FFC_2621
-

2621-103 **2621-103**

Explanation: Internal loop back test failure

Failing Item:

- FFC_2621
-

2621-701 2621-701

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2621

2621-702 2621-702

Explanation: Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.

Failing Item:

- FFC_2621

2621-703 2621-703

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2621

2621-704 2621-704

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Failing Item:

- FFC_2621

2621-705 2621-705

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2621

2621-706 2621-706

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2621

2625-101 2625-101

Explanation: Configuration failed.

Failing Item:

- FFC_2625

2625-102 2625-102

Explanation: Queue pair create failure.

Failing Item:

- FFC_2625

2625-103 2625-103

Explanation: Internal loop back test failure

Failing Item:

- FFC_2625

2625-201 2625-201

Explanation: Loop back test failure

Failing Item:

- CABLE
- NETWORK

2625-301 2625-301

Explanation: Loop back test failure

Failing Item:

- CABLE
- NETWORK
- FFC_2625

2625-701 2625-701

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2625

2625-702 2625-702

Explanation: Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.

Failing Item:

- FFC_2625

2625-703 2625-703

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2625
-

2625-704 **2625-704**

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Failing Item:

- FFC_2625
-

2625-705 **2625-705**

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2625
-

2625-706 **2625-706**

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2625
-

2628-101 **2628-101**

Explanation: Configuration failed.

Failing Item:

- FFC_2628
-

2628-102 **2628-102**

Explanation: Queue pair create failure.

Failing Item:

- FFC_2628
-

2628-103 **2628-103**

Explanation: Internal loop back test failure

Failing Item:

- FFC_2628
-

2628-201 **2628-201**

Explanation: Loop back test failure

Failing Item:

- CABLE
 - NETWORK
-

2628-301 **2628-301**

Explanation: Loop back test failure

Failing Item:

- CABLE
 - NETWORK
-

- FFC_2628
-

2628-701 **2628-701**

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2628
-

2628-702 **2628-702**

Explanation: Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.

Failing Item:

- FFC_2628
-

2628-703 **2628-703**

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2628
-

2628-704 **2628-704**

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Failing Item:

- FFC_2628
-

2628-705 **2628-705**

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2628
-

2628-706 **2628-706**

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2628
-

2640-114 **2640-114**

Explanation: IDE Disk diagnostic failure

Failing Item:

- FFC_2640
-

2640-115 2640-115

Explanation: IDE disk error on open or configuring device

Failing Item:

- FFC_2640
- FFC_2631

2640-121 2640-121

Explanation: Physical volume hardware error

Failing Item:

- FFC_2640

2640-131 2640-131

Explanation: Smart status threshold exceeded

Failing Item:

- FFC_2640

2640-132 2640-132

Explanation: Command timeouts threshold exceeded

Failing Item:

- FFC_2640

2640-133 2640-133

Explanation: Command timeout with error condition

Failing Item:

- FFC_2640

2640-134 2640-134

Explanation: Hardware command or DMA failure

Failing Item:

- FFC_2640

2640-135 2640-135

Explanation: IDE DMA error with no error status

Failing Item:

- FFC_2640

2640-136 2640-136

Explanation: TimeOut waiting for controller or drive with no busy status

Response: Go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2640
- FFC_2631

2641-102 2641-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2641

2641-104 2641-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2641

2641-105 2641-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2641

2641-106 2641-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2641

2641-108 2641-108

Explanation: The bus test failed.

Failing Item:

- FFC_2641

2641-110 2641-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2641

2641-112 2641-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2641

2641-114 2641-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2641

2641-116 2641-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2641

2641-117 2641-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2641

2641-118 2641-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2641
- FFC_B88

2641-120 2641-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2641

2641-122 2641-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2641

2641-124 2641-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2641

2641-126 2641-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2641
- FFC_B88

2641-128 2641-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2641
- SOFTWARE

2641-129 2641-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2641
- SOFTWARE

2641-130 2641-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2641

2641-132 2641-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2641

2641-133 2641-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2641-134 2641-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2641-135 2641-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2641
- FFC_B88
- SOFTWARE

2641-136 2641-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2641

2641-137 **2641-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2641
 - FFC_B88
 - FFC_190
-

2641-138 **2641-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2641
-

2641-140 **2641-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2641
-

2641-640 **2641-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2642-102 **2642-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2642
-

2642-104 **2642-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2642
-

2642-105 **2642-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2642
-

2642-106 **2642-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_2642
-

2642-108 **2642-108**

Explanation: The bus test failed.

Failing Item:

- FFC_2642
-

2642-110 **2642-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_2642
-

2642-112 **2642-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2642
-

2642-114 **2642-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2642
-

2642-116 **2642-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2642
-

2642-117 **2642-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2642
-

2642-118 **2642-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2642
 - FFC_B88
-

2642-120 **2642-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2642
-

2642-122 **2642-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2642
-

2642-124 **2642-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2642
-

2642-126 **2642-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2642
 - FFC_B88
-

2642-128 **2642-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2642
 - SOFTWARE
-

2642-129 **2642-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2642
 - SOFTWARE
-

2642-130 **2642-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2642

2642-132 **2642-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2642
-

2642-133 **2642-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2642-134 **2642-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2642-135 **2642-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2642
 - FFC_B88
 - SOFTWARE
-

2642-136 **2642-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2642
-

2642-137 **2642-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2642
 - FFC_B88
 - FFC_190
-

2642-138 **2642-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2642

2642-140 2642-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2642

2642-640 2642-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2643-102 2643-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2643

2643-104 2643-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2643

2643-105 2643-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2643

2643-106 2643-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2643

2643-108 2643-108

Explanation: The bus test failed.

Failing Item:

- FFC_2643

2643-110 2643-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2643

2643-112 2643-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2643

2643-114 2643-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2643

2643-116 2643-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2643

2643-117 2643-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2643

2643-118 2643-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2643
- FFC_B88

2643-120 2643-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2643

2643-122 2643-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2643

2643-124 2643-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2643

2643-126 **2643-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2643
 - FFC_B88
-

2643-128 **2643-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2643
 - SOFTWARE
-

2643-129 **2643-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2643
 - SOFTWARE
-

2643-130 **2643-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2643
-

2643-132 **2643-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2643
-

2643-133 **2643-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2643-134 **2643-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

2643-135 **2643-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2643
 - FFC_B88
 - SOFTWARE
-

2643-136 **2643-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2643
-

2643-137 **2643-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2643
 - FFC_B88
 - FFC_190
-

2643-138 **2643-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2643
-

2643-140 **2643-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2643
-

2643-640 **2643-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2644-102 2644-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2644
-

2644-104 2644-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2644
-

2644-105 2644-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2644
-

2644-106 2644-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2644
-

2644-108 2644-108

Explanation: The bus test failed.

Failing Item:

- FFC_2644
-

2644-110 2644-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2644
-

2644-112 2644-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2644
-

2644-114 2644-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2644
-

2644-116 2644-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2644
-

2644-117 2644-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2644
-

2644-118 2644-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2644
 - FFC_B88
-

2644-120 2644-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2644
-

2644-122 2644-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2644
-

2644-124 2644-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2644
-

2644-126 2644-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2644
 - FFC_B88
-

2644-128 2644-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2644
- SOFTWARE

2644-129 **2644-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2644
 - SOFTWARE
-

2644-130 **2644-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2644
-

2644-132 **2644-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2644
-

2644-133 **2644-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2644-134 **2644-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2644-135 **2644-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2644
 - FFC_B88
 - SOFTWARE
-

2644-136 **2644-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2644
-

2644-137 **2644-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2644
 - FFC_B88
 - FFC_190
-

2644-138 **2644-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2644
-

2644-140 **2644-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2644
-

2644-640 **2644-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2645-102 **2645-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2645
-

2645-104 **2645-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2645
-

2645-105 **2645-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2645
-

 2645-106 2645-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2645
-

2645-108 2645-108

Explanation: The bus test failed.

Failing Item:

- FFC_2645
-

2645-110 2645-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2645
-

2645-112 2645-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2645
-

2645-114 2645-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2645
-

2645-116 2645-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2645
-

2645-117 2645-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2645
-

2645-118 2645-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2645
 - FFC_B88
-

 2645-120 2645-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2645
-

2645-122 2645-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2645
-

2645-124 2645-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2645
-

2645-126 2645-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2645
 - FFC_B88
-

2645-128 2645-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2645
 - SOFTWARE
-

2645-129 2645-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2645
 - SOFTWARE
-

2645-130 2645-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2645
-

2645-132 **2645-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2645
-

2645-133 **2645-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2645-134 **2645-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2645-135 **2645-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2645
 - FFC_B88
 - SOFTWARE
-

2645-136 **2645-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2645
-

2645-137 **2645-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2645
 - FFC_B88
 - FFC_190
-

2645-138 **2645-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2645
-

2645-140 **2645-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2645
-

2645-640 **2645-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2646-102 **2646-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2646
-

2646-104 **2646-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2646
-

2646-105 **2646-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2646
-

2646-106 **2646-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_2646
-

2646-108 **2646-108**

Explanation: The bus test failed.

Failing Item:

- FFC_2646
-

2646-110 **2646-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_2646

2646-112 2646-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2646
-

2646-114 2646-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2646
-

2646-116 2646-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2646
-

2646-117 2646-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2646
-

2646-118 2646-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2646
 - FFC_B88
-

2646-120 2646-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2646
-

2646-122 2646-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2646
-

2646-124 2646-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2646
-

2646-126 2646-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2646
 - FFC_B88
-

2646-128 2646-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2646
 - SOFTWARE
-

2646-129 2646-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2646
 - SOFTWARE
-

2646-130 2646-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2646
-

2646-132 2646-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2646
-

2646-133 2646-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2646-134 2646-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

2646-135 **2646-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2646
- FFC_B88
- SOFTWARE

2646-136 **2646-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2646

2646-137 **2646-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2646
- FFC_B88
- FFC_190

2646-138 **2646-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2646

2646-140 **2646-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2646

2646-640 **2646-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2647-102 **2647-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2647

2647-104 **2647-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2647

2647-105 **2647-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2647

2647-106 **2647-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_2647

2647-108 **2647-108**

Explanation: The bus test failed.

Failing Item:

- FFC_2647

2647-110 **2647-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_2647

2647-112 **2647-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2647

2647-114 **2647-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2647

2647-116 **2647-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2647

2647-117 2647-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2647

2647-118 2647-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2647
- FFC_B88

2647-120 2647-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2647

2647-122 2647-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2647

2647-124 2647-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2647

2647-126 2647-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2647
- FFC_B88

2647-128 2647-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2647
- SOFTWARE

2647-129 2647-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2647
- SOFTWARE

2647-130 2647-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2647

2647-132 2647-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2647

2647-133 2647-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2647-134 2647-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2647-135 2647-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2647
- FFC_B88
- SOFTWARE

2647-136 2647-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2647

2647-137 2647-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2647
 - FFC_B88
 - FFC_190
-

2647-138 2647-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2647
-

2647-140 2647-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2647
-

2647-640 2647-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2648-102 2648-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2648
-

2648-104 2648-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2648
-

2648-105 2648-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2648

2648-106 2648-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2648
-

2648-108 2648-108

Explanation: The bus test failed.

Failing Item:

- FFC_2648
-

2648-110 2648-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2648
-

2648-112 2648-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2648
-

2648-114 2648-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2648
-

2648-116 2648-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2648
-

2648-117 2648-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2648
-

2648-118 2648-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2648
- FFC_B88

2648-120 2648-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2648

2648-122 2648-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2648

2648-124 2648-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2648

2648-126 2648-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2648
- FFC_B88

2648-128 2648-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2648
- SOFTWARE

2648-129 2648-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2648
- SOFTWARE

2648-130 2648-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2648

2648-132 2648-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2648

2648-133 2648-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2648-134 2648-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2648-135 2648-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2648
- FFC_B88
- SOFTWARE

2648-136 2648-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2648

2648-137 2648-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2648
- FFC_B88
- FFC_190

2648-138 2648-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2648

2648-140 2648-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2648

2648-640 2648-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2649-102 2649-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2649

2649-104 2649-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2649

2649-105 2649-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2649

2649-106 2649-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2649

2649-108 2649-108

Explanation: The bus test failed.

Failing Item:

- FFC_2649

2649-110 2649-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2649

2649-112 2649-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2649

2649-114 2649-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2649

2649-116 2649-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2649

2649-117 2649-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2649

2649-118 2649-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2649
- FFC_B88

2649-120 2649-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2649

2649-122 2649-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2649

2649-124 2649-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2649

2649-126 2649-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2649
- FFC_B88

2649-128 2649-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2649
- SOFTWARE

2649-129 2649-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2649
- SOFTWARE

2649-130 2649-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2649

2649-132 2649-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2649

2649-133 2649-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2649-134 2649-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

2649-135 2649-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2649
- FFC_B88
- SOFTWARE

2649-136 2649-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2649

2649-137 2649-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2649
- FFC_B88
- FFC_190

2649-138 2649-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2649

2649-140 2649-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2649

2649-640 2649-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

264B-102 **264B-102****Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_264B
-

264B-104 **264B-104****Explanation:** The motor failed to restart.**Failing Item:**

- FFC_264B
-

264B-105 **264B-105****Explanation:** The drive did not become ready.**Failing Item:**

- FFC_264B
-

264B-106 **264B-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_264B
-

264B-108 **264B-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_264B
-

264B-110 **264B-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_264B
-

264B-112 **264B-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_264B
-

264B-114 **264B-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_264B
-

264B-116 **264B-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_264B
-

264B-117 **264B-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_264B
-

264B-118 **264B-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_264B
 - FFC_B88
-

264B-120 **264B-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_264B
-

264B-122 **264B-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_264B
-

264B-124 **264B-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_264B
-

264B-126 **264B-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_264B
 - FFC_B88
-

264B-128 **264B-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
- FFC_B88
- FFC_264B
- SOFTWARE

264B-129 **264B-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_264B
 - SOFTWARE
-

264B-130 **264B-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_264B
-

264B-132 **264B-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_264B
-

264B-133 **264B-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

264B-134 **264B-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

264B-135 **264B-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_264B
 - FFC_B88
 - SOFTWARE
-

264B-136 **264B-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_264B
-

264B-137 **264B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_264B
 - FFC_B88
 - FFC_190
-

264B-138 **264B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_264B
-

264B-140 **264B-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_264B
-

264B-640 **264B-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

264D-102 **264D-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_264D
-

264D-104 **264D-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_264D
-

264D-105 **264D-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_264D
-

264D-106 **264D-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_264D
-

264D-108 **264D-108**

Explanation: The bus test failed.

Failing Item:

- FFC_264D
-

264D-110 **264D-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_264D
-

264D-112 **264D-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_264D
-

264D-114 **264D-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_264D
-

264D-116 **264D-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_264D
-

264D-117 **264D-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_264D
-

264D-118 **264D-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_264D
 - FFC_B88
-

264D-120 **264D-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_264D
-

264D-122 **264D-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_264D
-

264D-124 **264D-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_264D
-

264D-126 **264D-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_264D
 - FFC_B88
-

264D-128 **264D-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_264D
 - SOFTWARE
-

264D-129 **264D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_264D
 - SOFTWARE
-

264D-130 **264D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_264D
-

264D-132 264D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_264D

264D-133 264D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

264D-134 264D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

264D-135 264D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_264D
- FFC_B88
- SOFTWARE

264D-136 264D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_264D

264D-137 264D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_264D
- FFC_B88
- FFC_190

264D-138 264D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_264D

264D-140 264D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_264D

264D-640 264D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

264E-102 264E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_264E

264E-104 264E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_264E

264E-105 264E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_264E

264E-106 264E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_264E

264E-108 264E-108

Explanation: The bus test failed.

Failing Item:

- FFC_264E

264E-110 264E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_264E

264E-112 **264E-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_264E
-

264E-114 **264E-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_264E
-

264E-116 **264E-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_264E
-

264E-117 **264E-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_264E
-

264E-118 **264E-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_264E
 - FFC_B88
-

264E-120 **264E-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_264E
-

264E-122 **264E-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_264E
-

264E-124 **264E-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_264E
-

264E-126 **264E-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_264E
 - FFC_B88
-

264E-128 **264E-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_264E
 - SOFTWARE
-

264E-129 **264E-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_264E
 - SOFTWARE
-

264E-130 **264E-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_264E
-

264E-132 **264E-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_264E
-

264E-133 **264E-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

264E-134 **264E-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

264E-135 • 2650-116

- SOFTWARE

264E-135 264E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_264E
- FFC_B88
- SOFTWARE

264E-136 264E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_264E

264E-137 264E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_264E
- FFC_B88
- FFC_190

264E-138 264E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_264E

264E-140 264E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_264E

264E-640 264E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2650-102 2650-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2650

2650-104 2650-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2650

2650-105 2650-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2650

2650-106 2650-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2650

2650-108 2650-108

Explanation: The bus test failed.

Failing Item:

- FFC_2650

2650-110 2650-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2650

2650-112 2650-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2650

2650-114 2650-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2650

2650-116 2650-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2650

2650-117 2650-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2650

2650-118 2650-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2650
- FFC_B88

2650-120 2650-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2650

2650-122 2650-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2650

2650-124 2650-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2650

2650-126 2650-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2650
- FFC_B88

2650-128 2650-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2650
- SOFTWARE

2650-129 2650-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2650
- SOFTWARE

2650-130 2650-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2650

2650-132 2650-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2650

2650-133 2650-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2650-134 2650-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2650-135 2650-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2650
- FFC_B88
- SOFTWARE

2650-136 2650-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2650

2650-137 2650-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2650
- FFC_B88
- FFC_190

2650-138 2650-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2650

2650-140 2650-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2650

2650-640 2650-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2651-102 2651-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2651

2651-104 2651-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2651

2651-105 2651-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2651

2651-106 2651-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2651

2651-108 2651-108

Explanation: The bus test failed.

Failing Item:

- FFC_2651

2651-110 2651-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2651

2651-112 2651-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2651

2651-114 2651-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2651

2651-116 2651-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651

2651-117 2651-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2651

2651-118 2651-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2651
- FFC_B88

2651-120 2651-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2651
-

2651-122 2651-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2651
-

2651-124 2651-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2651
-

2651-126 2651-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2651
 - FFC_B88
-

2651-128 2651-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2651
 - SOFTWARE
-

2651-129 2651-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2651
 - SOFTWARE
-

2651-130 2651-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2651

2651-132 2651-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2651
-

2651-133 2651-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2651-134 2651-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2651-135 2651-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2651
 - FFC_B88
 - SOFTWARE
-

2651-136 2651-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2651
-

2651-137 2651-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2651
 - FFC_B88
 - FFC_190
-

2651-138 2651-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

2651-140 • 2652-124

- FFC_2651

2651-140 2651-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2651

2651-640 2651-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2652-102 2652-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2652

2652-104 2652-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2652

2652-105 2652-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2652

2652-106 2652-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2652

2652-108 2652-108

Explanation: The bus test failed.

Failing Item:

- FFC_2652

2652-110 2652-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2652

2652-112 2652-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2652

2652-114 2652-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2652

2652-116 2652-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2652

2652-117 2652-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2652

2652-118 2652-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2652
- FFC_B88

2652-120 2652-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2652

2652-122 2652-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2652

2652-124 2652-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2652

2652-126 **2652-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2652
 - FFC_B88
-

2652-128 **2652-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2652
 - SOFTWARE
-

2652-129 **2652-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2652
 - SOFTWARE
-

2652-130 **2652-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2652
-

2652-132 **2652-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2652
-

2652-133 **2652-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2652-134 **2652-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

2652-135 **2652-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2652
 - FFC_B88
 - SOFTWARE
-

2652-136 **2652-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2652
-

2652-137 **2652-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2652
 - FFC_B88
 - FFC_190
-

2652-138 **2652-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2652
-

2652-140 **2652-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2652
-

2652-640 **2652-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2653-102 2653-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2653
-

2653-104 2653-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2653
-

2653-105 2653-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2653
-

2653-106 2653-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2653
-

2653-108 2653-108

Explanation: The bus test failed.

Failing Item:

- FFC_2653
-

2653-110 2653-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2653
-

2653-112 2653-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2653
-

2653-114 2653-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2653
-

2653-116 2653-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2653
-

2653-117 2653-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2653
-

2653-118 2653-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2653
 - FFC_B88
-

2653-120 2653-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2653
-

2653-122 2653-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2653
-

2653-124 2653-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2653
-

2653-126 2653-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2653
 - FFC_B88
-

2653-128 2653-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2653
- SOFTWARE

2653-129 **2653-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2653
 - SOFTWARE
-

2653-130 **2653-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2653
-

2653-132 **2653-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2653
-

2653-133 **2653-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2653-134 **2653-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2653-135 **2653-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2653
 - FFC_B88
 - SOFTWARE
-

2653-136 **2653-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2653
-

2653-137 **2653-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2653
 - FFC_B88
 - FFC_190
-

2653-138 **2653-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2653
-

2653-140 **2653-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2653
-

2653-640 **2653-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2654-102 **2654-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2654
-

2654-104 **2654-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2654
-

2654-105 **2654-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2654
-

2654-106 2654-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2654
-

2654-108 2654-108

Explanation: The bus test failed.

Failing Item:

- FFC_2654
-

2654-110 2654-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2654
-

2654-112 2654-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2654
-

2654-114 2654-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2654
-

2654-116 2654-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2654-117 2654-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2654
-

2654-118 2654-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2654
 - FFC_B88
-

2654-120 2654-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2654
-

2654-122 2654-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2654
-

2654-124 2654-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2654
-

2654-126 2654-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2654
 - FFC_B88
-

2654-128 2654-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2654
 - SOFTWARE
-

2654-129 2654-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2654
 - SOFTWARE
-

2654-130 2654-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2654
-

2654-132 **2654-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2654
-

2654-133 **2654-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2654-134 **2654-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2654-135 **2654-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2654
 - FFC_B88
 - SOFTWARE
-

2654-136 **2654-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2654
-

2654-137 **2654-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2654
 - FFC_B88
 - FFC_190
-

2654-138 **2654-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2654
-

2654-140 **2654-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2654
-

2654-640 **2654-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2655-102 **2655-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2655
-

2655-104 **2655-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2655
-

2655-105 **2655-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2655
-

2655-106 **2655-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_2655
-

2655-108 **2655-108**

Explanation: The bus test failed.

Failing Item:

- FFC_2655
-

2655-110 **2655-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_2655

2655-112 2655-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2655
-

2655-114 2655-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2655
-

2655-116 2655-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2655-117 2655-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2655
-

2655-118 2655-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2655
 - FFC_B88
-

2655-120 2655-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2655
-

2655-122 2655-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2655
-

2655-124 2655-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2655

2655-126 2655-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2655
 - FFC_B88
-

2655-128 2655-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2655
 - SOFTWARE
-

2655-129 2655-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2655
 - SOFTWARE
-

2655-130 2655-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2655
-

2655-132 2655-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2655
-

2655-133 2655-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2655-134 2655-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

2655-135 2655-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2655
 - FFC_B88
 - SOFTWARE
-

2655-136 2655-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2655
-

2655-137 2655-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2655
 - FFC_B88
 - FFC_190
-

2655-138 2655-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2655
-

2655-140 2655-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2655
-

2655-640 2655-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2656-102 2656-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2656
-

2656-104 2656-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2656
-

2656-105 2656-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2656
-

2656-106 2656-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2656
-

2656-108 2656-108

Explanation: The bus test failed.

Failing Item:

- FFC_2656
-

2656-110 2656-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2656
-

2656-112 2656-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2656
-

2656-114 2656-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2656
-

2656-116 2656-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651

2656-117 2656-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2656

2656-118 2656-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2656
- FFC_B88

2656-120 2656-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2656

2656-122 2656-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2656

2656-124 2656-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2656

2656-126 2656-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2656
- FFC_B88

2656-128 2656-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2656
- SOFTWARE

2656-129 2656-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2656
- SOFTWARE

2656-130 2656-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2656

2656-132 2656-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2656

2656-133 2656-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2656-134 2656-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2656-135 2656-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2656
- FFC_B88
- SOFTWARE

2656-136 2656-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2656

2656-137 2656-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2656
 - FFC_B88
 - FFC_190
-

2656-138 2656-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2656
-

2656-140 2656-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2656
-

2656-640 2656-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2657-102 2657-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2657
-

2657-104 2657-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2657
-

2657-105 2657-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2657

2657-106 2657-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2657
-

2657-108 2657-108

Explanation: The bus test failed.

Failing Item:

- FFC_2657
-

2657-110 2657-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2657
-

2657-112 2657-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2657
-

2657-114 2657-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2657
-

2657-116 2657-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2657-117 2657-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2657
-

2657-118 2657-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2657
- FFC_B88

2657-120 2657-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2657
-

2657-122 2657-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2657
-

2657-124 2657-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2657
-

2657-126 2657-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2657
 - FFC_B88
-

2657-128 2657-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2657
 - SOFTWARE
-

2657-129 2657-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2657
 - SOFTWARE
-

2657-130 2657-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2657

2657-132 2657-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2657
-

2657-133 2657-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2657-134 2657-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2657-135 2657-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2657
 - FFC_B88
 - SOFTWARE
-

2657-136 2657-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2657
-

2657-137 2657-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2657
 - FFC_B88
 - FFC_190
-

2657-138 2657-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2657

2657-140 2657-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2657

2657-640 2657-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2658-102 2658-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2658

2658-104 2658-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2658

2658-105 2658-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2658

2658-106 2658-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2658

2658-108 2658-108

Explanation: The bus test failed.

Failing Item:

- FFC_2658

2658-110 2658-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2658

2658-112 2658-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2658

2658-114 2658-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2658

2658-116 2658-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651

2658-117 2658-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2658

2658-118 2658-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2658
- FFC_B88

2658-120 2658-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2658

2658-122 2658-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2658

2658-124 2658-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2658

2658-126 2658-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2658
- FFC_B88

2658-128 2658-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2658
- SOFTWARE

2658-129 2658-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2658
- SOFTWARE

2658-130 2658-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2658

2658-132 2658-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2658

2658-133 2658-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2658-134 2658-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

2658-135 2658-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2658
- FFC_B88
- SOFTWARE

2658-136 2658-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2658

2658-137 2658-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2658
- FFC_B88
- FFC_190

2658-138 2658-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2658

2658-140 2658-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2658

2658-640 2658-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2659-102 2659-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2659
-

2659-104 2659-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2659
-

2659-105 2659-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2659
-

2659-106 2659-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2659
-

2659-108 2659-108

Explanation: The bus test failed.

Failing Item:

- FFC_2659
-

2659-110 2659-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2659
-

2659-112 2659-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2659
-

2659-114 2659-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2659
-

2659-116 2659-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2659-117 2659-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2659
-

2659-118 2659-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2659
 - FFC_B88
-

2659-120 2659-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2659
-

2659-122 2659-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2659
-

2659-124 2659-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2659
-

2659-126 2659-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2659
 - FFC_B88
-

2659-128 2659-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2659
- SOFTWARE

2659-129 2659-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2659
- SOFTWARE

2659-130 2659-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2659

2659-132 2659-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2659

2659-133 2659-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2659-134 2659-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2659-135 2659-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2659
- FFC_B88
- SOFTWARE

2659-136 2659-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2659

2659-137 2659-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2659
- FFC_B88
- FFC_190

2659-138 2659-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2659

2659-140 2659-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2659

2659-640 2659-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

265B-102 265B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_265B

265B-104 265B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_265B

265B-105 265B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_265B

265B-106 265B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_265B
-

265B-108 265B-108

Explanation: The bus test failed.

Failing Item:

- FFC_265B
-

265B-110 265B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_265B
-

265B-112 265B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_265B
-

265B-114 265B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_265B
-

265B-116 265B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

265B-117 265B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_265B
-

265B-118 265B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_265B
- FFC_B88

265B-120 265B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_265B
-

265B-122 265B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_265B
-

265B-124 265B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_265B
-

265B-126 265B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_265B
 - FFC_B88
-

265B-128 265B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_265B
 - SOFTWARE
-

265B-129 265B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_265B
 - SOFTWARE
-

265B-130 265B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_265B

265B-132 265B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_265B

265B-133 265B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

265B-134 265B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

265B-135 265B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_265B
- FFC_B88
- SOFTWARE

265B-136 265B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_265B

265B-137 265B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_265B
- FFC_B88
- FFC_190

265B-138 265B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_265B

265B-140 265B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_265B

265B-640 265B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2667-125 2667-125

Explanation: A power supply error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_153

2667-135 2667-135

Explanation: A fan error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_166

2667-145 2667-145

Explanation: The enclosure indicates a temperature threshold condition.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_166

2667-155 2667-155

Explanation: An expander card error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
-

2667-175 **2667-175**

Explanation: An enclosure services error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
-

2667-201 **2667-201**

Explanation: Device configuration error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
 - FFC_2680
-

2667-202 **2667-202**

Explanation: The enclosure failed to open.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
 - FFC_2680
-

2667-203 **2667-203**

Explanation: The enclosure failed to return inquiry data.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
 - FFC_2680
-

2667-210 **2667-210**

Explanation: The enclosure indicates a power fault to a media bay.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2681
 - CABLE
-

2667-239 **2667-239**

Explanation: The enclosure indicates a voltage threshold condition.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_153
 - FFC_2667
-

2667-246 **2667-246**

Explanation: The enclosure indicates a temperature threshold condition.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_166
 - FFC_2667
-

2670-102 **2670-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2670
-

2670-104 **2670-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2670
-

2670-105 **2670-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2670
-

2670-106 **2670-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_2670
-

2670-108 **2670-108**

Explanation: The bus test failed.

Failing Item:

- FFC_2670
-

2670-110 **2670-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_2670
-

2670-112 **2670-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2670
-

2670-114 2670-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2670
-

2670-116 2670-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2670
-

2670-117 2670-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2670
-

2670-118 2670-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2670
 - FFC_B88
-

2670-120 2670-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2670
-

2670-122 2670-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2670
-

2670-124 2670-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2670
-

2670-126 2670-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2670
-

- FFC_B88
-

2670-128 2670-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2670
 - SOFTWARE
-

2670-129 2670-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2670
 - SOFTWARE
-

2670-130 2670-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2670
-

2670-132 2670-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2670
-

2670-133 2670-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2670-134 2670-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2670-135 **2670-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2670
 - FFC_B88
 - SOFTWARE
-

2670-136 **2670-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2670
-

2670-137 **2670-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2670
 - FFC_B88
 - FFC_190
-

2670-138 **2670-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2670
-

2670-140 **2670-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2670
-

2670-640 **2670-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2671-102 **2671-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2671
-

2671-104 **2671-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_2671
-

2671-105 **2671-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_2671
-

2671-106 **2671-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_2671
-

2671-108 **2671-108**

Explanation: The bus test failed.

Failing Item:

- FFC_2671
-

2671-110 **2671-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_2671
-

2671-112 **2671-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2671
-

2671-114 **2671-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2671
-

2671-116 **2671-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2671

2671-117 2671-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2671

2671-118 2671-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2671
- FFC_B88

2671-120 2671-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2671

2671-122 2671-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2671

2671-124 2671-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2671

2671-126 2671-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2671
- FFC_B88

2671-128 2671-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2671
- SOFTWARE

2671-129 2671-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2671
- SOFTWARE

2671-130 2671-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2671

2671-132 2671-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2671

2671-133 2671-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2671-134 2671-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2671-135 2671-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2671
- FFC_B88
- SOFTWARE

2671-136 2671-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2671

2671-137 2671-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2671
 - FFC_B88
 - FFC_190
-

2671-138 2671-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2671
-

2671-140 2671-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2671
-

2671-640 2671-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2672-102 2672-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2672
-

2672-104 2672-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2672
-

2672-105 2672-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2672

2672-106 2672-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2672
-

2672-108 2672-108

Explanation: The bus test failed.

Failing Item:

- FFC_2672
-

2672-110 2672-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2672
-

2672-112 2672-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2672
-

2672-114 2672-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2672
-

2672-116 2672-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2672
-

2672-117 2672-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2672
-

2672-118 2672-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2672
- FFC_B88

2672-120 2672-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2672

2672-122 2672-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2672

2672-124 2672-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2672

2672-126 2672-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2672
- FFC_B88

2672-128 2672-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2672
- SOFTWARE

2672-129 2672-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2672
- SOFTWARE

2672-130 2672-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2672

2672-132 2672-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2672

2672-133 2672-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2672-134 2672-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2672-135 2672-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2672
- FFC_B88
- SOFTWARE

2672-136 2672-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2672

2672-137 2672-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2672
- FFC_B88
- FFC_190

2672-138 2672-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2672

2672-140 2672-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2672

2672-640 2672-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2679-101 2679-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2679

2679-201 2679-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0

2679-202 2679-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2679
- FFC_25A0
- MEDIA

2679-203 2679-203

Explanation: Unable to open adapter driver.

Failing Item:

- FFC_25A0

2679-204 2679-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
- FFC_2679

2679-205 2679-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2679
- MEDIA

2679-206 2679-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2679

2679-207 2679-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_2679

2679-210 2679-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2679

2679-701 2679-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2679

2679-702 2679-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2679

267B-101 267B-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_267B

267B-201 267B-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0

267B-202 267B-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_267B
 - FFC_25A0
 - MEDIA
-

267B-203 267B-203

Explanation: Unable to open adapter driver.

Failing Item:

- FFC_25A0
-

267B-204 267B-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_267B
-

267B-205 267B-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_267B
 - MEDIA
-

267B-206 267B-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_267B
-

267B-207 267B-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_267B
-

267B-210 267B-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_267B
-

267B-701 267B-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_267B
-

267B-702 267B-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_267B
-

2684-102 2684-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2684
-

2684-104 2684-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2684
-

2684-105 2684-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2684
-

2684-106 2684-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2684
-

2684-108 2684-108

Explanation: The bus test failed.

Failing Item:

- FFC_2684
-

2684-110 2684-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2684
-

2684-112 2684-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2684
-

2684-114 2684-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2684
-

2684-116 2684-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2684
-

2684-117 2684-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2684
-

2684-118 2684-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2684
 - FFC_B88
-

2684-120 2684-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2684
-

2684-122 2684-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2684
-

2684-124 2684-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2684
-

2684-126 2684-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2684
-

- FFC_B88
-

2684-128 2684-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2684
 - SOFTWARE
-

2684-129 2684-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2684
 - SOFTWARE
-

2684-130 2684-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2684
-

2684-132 2684-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2684
-

2684-133 2684-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2684-134 2684-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

 2684-135 2684-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2684
 - FFC_B88
 - SOFTWARE
-

2684-136 2684-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2684
-

2684-137 2684-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2684
 - FFC_B88
 - FFC_190
-

2684-138 2684-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2684
-

2684-140 2684-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2684
-

2684-640 2684-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

 2685-102 2685-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2685
-

2685-104 2685-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2685
-

2685-105 2685-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2685
-

2685-106 2685-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2685
-

2685-108 2685-108

Explanation: The bus test failed.

Failing Item:

- FFC_2685
-

2685-110 2685-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2685
-

2685-112 2685-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2685
-

2685-114 2685-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2685
-

2685-116 2685-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2685

2685-117 2685-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2685

2685-118 2685-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2685
- FFC_B88

2685-120 2685-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2685

2685-122 2685-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2685

2685-124 2685-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2685

2685-126 2685-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2685
- FFC_B88

2685-128 2685-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2685
- SOFTWARE

2685-129 2685-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2685
- SOFTWARE

2685-130 2685-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2685

2685-132 2685-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2685

2685-133 2685-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2685-134 2685-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2685-135 2685-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2685
- FFC_B88
- SOFTWARE

2685-136 2685-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2685

2685-137 2685-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2685
- FFC_B88
- FFC_190

2685-138 2685-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2685

2685-140 2685-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2685

2685-640 2685-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2687-102 2687-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2687

2687-104 2687-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2687

2687-105 2687-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2687

2687-106 2687-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2687

2687-108 2687-108

Explanation: The bus test failed.

Failing Item:

- FFC_2687

2687-110 2687-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2687

2687-112 2687-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2687

2687-114 2687-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2687

2687-116 2687-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2687

2687-117 2687-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2687

2687-118 2687-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2687
- FFC_B88

2687-120 2687-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2687
-

2687-122 2687-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2687
-

2687-124 2687-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2687
-

2687-126 2687-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2687
 - FFC_B88
-

2687-128 2687-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2687
 - SOFTWARE
-

2687-129 2687-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2687
 - SOFTWARE
-

2687-130 2687-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2687

2687-132 2687-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2687
-

2687-133 2687-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2687-134 2687-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2687-135 2687-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2687
 - FFC_B88
 - SOFTWARE
-

2687-136 2687-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2687
-

2687-137 2687-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2687
 - FFC_B88
 - FFC_190
-

2687-138 2687-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2687

2687-140 2687-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2687

2687-640 2687-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2690-102 2690-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2690

2690-104 2690-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2690

2690-105 2690-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2690

2690-106 2690-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2690

2690-108 2690-108

Explanation: The bus test failed.

Failing Item:

- FFC_2690

2690-110 2690-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2690

2690-112 2690-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2690

2690-114 2690-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2690

2690-116 2690-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2690

2690-117 2690-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2690

2690-118 2690-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2690
- FFC_B88

2690-120 2690-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2690

2690-122 2690-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2690

2690-124 2690-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2690

2690-126 **2690-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2690
 - FFC_B88
-

2690-128 **2690-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2690
 - SOFTWARE
-

2690-129 **2690-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2690
 - SOFTWARE
-

2690-130 **2690-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2690
-

2690-132 **2690-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2690
-

2690-133 **2690-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2690-134 **2690-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

2690-135 **2690-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2690
 - FFC_B88
 - SOFTWARE
-

2690-136 **2690-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2690
-

2690-137 **2690-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2690
 - FFC_B88
 - FFC_190
-

2690-138 **2690-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2690
-

2690-140 **2690-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2690
-

2690-640 **2690-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2699-102 2699-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2699
-

2699-104 2699-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2699
-

2699-105 2699-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2699
-

2699-106 2699-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2699
-

2699-108 2699-108

Explanation: The bus test failed.

Failing Item:

- FFC_2699
-

2699-110 2699-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2699
-

2699-112 2699-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2699
-

2699-114 2699-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2699
-

2699-116 2699-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2699
-

2699-117 2699-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2699
-

2699-118 2699-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2699
 - FFC_B88
-

2699-120 2699-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2699
-

2699-122 2699-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2699
-

2699-124 2699-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2699
-

2699-126 2699-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2699
 - FFC_B88
-

2699-128 2699-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2699
- SOFTWARE

2699-129 **2699-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2699
 - SOFTWARE
-

2699-130 **2699-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2699
-

2699-132 **2699-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2699
-

2699-133 **2699-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2699-134 **2699-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2699-135 **2699-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_2699
 - FFC_B88
 - SOFTWARE
-

2699-136 **2699-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_2699
-

2699-137 **2699-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2699
 - FFC_B88
 - FFC_190
-

2699-138 **2699-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2699
-

2699-140 **2699-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2699
-

2699-640 **2699-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26B4-102 **26B4-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26B4
-

26B4-104 **26B4-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_26B4
-

26B4-105 **26B4-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_26B4
-

26B4-106 26B4-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26B4

26B4-108 26B4-108

Explanation: The bus test failed.

Failing Item:

- FFC_26B4

26B4-110 26B4-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26B4

26B4-112 26B4-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26B4

26B4-114 26B4-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26B4

26B4-116 26B4-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-117 26B4-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26B4

26B4-118 26B4-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26B4
- FFC_26BD

- FFC_B88

26B4-120 26B4-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-122 26B4-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-124 26B4-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-126 26B4-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26B4
- FFC_26BD
- FFC_B88

26B4-128 26B4-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_26BD
- FFC_B88
- FFC_26B4
- SOFTWARE

26B4-129 26B4-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_26BD
 - FFC_B88
 - FFC_26B4
 - SOFTWARE
-

26B4-130 **26B4-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26B4
-

26B4-132 **26B4-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26B4
 - FFC_26BD
-

26B4-133 **26B4-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

26B4-134 **26B4-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

26B4-135 **26B4-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_26B4
 - FFC_26BD
 - FFC_B88
 - SOFTWARE
-

26B4-136 **26B4-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_26B4
-

26B4-137 **26B4-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26B4
 - FFC_26BD
 - FFC_B88
-

26B4-138 **26B4-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26B4
-

26B4-140 **26B4-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_26BD
 - FFC_B88
 - FFC_26B4
-

26B4-640 **26B4-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26B8-102 **26B8-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26B8
-

26B8-104 **26B8-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_26B8
-

26B8-105 **26B8-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_26B8
-

26B8-106 **26B8-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_26B8
-

26B8-108 26B8-108

Explanation: The bus test failed.

Failing Item:

- FFC_26B8
-

26B8-110 26B8-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26B8
-

26B8-112 26B8-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26B8
-

26B8-114 26B8-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26B8
-

26B8-116 26B8-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26B8
-

26B8-117 26B8-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26B8
-

26B8-118 26B8-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26B8
 - FFC_B88
-

26B8-120 26B8-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26B8
-

26B8-122 26B8-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26B8
-

26B8-124 26B8-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26B8
-

26B8-126 26B8-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26B8
 - FFC_B88
-

26B8-128 26B8-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26B8
 - SOFTWARE
-

26B8-129 26B8-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26B8
 - SOFTWARE
-

26B8-130 26B8-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26B8
-

26B8-132 26B8-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26B8
-

26B8-133 **26B8-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

26B8-134 **26B8-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

26B8-135 **26B8-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_26B8
 - FFC_B88
 - SOFTWARE
-

26B8-136 **26B8-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_26B8
-

26B8-137 **26B8-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26B8
 - FFC_B88
 - FFC_190
-

26B8-138 **26B8-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26B8
-

26B8-140 **26B8-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_26B8
-

26B8-640 **26B8-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26D0-110 **26D0-110**

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
-

26D0-120 **26D0-120**

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
-

26D0-130 **26D0-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - MEDIA
-

26D0-131 **26D0-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
-

26D0-135 • 26D0-169

- FFC_26D0

26D0-135 26D0-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-136 26D0-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-140 26D0-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-150 26D0-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-151 26D0-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-160 26D0-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-161 26D0-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-168 26D0-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-169 26D0-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-170 **26D0-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_B88
 - MEDIA
-

26D0-171 **26D0-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26D0
 - FFC_B88
-

26D0-180 **26D0-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - MEDIA
-

26D0-181 **26D0-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26D0
-

26D0-185 **26D0-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - MEDIA
-

26D0-186 **26D0-186**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26D0
-

26D0-190 **26D0-190**

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
-

26D0-200 **26D0-200**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - MEDIA
-

26D0-201 **26D0-201**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

26D0-210 • 26D0-411

- MEDIA
- FFC_26D0

26D0-210 26D0-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-211 26D0-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-220 26D0-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-230 26D0-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-240 26D0-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-300 26D0-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- SOFTWARE

26D0-310 26D0-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
- FFC_26D0
- SOFTWARE

26D0-320 26D0-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-321 26D0-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-411 26D0-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-412 **26D0-412**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-413 **26D0-413**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-414 **26D0-414**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-415 **26D0-415**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-416 **26D0-416**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-417 **26D0-417**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-418 **26D0-418**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-419 **26D0-419**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-420 **26D0-420**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-421 **26D0-421**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-422 26D0-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-423 26D0-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-511 26D0-511

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-512 26D0-512

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-513 26D0-513

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-514 26D0-514

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-515 26D0-515

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-516 26D0-516

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-517 26D0-517

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-518 26D0-518

Explanation: The drive returned bad or non-extended
sense data.

Response: If the problem persists, use MAP0210 :
General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-519 **26D0-519**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-520 **26D0-520**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-521 **26D0-521**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-522 **26D0-522**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-523 **26D0-523**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-611 **26D0-611**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-612 **26D0-612**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-613 **26D0-613**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-614 **26D0-614**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-615 **26D0-615**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-616 26D0-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-617 26D0-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-618 26D0-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-619 26D0-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-620 26D0-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-621 26D0-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-622 26D0-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-623 26D0-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-711 26D0-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-712 26D0-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-713 **26D0-713**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-714 **26D0-714**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-715 **26D0-715**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-716 **26D0-716**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-717 **26D0-717**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-718 **26D0-718**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-719 **26D0-719**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-720 **26D0-720**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-721 **26D0-721**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-722 **26D0-722**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-723 26D0-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D1-110 26D1-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-120 26D1-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-130 26D1-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-131 26D1-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-135 26D1-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-136 26D1-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-140 26D1-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-150 26D1-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-151 26D1-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-160 26D1-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-161 26D1-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-168 26D1-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-169 26D1-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-170 26D1-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_B88
- MEDIA

26D1-171 26D1-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1
- FFC_B88

26D1-180 26D1-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-181 26D1-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-185 26D1-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-186 26D1-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-190 26D1-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-200 26D1-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-201 26D1-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-210 26D1-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-211 26D1-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-220 26D1-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-230 26D1-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-240 26D1-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-300 **26D1-300**

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - SOFTWARE
-

26D1-310 **26D1-310**

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D02
 - FFC_26D1
 - SOFTWARE
-

26D1-320 **26D1-320**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - MEDIA
-

26D1-321 **26D1-321**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26D1
-

26D1-411 **26D1-411**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-412 **26D1-412**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-413 **26D1-413**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-414 **26D1-414**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-415 **26D1-415**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-416 **26D1-416**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-417 26D1-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-418 26D1-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-419 26D1-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-420 26D1-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-421 26D1-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-422 26D1-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-423 26D1-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-511 26D1-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-512 26D1-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-513 26D1-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-514 **26D1-514**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-515 **26D1-515**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-516 **26D1-516**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-517 **26D1-517**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-518 **26D1-518**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-519 **26D1-519**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-520 **26D1-520**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-521 **26D1-521**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-522 **26D1-522**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-523 **26D1-523**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-611 26D1-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-612 26D1-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-613 26D1-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-614 26D1-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-615 26D1-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-616 26D1-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-617 26D1-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-618 26D1-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-619 26D1-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-620 26D1-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-621 **26D1-621**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-622 **26D1-622**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-623 **26D1-623**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-711 **26D1-711**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-712 **26D1-712**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-713 **26D1-713**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-714 **26D1-714**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-715 **26D1-715**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-716 **26D1-716**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-717 **26D1-717**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-718 26D1-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-719 26D1-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-720 26D1-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-721 26D1-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-722 26D1-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-723 26D1-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D2-102 26D2-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26D2

26D2-104 26D2-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_26D2

26D2-105 26D2-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_26D2

26D2-106 26D2-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26D2

26D2-108 26D2-108

Explanation: The bus test failed.

Failing Item:

- FFC_26D2

26D2-110 26D2-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26D2

26D2-112 26D2-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26D2
-

26D2-114 **26D2-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26D2
-

26D2-116 **26D2-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26D2
-

26D2-117 **26D2-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26D2
-

26D2-118 **26D2-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26D2
 - FFC_B88
-

26D2-120 **26D2-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26D2
-

26D2-122 **26D2-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26D2
-

26D2-124 **26D2-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26D2
-

26D2-126 **26D2-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26D2
-

- FFC_B88
-

26D2-128 **26D2-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26D2
 - SOFTWARE
-

26D2-129 **26D2-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26D2
 - SOFTWARE
-

26D2-130 **26D2-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26D2
-

26D2-132 **26D2-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26D2
-

26D2-133 **26D2-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

26D2-134 **26D2-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

26D2-135 26D2-135

Explanation: The device failed to configure.

Failing Item:

- FFC_26D2
- FFC_B88
- SOFTWARE

26D2-136 26D2-136

Explanation: The certify operation failed.

Failing Item:

- FFC_26D2

26D2-137 26D2-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26D2
- FFC_B88
- FFC_190

26D2-138 26D2-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26D2

26D2-140 26D2-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_26D2

26D2-640 26D2-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26D3-102 26D3-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26D3

26D3-104 26D3-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_26D3

26D3-105 26D3-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_26D3

26D3-106 26D3-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26D3

26D3-108 26D3-108

Explanation: The bus test failed.

Failing Item:

- FFC_26D3

26D3-110 26D3-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26D3

26D3-112 26D3-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26D3

26D3-114 26D3-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26D3

26D3-116 26D3-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26D3

26D3-117 26D3-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26D3

26D3-118 26D3-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26D3
- FFC_B88

26D3-120 26D3-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26D3

26D3-122 26D3-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26D3

26D3-124 26D3-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26D3

26D3-126 26D3-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26D3
- FFC_B88

26D3-128 26D3-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_26D3
- SOFTWARE

26D3-129 26D3-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_26D3
- SOFTWARE

26D3-130 26D3-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26D3

26D3-132 26D3-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26D3

26D3-133 26D3-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

26D3-134 26D3-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

26D3-135 26D3-135

Explanation: The device failed to configure.

Failing Item:

- FFC_26D3
- FFC_B88
- SOFTWARE

26D3-136 26D3-136

Explanation: The certify operation failed.

Failing Item:

- FFC_26D3

26D3-137 26D3-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26D3
- FFC_B88
- FFC_190

26D3-138 26D3-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26D3

26D3-140 26D3-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_26D3

26D3-640 26D3-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26E0-101 26E0-101

Explanation: Dock failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E0

26E0-102 26E0-102

Explanation: Cartridge failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E2

26E0-601 26E0-601

Explanation: ELA failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E0

26E1-101 26E1-101

Explanation: Dock failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E1

26E1-102 26E1-102

Explanation: Cartridge failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E2

26E1-601 26E1-601

Explanation: ELA failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E1

26E5-110 26E5-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

26E5-120 26E5-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
-

26E5-130 **26E5-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-131 **26E5-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-135 **26E5-135**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-136 **26E5-136**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-140 **26E5-140**

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

26E5-150 **26E5-150**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-151 **26E5-151**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-160 **26E5-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-161 **26E5-161**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-168 **26E5-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-169 **26E5-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-170 **26E5-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_B88
- MEDIA

26E5-171 **26E5-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5
- FFC_B88

26E5-180 **26E5-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-181 **26E5-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-185 **26E5-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-186 **26E5-186**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-190 **26E5-190**

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

26E5-200 26E5-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-201 26E5-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-210 26E5-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-211 26E5-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-220 26E5-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

26E5-230 26E5-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

26E5-240 26E5-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

26E5-300 26E5-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- SOFTWARE

26E5-310 26E5-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
- FFC_26E5
- SOFTWARE

26E5-320 26E5-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

26E5-321 • 26E5-419

- FFC_26E5
- MEDIA

26E5-321 26E5-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-411 26E5-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-412 26E5-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-413 26E5-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-414 26E5-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

- FFC_2680
- SOFTWARE

26E5-415 26E5-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-416 26E5-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-417 26E5-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-418 26E5-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-419 26E5-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

- SOFTWARE

26E5-420 **26E5-420**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-421 **26E5-421**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-422 **26E5-422**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-423 **26E5-423**

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-511 **26E5-511**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-512 **26E5-512**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-513 **26E5-513**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-514 **26E5-514**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-515 **26E5-515**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-516 **26E5-516**

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-517 26E5-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-518 26E5-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-519 26E5-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-520 26E5-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-521 26E5-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-522 26E5-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-523 26E5-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-611 26E5-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-612 26E5-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-613 26E5-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-614 **26E5-614**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-615 **26E5-615**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-616 **26E5-616**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-617 **26E5-617**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-618 **26E5-618**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-619 **26E5-619**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-620 **26E5-620**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-621 **26E5-621**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-622 **26E5-622**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-623 **26E5-623**

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-711 26E5-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-712 26E5-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-713 26E5-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-714 26E5-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-715 26E5-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-716 26E5-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-717 26E5-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-718 26E5-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-719 26E5-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-720 26E5-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-721 **26E5-721**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-722 **26E5-722**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-723 **26E5-723**

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

2710-101 **2710-101**

Explanation: Diagnostics indicates adapter configuration failure.

Failing Item:

- FFC_2710
-

2710-601 **2710-601**

Explanation: Error log analysis indicates adapter function failure.

Failing Item:

- FFC_2710
-

2699-1001 **2699-1001**

Explanation: A disk has failed or is not responding and needs to be replaced.

Response: Use MAP5000

Failing Item:

- FFC_2699

26B8-1001 **26B8-1001**

Explanation: A disk has failed or is not responding and needs to be replaced.

Response: Use MAP5000

Failing Item:

- FFC_26B8
-

28PAA **28PAA**

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

29PAA **29PAA**

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

2A002 **2A002**

Explanation: Async code 02 was received. Probably, a software error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2A003 **2A003**

Explanation: Async code 03 was received. Probably, a software error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2A004 **2A004**

Explanation: Async code 04 was received. Probably, a software error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2A005 2A005

Explanation: Async code 05 was received. This code indicates that a disk drive module detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2A006 2A006

Explanation: Async code 06 was received. This code indicates that a disk drive module detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2A106 2A106

Explanation: Async code 06 was received. This code indicates that multiple disk drive modules detected loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2A206 2A206

Explanation: A disk drive module detected that one of its SSA links failed the POST.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2FFFF 2FFFF

Explanation: An async code that is not valid was received.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2E6-101 2E6-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221

2E6-102 2E6-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293

2E6-103 2E6-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_2E6
- FFC_221

2E6-212 2E6-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_2E6

2E6-213 2E6-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_2E6

2E6-214 2E6-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_2E6

2E6-215 2E6-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_2E6

2E6-216 2E6-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_2E6

2E6-217 2E6-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_2E6

2E6-218 2E6-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_2E6
-

2E6-219 **2E6-219**
Explanation: SCSI parity error.**Response:** Use MAP0050 : SCSI Bus Problems.**Failing Item:**

- FFC_2E6
-

2E6-220 **2E6-220****Explanation:** SCSI FIFO flags error.**Failing Item:**

- FFC_2E6
-

2E6-221 **2E6-221****Explanation:** Mismatch during the write/read of the configuration register.**Failing Item:**

- FFC_2E6
 - FFC_221
-

2E6-222 **2E6-222****Explanation:** Error during the write/read of the memory register.**Failing Item:**

- FFC_2E6
-

2E6-223 **2E6-223****Explanation:** Mismatch during the write/read of the memory I/O register.**Response:** Use MAP0050 : SCSI Bus Problems.**Failing Item:**

- FFC_2E6
-

2E6-224 **2E6-224****Explanation:** SCSI configuration register read or write error.**Failing Item:**

- FFC_2E6
 - FFC_221
-

2E6-225 **2E6-225****Explanation:** Adapter POST failed.**Failing Item:**

- FFC_2E6
-

2E6-226 **2E6-226****Explanation:** SCSI wrap or PTC failure.**Response:** Use MAP0050 : SCSI Bus Problems.**2E6-227** **2E6-227****Explanation:** SCSI adapter test failure.**Failing Item:**

- FFC_2E6
 - FFC_221
-

2E6-230 **2E6-230****Explanation:** Arbitration test failed.**Response:** Use MAP0050 : SCSI Bus Problems.**2E6-231** **2E6-231****Explanation:** Function could not complete.**Response:** Use MAP0050 : SCSI Bus Problems.**2E6-232** **2E6-232****Explanation:** SCSI bus data mismatch.**Response:** Use MAP0050 : SCSI Bus Problems.**2E6-240** **2E6-240****Explanation:** No terminal power.**Response:** Use MAP0050 : SCSI Bus Problems.**2E6-242** **2E6-242****Explanation:** SCSI bus problem.**Response:** Use MAP0050 : SCSI Bus Problems.**2E6-301** **2E6-301****Explanation:** The parent device open failed.**Failing Item:**

- FFC_2E6
 - FFC_221
-

2E6-701 **2E6-701****Explanation:** Error log analysis indicates a PCI SCSI adapter failure.**Failing Item:**

- FFC_2E6
-

2E6-801 2E6-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2E6-802 2E6-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in

General SCSI configuration checks to resolve the problem.

2E6-803 2E6-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2E7-101 2E7-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221

2E7-102 2E7-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293

2E7-103 2E7-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_2E7
- FFC_221

2E7-212 2E7-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_2E7

2E7-213 2E7-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_2E7

2E7-214 2E7-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_2E7

2E7-215 2E7-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_2E7

2E7-216 2E7-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_2E7

2E7-217 2E7-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_2E7

2E7-218 2E7-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_2E7

2E7-219 2E7-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-220 2E7-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_2E7

2E7-221 2E7-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_2E7
 - FFC_221
-

2E7-222 2E7-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_2E7
-

2E7-223 2E7-223

Explanation: Miscompare during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_2E7
-

2E7-224 2E7-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_2E7
 - FFC_221
-

2E7-225 2E7-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_2E7
-

2E7-226 2E7-226

Explanation: SCSI wrap or PTC failure.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-227 2E7-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_2E7
 - FFC_221
-

2E7-230 2E7-230

Explanation: Arbitration test failed.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-231 2E7-231

Explanation: Function could not complete.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-232 2E7-232

Explanation: SCSI bus data miscompare.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-240 2E7-240

Explanation: No terminal power.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-242 2E7-242

Explanation: SCSI bus problem.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-301 2E7-301

Explanation: Configuration open failed for parent bus.

Failing Item:

- FFC_2E7
-

2E7-701 2E7-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_2E7
-

2E7-801 2E7-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2E7-802 2E7-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not

2E7-803 • 2D07-721

reported, use the SCSI service hints in

General SCSI configuration checks to resolve the problem.

2E7-803 2E7-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2EF-101 2EF-101

Explanation: Post indicates an adapter failure.

Failing Item:

- FFC_751

2D07-101 2D07-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2D07

2D07-710 2D07-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2D07

2D07-711 2D07-711

Explanation: Adapter failure.

Failing Item:

- FFC_2D07

2D07-712 2D07-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2D07

2D07-713 2D07-713

Explanation: Adapter failure.

Failing Item:

- FFC_2D07

2D07-714 2D07-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2D07

2D07-715 2D07-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2D07

2D07-716 2D07-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2D07
- FFC_293

2D07-717 2D07-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2D07
- FFC_293

2D07-718 2D07-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2D07
- FFC_293

2D07-719 2D07-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2D07-720 2D07-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2D07-721 2D07-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2D07-722 **2D07-722**
Explanation: Device bus interface problem.**Failing Item:**

- FFC_2D07
-

2D07-723 **2D07-723****Explanation:** Device bus interface problem.**Response:** Use MAP0054.

2D07-724 **2D07-724**
Explanation: Temporary device bus interface problem.**Failing Item:**

- FFC_2D07
-

2D07-725 **2D07-725****Explanation:** Temporary device bus interface problem.**Response:** Use MAP0054.

2D0B-101 **2D0B-101**
Explanation: Adapter configuration error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2D0B
-

2D0B-710 **2D0B-710****Explanation:** Permanent controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D0B
-

2D0B-713 **2D0B-713****Explanation:** Controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D0B
-

2D0B-720 **2D0B-720****Explanation:** Controller device bus configuration error.**Response:** Use MAP3150.

2D14-101 **2D14-101**
Explanation: Adapter configuration error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2D14
-

2D14-710 **2D14-710****Explanation:** Permanent controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D14
-

2D14-713 **2D14-713****Explanation:** Controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D14
-

2D14-720 **2D14-720****Explanation:** Controller device bus configuration error.**Response:** Use MAP4150.

2D15-101 **2D15-101**
Explanation: Adapter configuration error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2D15
-

2D15-710 **2D15-710****Explanation:** Permanent controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D15
-

2D15-713 **2D15-713****Explanation:** Controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D15
-

2D15-720 • 2D1D-101

2D15-720 **2D15-720**

Explanation: Controller device bus configuration error.

Response: Use MAP4150.

2D16-101 **2D16-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D16
-

2D16-710 **2D16-710**

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-713 **2D16-713**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-720 **2D16-720**

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D17-101 **2D17-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D17
-

2D17-710 **2D17-710**

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-713 **2D17-713**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-720 **2D17-720**

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D18-101 **2D18-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D18
-

2D18-710 **2D18-710**

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
-

2D18-713 **2D18-713**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
-

2D18-720 **2D18-720**

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D1D-101 **2D1D-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D1D
-

2D1D-710 2D1D-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-713 2D1D-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-720 2D1D-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D20-101 2D20-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D20
-

2D20-710 2D20-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
-

2D20-713 2D20-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
-

2D20-720 2D20-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D23-101 2D23-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-710 2D23-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-713 2D23-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-720 2D23-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2D24-101 2D24-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-710 2D24-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-713 2D24-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-720 • 2D28-101

2D24-720 **2D24-720**

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D25-101 **2D25-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-710 **2D25-710**

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-713 **2D25-713**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-720 **2D25-720**

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2D26-101 **2D26-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D26
-

2D26-710 **2D26-710**

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
-

2D26-713 **2D26-713**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
-

2D26-720 **2D26-720**

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D27-101 **2D27-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D27
-

2D27-710 **2D27-710**

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
-

2D27-713 **2D27-713**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
-

2D27-720 **2D27-720**

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D28-101 **2D28-101**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D28
-

2D28-710 **2D28-710****Explanation:** Permanent controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D28
-

2D28-713 **2D28-713****Explanation:** Controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D28
-

2D28-720 **2D28-720****Explanation:** Controller device bus configuration error.**Response:** Use MAP4050.

2D40-101 **2D40-101****Explanation:** Adapter configuration error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2D40
-

2D40-710 **2D40-710****Explanation:** Permanent controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D40
-

2D40-713 **2D40-713****Explanation:** Controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D40
-

2D40-720 **2D40-720****Explanation:** Controller device bus configuration error.**Response:** Use MAP3150.

2E01-101 **2E01-101****Explanation:** Register Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01
-

2E01-102 **2E01-102****Explanation:** VPD Checksum Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01
-

2E01-103 **2E01-103****Explanation:** Flash Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01
-

2E01-104 **2E01-104****Explanation:** Internal Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01
-

2E01-105 **2E01-105****Explanation:** External Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01
-

2E01-106 **2E01-106****Explanation:** External Wrap with IP Checksum Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01
-

2E01-107 • 2E02-103

2E01-107 2E01-107

Explanation: External Wrap with TCP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-108 2E01-108

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-109 2E01-109

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-201 2E01-201

Explanation: Enhanced Error Handling Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-202 2E01-202

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-601 2E01-601

Explanation: Error log analysis indicates a hardware error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-602 2E01-602

Explanation: Error log analysis indicates an EEH error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-603 2E01-603

Explanation: Error log analysis indicates an EEPROM error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-604 2E01-604

Explanation: Error log analysis indicates transmission errors.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E02-101 2E02-101

Explanation: Register Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E02
-

2E02-102 2E02-102

Explanation: VPD Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E02
-

2E02-103 2E02-103

Explanation: Flash Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E02
-

2E02-104 **2E02-104****Explanation:** Internal Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-105 **2E02-105****Explanation:** External Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-106 **2E02-106****Explanation:** External Wrap with IP Checksum Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-107 **2E02-107****Explanation:** External Wrap with TCP Checksum Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-108 **2E02-108****Explanation:** Network link test failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-109 **2E02-109****Explanation:** Network link test failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-201 **2E02-201****Explanation:** Enhanced Error Handling Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-202 **2E02-202****Explanation:** Network link test failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-601 **2E02-601****Explanation:** Error log analysis indicates a hardware error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-602 **2E02-602****Explanation:** Error log analysis indicates an EEH error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-603 **2E02-603****Explanation:** Error log analysis indicates an EEPROM error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-604 **2E02-604****Explanation:** Error log analysis indicates transmission errors.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E03-101 • 2E03-602

2E03-101 2E03-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E03
-

2E03-102 2E03-102

Explanation: Internal Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03
-

2E03-103 2E03-103

Explanation: External Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03
-

2E03-104 2E03-104

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Failing Item:

- FFC_2E03
-

2E03-105 2E03-105

Explanation: Failure to initialize due to a physical Interface test failure

Failing Item:

- FFC_2E03
-

2E03-106 2E03-106

Explanation: External IP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03
-

2E03-107 2E03-107

Explanation: External UDP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03
-

2E03-108 2E03-108

Explanation: External TCP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03
-

2E03-109 2E03-109

Explanation: External Wrap Loopback Test Failure (10Gbps)

Failing Item:

- FFC_2E03
-

2E03-110 2E03-110

Explanation: External Link Test Failure (10Gbps)

Failing Item:

- FFC_2E03
-

2E03-111 2E03-111

Explanation: Failure to initialize due to a EEH Failure

Failing Item:

- FFC_2E03
-

2E03-201 2E03-201

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2E03
 - FFC_221
-

2E03-202 2E03-202

Explanation: External Link Test Failure without External Wrap Test (10Gbps)

Failing Item:

- FFC_2E03
 - FFC_221
-

2E03-601 2E03-601

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2E03
-

2E03-602 2E03-602

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2E03
-

2E04-101 **2E04-101**

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E04
-

2E04-102 **2E04-102**

Explanation: Internal Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-103 **2E04-103**

Explanation: External Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-104 **2E04-104**

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Failing Item:

- FFC_2E04
-

2E04-105 **2E04-105**

Explanation: Failure to initialize due to a physical Interface test failure

Failing Item:

- FFC_2E04
-

2E04-106 **2E04-106**

Explanation: External IP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-107 **2E04-107**

Explanation: External UDP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-108 **2E04-108**

Explanation: External TCP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-109 **2E04-109**

Explanation: External Wrap Loopback Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-110 **2E04-110**

Explanation: External Link Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-111 **2E04-111**

Explanation: Failure to initialize due to a EEH Failure

Failing Item:

- FFC_2E04
-

2E04-201 **2E04-201**

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2E04
 - FFC_221
-

2E04-202 **2E04-202**

Explanation: External Link Test Failure without External Wrap Test (10Gbps)

Failing Item:

- FFC_2E04
 - FFC_221
-

2E04-601 **2E04-601**

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2E04
-

2E04-602 **2E04-602**

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2E04
-

2E07-101 • 2E08-103

2E07-101 2E07-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E07
-

2E07-102 2E07-102

Explanation: Configuration register test failure

Failing Item:

- FFC_2E07
-

2E07-103 2E07-103

Explanation: EEPROM checksum error

Failing Item:

- FFC_2E07
-

2E07-104 2E07-104

Explanation: Flash checksum error

Failing Item:

- FFC_2E07
-

2E07-105 2E07-105

Explanation: Internal loopback test failure

Failing Item:

- FFC_2E07
-

2E07-106 2E07-106

Explanation: Internal loopback - IP checksum test failure

Failing Item:

- FFC_2E07
-

2E07-107 2E07-107

Explanation: Internal loopback - TCP checksum test failure

Failing Item:

- FFC_2E07
-

2E07-108 2E07-108

Explanation: External loopback test failure

Failing Item:

- FFC_2E07
-

2E07-109 2E07-109

Explanation: External loopback - IP checksum test failure

Failing Item:

- FFC_2E07
-

2E07-110 2E07-110

Explanation: External loopback - TCP checksum test failure

Failing Item:

- FFC_2E07
-

2E07-111 2E07-111

Explanation: Failure to initialize due to a EEH failure

Failing Item:

- FFC_2E07
 - FFC_221
-

2E07-201 2E07-201

Explanation: External link test failure without external wrap test (10Gbps)

Failing Item:

- FFC_2E07
-

2E07-202 2E07-202

Explanation: External link test failure without external wrap test (1Gbps)

Failing Item:

- FFC_2E07
-

2E08-101 2E08-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E08
-

2E08-102 2E08-102

Explanation: Configuration register test failure

Failing Item:

- FFC_2E08
-

2E08-103 2E08-103

Explanation: EEPROM checksum error

Failing Item:

- FFC_2E08
-

2E08-104 2E08-104

Explanation: Flash checksum error

Failing Item:

- FFC_2E08
-

2E08-105 2E08-105

Explanation: Internal loopback test failure

Failing Item:

- FFC_2E08
-

2E08-106 2E08-106

Explanation: Internal loopback - IP checksum test failure

Failing Item:

- FFC_2E08
-

2E08-107 2E08-107

Explanation: Internal loopback - TCP checksum test failure

Failing Item:

- FFC_2E08
-

2E08-108 2E08-108

Explanation: External loopback test failure

Failing Item:

- FFC_2E08
-

2E08-109 2E08-109

Explanation: External loopback - IP checksum test failure

Failing Item:

- FFC_2E08
-

2E08-110 2E08-110

Explanation: External loopback - TCP checksum test failure

Failing Item:

- FFC_2E08
-

2E08-111 2E08-111

Explanation: Failure to initialize due to a EEH failure

Failing Item:

- FFC_2E08
 - FFC_221
-

2E08-201 2E08-201

Explanation: External link test failure without external wrap test (10Gbps)

Failing Item:

- FFC_2E08
-

2E08-202 2E08-202

Explanation: External link test failure without external wrap test (1Gbps)

Failing Item:

- FFC_2E08
-

2E0B-101 2E0B-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E0B
-

2E0B-102 2E0B-102

Explanation: Configuration register test failure

Failing Item:

- FFC_2E0B
-

2E0B-103 2E0B-103

Explanation: EEPROM checksum error

Failing Item:

- FFC_2E0B
-

2E0B-104 2E0B-104

Explanation: Flash checksum error

Failing Item:

- FFC_2E0B
-

2E0B-105 2E0B-105

Explanation: Internal loopback test failure

Failing Item:

- FFC_2E0B
-

2E0B-106 2E0B-106

Explanation: Internal loopback - IP checksum test failure

Failing Item:

- FFC_2E0B
-

2E0B-107 • 2E12-701

2E0B-107 2E0B-107

Explanation: Internal loopback - TCP checksum test failure

Failing Item:

- FFC_2E0B
-

2E0B-108 2E0B-108

Explanation: External loopback test failure

Failing Item:

- FFC_2E0B
-

2E0B-109 2E0B-109

Explanation: External loopback - IP checksum test failure

Failing Item:

- FFC_2E0B
-

2E0B-110 2E0B-110

Explanation: External loopback - TCP checksum test failure

Failing Item:

- FFC_2E0B
-

2E0B-111 2E0B-111

Explanation: Failure to initialize due to a EEH failure

Failing Item:

- FFC_2E0B
 - FFC_221
-

2E0B-201 2E0B-201

Explanation: External link test failure without external wrap test (10Gbps)

Failing Item:

- FFC_2E0B
-

2E0B-202 2E0B-202

Explanation: External link test failure without external wrap test (1Gbps)

Failing Item:

- FFC_2E0B
-

2E12-201 2E12-201

Explanation: Adapter configuration error.

Failing Item:

- FFC_2E12
-

- FFC_221
-

2E12-601 2E12-601

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_2E12
-

2E12-602 2E12-602

Explanation: Error log analysis indicates an error attention condition.

Failing Item:

- FFC_2E12
-

2E12-603 2E12-603

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Failing Item:

- FFC_2E12
-

2E12-604 2E12-604

Explanation: Error log analysis indicates a permanent adapter failure.

Failing Item:

- FFC_2E12
-

2E12-605 2E12-605

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_2E12
-

2E12-606 2E12-606

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_2E12
-

2E12-701 2E12-701

Explanation: Error log analysis indicates permanent adapter failure.

Failing Item:

- FFC_2E12
 - FFC_221
-

2E12-702 **2E12-702**

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_2E12
 - FFC_221
-

2E20-201 **2E20-201**

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
 - FFC_221
-

2E20-601 **2E20-601**

Explanation: Error log analysis indicates adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-602 **2E20-602**

Explanation: Error log analysis indicates an error attention condition.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-603 **2E20-603**

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-604 **2E20-604**

Explanation: Error log analysis indicates a permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-605 **2E20-605**

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-606 **2E20-606**

Explanation: Error log analysis indicates adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-701 **2E20-701**

Explanation: Error log analysis indicates permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
 - FFC_221
-

2E20-702 **2E20-702**

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
 - FFC_221
-

2E22-101 **2E22-101**

Explanation: Register Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-102 • 2E22-602

2E22-102 2E22-102

Explanation: VPD Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-103 2E22-103

Explanation: Flash Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-104 2E22-104

Explanation: Internal Wrap Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-105 2E22-105

Explanation: External Wrap Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-106 2E22-106

Explanation: External Wrap with IP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-107 2E22-107

Explanation: External Wrap with TCP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-108 2E22-108

Explanation: External Wrap with UDP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-109 2E22-109

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-201 2E22-201

Explanation: Enhanced Error Handling Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-202 2E22-202

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-601 2E22-601

Explanation: Error log analysis indicates a hardware error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-602 2E22-602

Explanation: Error log analysis indicates an EEH error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-603 **2E22-603**

Explanation: Error log analysis indicates an EEPROM error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-604 **2E22-604**

Explanation: Error log analysis indicates transmission errors.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E30-111 **2E30-111**

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-112 **2E30-112**

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
 - FFC_221
-

2E30-140 **2E30-140**

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-141 **2E30-141**

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-142 **2E30-142**

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-151 **2E30-151**

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-152 **2E30-152**

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-153 **2E30-153**

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-154 **2E30-154**

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-155 **2E30-155**

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
-

2E30-161 • 2E31-140

2E30-161 2E30-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-162 2E30-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-163 2E30-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-164 2E30-164

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-165 2E30-165

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-201 2E30-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
- FFC_221

2E30-701 2E30-701

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-702 2E30-702

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
- FFC_221

2E30-703 2E30-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E31-111 2E31-111

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31

2E31-112 2E31-112

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
- FFC_221

2E31-140 2E31-140

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31

2E31-141 **2E31-141**

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-142 **2E31-142**

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-151 **2E31-151**

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-152 **2E31-152**

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-153 **2E31-153**

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-154 **2E31-154**

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-155 **2E31-155**

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-161 **2E31-161**

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-162 **2E31-162**

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-163 **2E31-163**

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-164 **2E31-164**

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-165 **2E31-165**

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-201 • 2E38-153

2E31-201 2E31-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
- FFC_221

2E31-701 2E31-701

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31

2E31-702 2E31-702

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
- FFC_221

2E31-703 2E31-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31

2E38-111 2E38-111

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38

2E38-112 2E38-112

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
- FFC_221

2E38-140 2E38-140

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38

2E38-141 2E38-141

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38

2E38-142 2E38-142

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38

2E38-151 2E38-151

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38

2E38-152 2E38-152

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38

2E38-153 2E38-153

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38

2E38-154 **2E38-154**

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-155 **2E38-155**

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-161 **2E38-161**

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-162 **2E38-162**

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-163 **2E38-163**

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-164 **2E38-164**

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-165 **2E38-165**

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-201 **2E38-201**

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
 - FFC_221
-

2E38-701 **2E38-701**

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-702 **2E38-702**

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
 - FFC_221
-

2E38-703 **2E38-703**

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E39-111 **2E39-111**

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-112 2E39-112

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
 - FFC_221
-

2E39-140 2E39-140

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-141 2E39-141

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-142 2E39-142

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-151 2E39-151

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-152 2E39-152

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-153 2E39-153

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-154 2E39-154

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-155 2E39-155

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-161 2E39-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-162 2E39-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-163 2E39-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-164 **2E39-164**

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-165 **2E39-165**

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-201 **2E39-201**

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
 - FFC_221
-

2E39-701 **2E39-701**

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-702 **2E39-702**

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
 - FFC_221
-

2E39-703 **2E39-703**

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E3B-111 **2E3B-111**

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-112 **2E3B-112**

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
 - FFC_221
-

2E3B-140 **2E3B-140**

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-141 **2E3B-141**

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-142 **2E3B-142**

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-151 **2E3B-151**

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-152 2E3B-152

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-153 2E3B-153

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-154 2E3B-154

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-155 2E3B-155

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-161 2E3B-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-162 2E3B-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-163 2E3B-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-164 2E3B-164

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-165 2E3B-165

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-201 2E3B-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
 - FFC_221
-

2E3B-701 2E3B-701

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-702 2E3B-702

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
 - FFC_221
-

2E3B-703 **2E3B-703**

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2D07-102E **2D07-102E**

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-3002 **2D07-3002**

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-3010 **2D07-3010**

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-3020 **2D07-3020**

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D07-3100 **2D07-3100**

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D07-3101 **2D07-3101**

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D07-3109 **2D07-3109**

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D07-3110 **2D07-3110**

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D07-7001 **2D07-7001**

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2D07-8008 **2D07-8008**

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01
-

2D07-8009 **2D07-8009**

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01
-

2D07-9000 **2D07-9000**

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2D07-9001 **2D07-9001**

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2D07-9002 **2D07-9002**

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2D07-9008 **2D07-9008**

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D07-9010 • 2D07-9050

2D07-9010 2D07-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D07-9011 2D07-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D07-9020 2D07-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2D07-9021 2D07-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2D07-9022 2D07-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2D07-9023 2D07-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012

2D07-9024 2D07-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2D07-9025 2D07-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2D07-9026 2D07-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190

2D07-9027 2D07-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2D07-9028 2D07-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2D07-9029 2D07-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2D07-9030 2D07-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2D07-9031 2D07-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2D07-9032 2D07-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

2D07-9041 2D07-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2D07-9042 2D07-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D07-9050 2D07-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

2D07-9051 2D07-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2D07-9052 2D07-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D07-9054 2D07-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2D07-9060 2D07-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2D07-9061 2D07-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2D07-9062 2D07-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2D07-9063 2D07-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2D07-9073 2D07-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D07-9074 2D07-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2D07-9081 2D07-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2D07-9082 2D07-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2D07-9090 2D07-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D07-9091 2D07-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D07-9092 2D07-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2D07-9200 2D07-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2D07-FFF3 2D07-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2D07-FFF4 2D07-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2D07-FFF6 2D07-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-FFFA 2D07-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722

2D07-FFFE 2D07-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2D0B-102E 2D0B-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 :
General Problem Resolution

Failing Item:

- FFC_722

2D0B-3002 2D0B-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 :
General Problem Resolution

Failing Item:

- FFC_722

2D0B-3010 2D0B-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 :
General Problem Resolution

Failing Item:

- FFC_722

2D0B-3020 2D0B-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D0B-3100 2D0B-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D0B-3109 2D0B-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D0B-3110 2D0B-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D0B-4010 2D0B-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D0B-4020 2D0B-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D0B-4030 2D0B-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144

2D0B-4040 2D0B-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144

2D0B-4041 2D0B-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D0B-4050 2D0B-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D0B-4060 2D0B-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D0B-4100 2D0B-4100**Explanation:** Device bus fabric error.**Response:** Use MAP3152.

2D0B-4101 2D0B-4101**Explanation:** Temporary device bus fabric error.**Response:** Use MAP3152.

2D0B-4110 2D0B-4110**Explanation:** Unsupported enclosure function detected.**Response:** Use MAP3145.

2D0B-4150 2D0B-4150**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D0B
- FFC_221

2D0B-4160 2D0B-4160**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D0B
- FFC_221

2D0B-7001 2D0B-7001**Explanation:** Temporary disk data error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2D0B-8150 2D0B-8150**Explanation:** Controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D0B

2D0B-8157 2D0B-8157**Explanation:** Temporary controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D0B

2D0B-9000 2D0B-9000**Explanation:** Controller detected device error during configuration discovery.**Response:** Use MAP3190.

2D0B-9001 2D0B-9001**Explanation:** Controller detected device error during configuration discovery.**Response:** Use MAP3190.

2D0B-9002 2D0B-9002**Explanation:** Controller detected device error during configuration discovery.**Response:** Use MAP3190.

2D0B-9008 2D0B-9008**Explanation:** Controller does not support function expected for one or more disks.**Response:** Use MAP3130.

2D0B-9010 2D0B-9010**Explanation:** Cache data associated with attached disks cannot be found.**Response:** Use MAP3120.

2D0B-9011 2D0B-9011**Explanation:** Cache data belongs to disks other than those attached.**Response:** Use MAP3190.

2D0B-9020 2D0B-9020**Explanation:** Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.**Response:** Use MAP3111.

2D0B-9021 2D0B-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D0B-9022 2D0B-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D0B-9023 2D0B-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D0B-9024 2D0B-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D0B-9025 2D0B-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D0B-9026 2D0B-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D0B-9027 2D0B-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D0B-9028 2D0B-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D0B-9029 2D0B-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D0B-9030 2D0B-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D0B-9031 2D0B-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D0B-9032 2D0B-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D0B-9041 2D0B-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D0B-9042 2D0B-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D0B-9050 2D0B-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D0B-9051 2D0B-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D0B-9052 2D0B-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D0B-9054 2D0B-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D0B-9060 2D0B-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D0B-9061 2D0B-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D0B-9062 2D0B-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D0B-9063 2D0B-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D0B-9073 2D0B-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140

2D0B-9074 2D0B-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D0B-9075 2D0B-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149

2D0B-9076 2D0B-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2D0B-9081 2D0B-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D0B-9082 2D0B-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D0B-9090 2D0B-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D0B-9091 2D0B-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D0B-9092 2D0B-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2D0B-FF3D 2D0B-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D0B
-

2D0B-FFF3 2D0B-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2D0B-FFF4 2D0B-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-FFF6 2D0B-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-FFFA 2D0B-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D0B-FFFE 2D0B-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D14-102E 2D14-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D14-3002 2D14-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D14-3010 2D14-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D14-3020 2D14-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4150.

2D14-3100 2D14-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4150.

2D14-3109 2D14-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4150.

2D14-3110 2D14-3110

Explanation: Disk bus interface error.

Response: Use MAP4150.

2D14-4010 2D14-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D14-4020 2D14-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D14-4030 2D14-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4144.

2D14-4040 2D14-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4144.

2D14-4041 2D14-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D14-4050 2D14-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D14-4060 2D14-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4153.

2D14-4100 **2D14-4100**

Explanation: Device bus fabric error.

Response: Use MAP4152.

2D14-4101 **2D14-4101**

Explanation: Temporary device bus fabric error.

Response: Use MAP4152.

2D14-4110 **2D14-4110**

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D14-4150 **2D14-4150**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
 - FFC_221
-

2D14-4160 **2D14-4160**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
 - FFC_221
-

2D14-7001 **2D14-7001**

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D14-8150 **2D14-8150**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
-

2D14-8157 **2D14-8157**

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
-

2D14-9000 **2D14-9000**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D14-9001 **2D14-9001**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D14-9002 **2D14-9002**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D14-9008 **2D14-9008**

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D14-9010 **2D14-9010**

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D14-9011 **2D14-9011**

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D14-9020 **2D14-9020**

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D14-9021 • 2D14-9054

2D14-9021 2D14-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D14-9022 2D14-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D14-9023 2D14-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D14-9024 2D14-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D14-9025 2D14-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D14-9026 2D14-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D14-9027 2D14-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D14-9028 2D14-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D14-9029 2D14-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D14-9030 2D14-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D14-9031 2D14-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D14-9032 2D14-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D14-9041 2D14-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D14-9042 2D14-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D14-9050 2D14-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D14-9051 2D14-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D14-9052 2D14-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D14-9054 2D14-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D14-9060 2D14-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D14-9061 2D14-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D14-9062 2D14-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D14-9063 2D14-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D14-9073 2D14-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4140.

2D14-9074 2D14-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4141.

2D14-9075 2D14-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4149.

2D14-9076 2D14-9076

Explanation: Missing remote controller.

Response: Use MAP4147.

2D14-9081 2D14-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D14-9082 2D14-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D14-9090 2D14-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D14-9091 2D14-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D14-9092 2D14-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D14-FF3D 2D14-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D14
-

2D14-FFF3 2D14-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D14-FFF4 2D14-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-FFF6 2D14-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-FFFA 2D14-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D14-FFFE 2D14-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D15-102E 2D15-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D15-3002 2D15-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D15-3010 2D15-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D15-3020 2D15-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4150.

2D15-3100 2D15-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4150.

2D15-3109 2D15-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4150.

2D15-3110 2D15-3110

Explanation: Disk bus interface error.

Response: Use MAP4150.

2D15-4010 2D15-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D15-4020 2D15-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D15-4030 2D15-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4144.

2D15-4040 2D15-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4144.

2D15-4041 2D15-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D15-4050 2D15-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D15-4060 2D15-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4153.

2D15-4100 2D15-4100

Explanation: Device bus fabric error.

Response: Use MAP4152.

2D15-4101 2D15-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4152.

2D15-4110 2D15-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D15-4150 2D15-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
 - FFC_221
-

2D15-4160 2D15-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
 - FFC_221
-

2D15-7001 2D15-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D15-8008 2D15-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D19
-

2D15-8009 2D15-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D19
-

2D15-8150 2D15-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
-

2D15-8157 2D15-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
-

2D15-9000 2D15-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D15-9001 2D15-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D15-9002 2D15-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D15-9008 2D15-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D15-9010 2D15-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D15-9011 • 2D15-9051

2D15-9011 2D15-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D15-9020 2D15-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D15-9021 2D15-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D15-9022 2D15-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D15-9023 2D15-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D15-9024 2D15-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D15-9025 2D15-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D15-9026 2D15-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D15-9027 2D15-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D15-9028 2D15-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D15-9029 2D15-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D15-9030 2D15-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D15-9031 2D15-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D15-9032 2D15-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D15-9041 2D15-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D15-9042 2D15-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D15-9050 2D15-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D15-9051 2D15-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D15-9052 2D15-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D15-9054 2D15-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D15-9060 2D15-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D15-9061 2D15-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D15-9062 2D15-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D15-9063 2D15-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D15-9073 2D15-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4140.

2D15-9074 2D15-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4141.

2D15-9075 2D15-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4149.

2D15-9076 2D15-9076

Explanation: Missing remote controller.

Response: Use MAP4147.

2D15-9081 2D15-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D15-9082 2D15-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D15-9090 2D15-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D15-9091 2D15-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D15-9092 2D15-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D15-FF3D 2D15-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D15
-

2D15-FFF3 2D15-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D15-FFF4 2D15-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D15-FFF6 2D15-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-FFFA 2D15-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-FFFE 2D15-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D16-102E 2D16-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-3002 2D16-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-3010 2D16-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-3020 2D16-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D16-3100 2D16-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D16-3109 2D16-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D16-3110 2D16-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D16-4010 2D16-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D16-4020 2D16-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D16-4030 2D16-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D16-4040 2D16-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D16-4041 2D16-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D16-4050 **2D16-4050**

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D16-4060 **2D16-4060**

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D16-4100 **2D16-4100**

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D16-4101 **2D16-4101**

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D16-4110 **2D16-4110**

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D16-4150 **2D16-4150**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
 - FFC_221
-

2D16-4160 **2D16-4160**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
 - FFC_221
-

2D16-7001 **2D16-7001**

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D16-8150 **2D16-8150**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-8157 **2D16-8157**

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-9000 **2D16-9000**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D16-9001 **2D16-9001**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D16-9002 **2D16-9002**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D16-9008 **2D16-9008**

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D16-9010 **2D16-9010**

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D16-9011 **2D16-9011**

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D16-9020 2D16-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D16-9021 2D16-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D16-9022 2D16-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D16-9023 2D16-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D16-9024 2D16-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D16-9025 2D16-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D16-9026 2D16-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D16-9027 2D16-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D16-9028 2D16-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D16-9029 2D16-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D16-9030 2D16-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D16-9031 2D16-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D16-9032 2D16-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D16-9041 2D16-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D16-9042 2D16-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D16-9050 2D16-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D16-9051 2D16-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D16-9052 2D16-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D16-9054 2D16-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D16-9060 2D16-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D16-9061 2D16-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D16-9062 2D16-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D16-9063 2D16-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D16-9073 2D16-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D16-9074 2D16-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D16-9075 2D16-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D16-9076 2D16-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D16-9081 2D16-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D16-9082 2D16-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D16-9090 2D16-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D16-9091 2D16-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D16-9092 2D16-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D16-FF3D 2D16-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D16
-

2D16-FFF3 2D16-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D16-FFF4 2D16-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-FFF6 2D16-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-FFFA 2D16-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-FFFE 2D16-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D17-102E 2D17-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-3002 2D17-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-3010 2D17-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-3020 2D17-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D17-3100 2D17-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D17-3109 2D17-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D17-3110 2D17-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D17-4010 2D17-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D17-4020 2D17-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D17-4030 2D17-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D17-4040 2D17-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D17-4041 2D17-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D17-4050 2D17-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D17-4060 2D17-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D17-4100 2D17-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D17-4101 2D17-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D17-4110 2D17-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D17-4150 2D17-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
 - FFC_221
-

2D17-4160 2D17-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
 - FFC_221
-

2D17-7001 2D17-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2D17-8008 2D17-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D17-8009 2D17-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D17-8150 2D17-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-8157 2D17-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-9000 2D17-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D17-9001 2D17-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D17-9002 2D17-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D17-9008 2D17-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D17-9010 2D17-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D17-9011 2D17-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D17-9020 2D17-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D17-9021 2D17-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D17-9022 2D17-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D17-9023 2D17-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D17-9024 2D17-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D17-9025 2D17-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D17-9026 2D17-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D17-9027 2D17-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D17-9028 2D17-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D17-9029 2D17-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D17-9030 2D17-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D17-9031 2D17-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D17-9032 2D17-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D17-9041 2D17-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D17-9042 2D17-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D17-9050 2D17-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D17-9051 2D17-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D17-9052 2D17-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D17-9054 2D17-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D17-9060 2D17-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D17-9061 2D17-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D17-9062 2D17-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D17-9063 2D17-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D17-9073 2D17-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D17-9074 2D17-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D17-9075 2D17-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D17-9076 2D17-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D17-9081 2D17-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D17-9082 2D17-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D17-9090 2D17-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D17-9091 2D17-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D17-9092 2D17-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D17-FF3D 2D17-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D17
-

2D17-FFF3 2D17-FFF3**Explanation:** Disk media format bad.**Response:** Use MAP3135

2D17-FFF4 2D17-FFF4**Explanation:** Disk drive problem.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D17-FFF6 2D17-FFF6**Explanation:** Disk detected recoverable error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D17-FFFA 2D17-FFFA**Explanation:** Temporary disk error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D17-FFFE 2D17-FFFE**Explanation:** Temporary disk bus error.**Response:** Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D18-102E 2D18-102E**Explanation:** Out of alternate disk storage for storage.**Response:** If the problem persists, use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D18-3002 2D18-3002**Explanation:** Addressed device failed to respond to selection.**Response:** If the problem persists, use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D18-3010 2D18-3010**Explanation:** Disk returned wrong response to adapter.**Response:** If the problem persists, use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D18-3020 2D18-3020**Explanation:** Storage subsystem configuration error.**Response:** Use MAP4050.

2D18-3100 2D18-3100**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP4050.

2D18-3109 2D18-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP4050.

2D18-3110 2D18-3110**Explanation:** Disk bus interface error.**Response:** Use MAP4050.

2D18-4010 2D18-4010**Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142

2D18-4020 2D18-4020**Explanation:** Configuration error, connections exceed IOA design limits.**Response:** Use MAP3143

2D18-4030 2D18-4030**Explanation:** Configuration error, incorrect multipath connection.**Response:** Use MAP4044.

2D18-4040 2D18-4040**Explanation:** Configuration error, incomplete multipath connection between controller and enclosure detected.**Response:** Use MAP4044.

2D18-4041 2D18-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D18-4050 2D18-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D18-4060 2D18-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D18-4100 2D18-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D18-4101 2D18-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D18-4110 2D18-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D18-4150 2D18-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
 - FFC_221
-

2D18-4160 2D18-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
 - FFC_221
-

2D18-7001 2D18-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D18-8008 2D18-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D18-8009 2D18-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D18-8150 2D18-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
-

2D18-8157 2D18-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
-

2D18-9000 2D18-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D18-9001 2D18-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D18-9002 • 2D18-9041

2D18-9002 2D18-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D18-9008 2D18-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D18-9010 2D18-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D18-9011 2D18-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D18-9020 2D18-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D18-9021 2D18-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D18-9022 2D18-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D18-9023 2D18-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D18-9024 2D18-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D18-9025 2D18-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D18-9026 2D18-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D18-9027 2D18-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D18-9028 2D18-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D18-9029 2D18-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D18-9030 2D18-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D18-9031 2D18-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D18-9032 2D18-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D18-9041 2D18-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D18-9042 2D18-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D18-9050 2D18-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D18-9051 2D18-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D18-9052 2D18-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D18-9054 2D18-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D18-9060 2D18-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D18-9061 2D18-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D18-9062 2D18-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D18-9063 2D18-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D18-9073 2D18-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D18-9074 2D18-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D18-9075 2D18-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D18-9076 2D18-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D18-9081 2D18-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D18-9082 2D18-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D18-9090 2D18-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D18-9091 2D18-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D18-9092 2D18-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D18-FF3D 2D18-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D18
-

2D18-FFF3 2D18-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D18-FFF4 2D18-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-FFF6 2D18-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-FFFA 2D18-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-FFFE 2D18-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D1D-102E 2D1D-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-3002 2D1D-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-3010 2D1D-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-3020 2D1D-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D1D-3100 2D1D-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D1D-3109 2D1D-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D1D-310C 2D1D-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D1D-310D 2D1D-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D1D-3110 2D1D-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D1D-4010 2D1D-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D1D-4020 2D1D-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D1D-4030 2D1D-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D1D-4040 2D1D-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D1D-4041 2D1D-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D1D-4050 2D1D-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D1D-4060 2D1D-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D1D-4080 2D1D-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D1D-4085 2D1D-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D1D-4100 2D1D-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D1D-4101 2D1D-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D1D-4102 2D1D-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D1D-4110 2D1D-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D1D-4120 2D1D-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D1D-4121 2D1D-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D1D-4150 2D1D-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
 - FFC_221
-

2D1D-4160 2D1D-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
 - FFC_221
-

2D1D-4170 2D1D-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D1D-4171 2D1D-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D1D-7001 2D1D-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D1D-8008 2D1D-8008

Explanation: A permanent Cache Power Pack failure occurred.

Response: Use MAP3200.

Failing Item:

- FFC_2D1D
-

2D1D-8009 2D1D-8009

Explanation: Impending Cache Power Pack failure.

Response: Use MAP3200.

Failing Item:

- FFC_2D1D
-

2D1D-8150 2D1D-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-8157 2D1D-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-9000 2D1D-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1D-9001 2D1D-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1D-9002 2D1D-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1D-9008 2D1D-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D1D-9010 2D1D-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D1D-9011 2D1D-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D1D-9020 2D1D-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1D-9021 2D1D-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1D-9022 2D1D-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1D-9023 2D1D-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D1D-9024 2D1D-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D1D-9025 2D1D-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D1D-9026 2D1D-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D1D-9027 2D1D-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D1D-9028 2D1D-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D1D-9029 2D1D-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D1D-9030 2D1D-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D1D-9031 2D1D-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D1D-9032 2D1D-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D1D-9041 2D1D-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D1D-9042 2D1D-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D1D-9050 2D1D-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D1D-9051 2D1D-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D1D-9052 2D1D-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D1D-9054 2D1D-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D1D-9060 2D1D-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D1D-9061 2D1D-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D1D-9062 • 2D1D-FFFA

2D1D-9062 2D1D-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D1D-9063 2D1D-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D1D-9073 2D1D-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D1D-9074 2D1D-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D1D-9075 2D1D-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D1D-9076 2D1D-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D1D-9081 2D1D-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D1D-9082 2D1D-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D1D-9090 2D1D-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D1D-9091 2D1D-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D1D-9092 2D1D-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234

2D1D-FF3D 2D1D-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D1D
-

2D1D-FFF3 2D1D-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235

2D1D-FFF4 2D1D-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-FFF6 2D1D-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-FFFA 2D1D-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-FFFC 2D1D-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D1D-FFFF 2D1D-FFFF

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D1D-FFFE 2D1D-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D20-102E 2D20-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution,

Failing Item:

- FFC_722
-

2D20-3002 2D20-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D20-3010 2D20-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D20-3020 2D20-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D20-3100 2D20-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D20-3109 2D20-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D20-310C 2D20-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D20-310D 2D20-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D20-3110 2D20-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D20-4010 2D20-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D20-4020 2D20-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D20-4030 2D20-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D20-4040 2D20-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D20-4041 **2D20-4041**

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D20-4050 **2D20-4050**

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D20-4060 **2D20-4060**

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D20-4080 **2D20-4080**

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D20-4085 **2D20-4085**

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D20-4100 **2D20-4100**

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D20-4101 **2D20-4101**

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D20-4102 **2D20-4102**

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D20-4110 **2D20-4110**

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D20-4120 **2D20-4120**

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D20-4121 **2D20-4121**

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D20-4150 **2D20-4150**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
 - FFC_221
-

2D20-4160 **2D20-4160**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
 - FFC_221
-

2D20-4170 **2D20-4170**

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D20-4171 **2D20-4171**

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D20-7001 **2D20-7001**

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D20-8008 **2D20-8008**

Explanation: A permanent Cache Power Pack failure occurred.

Response: Use MAP3200.

Failing Item:

- FFC_2D20
-

2D20-8009 **2D20-8009**

Explanation: Impending Cache Power Pack failure.

Response: Use MAP3200.

Failing Item:

- FFC_2D20
-

2D20-8150 **2D20-8150**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
-

2D20-8157 **2D20-8157**

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
-

2D20-9000 **2D20-9000**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D20-9001 **2D20-9001**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D20-9002 **2D20-9002**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D20-9008 **2D20-9008**

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D20-9010 **2D20-9010**

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D20-9011 **2D20-9011**

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D20-9020 **2D20-9020**

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D20-9021 **2D20-9021**

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D20-9022 **2D20-9022**

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D20-9023 **2D20-9023**

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D20-9024 **2D20-9024**

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D20-9025 **2D20-9025**

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D20-9026 2D20-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D20-9027 2D20-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D20-9028 2D20-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D20-9029 2D20-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D20-9030 2D20-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D20-9031 2D20-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D20-9032 2D20-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D20-9041 2D20-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D20-9042 2D20-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D20-9050 2D20-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D20-9051 2D20-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D20-9052 2D20-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D20-9054 2D20-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D20-9060 2D20-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D20-9061 2D20-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D20-9062 2D20-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D20-9063 2D20-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D20-9073 2D20-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D20-9074 2D20-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D20-9075 2D20-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D20-9076 2D20-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D20-9081 2D20-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D20-9082 2D20-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D20-9090 2D20-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D20-9091 2D20-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D20-9092 2D20-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234

2D20-FF3D 2D20-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20

2D20-FFF3 2D20-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235

2D20-FFF4 2D20-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D20-FFF6 2D20-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D20-FFFA 2D20-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D20-FFFC 2D20-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D20-FFFD 2D20-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D20-FFFE 2D20-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D23-102E 2D23-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-3002 2D23-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-3010 2D23-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-3020 2D23-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D23-3100 2D23-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D23-3109 2D23-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D23-3110 2D23-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D23-4010 2D23-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D23-4020 2D23-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D23-4030 2D23-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2D23-4040 2D23-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2D23-4041 2D23-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D23-4050 2D23-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D23-4060 2D23-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D23-4100 2D23-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2D23-4101 2D23-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2D23-4110 2D23-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2D23-4150 **2D23-4150**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
 - FFC_221
-

2D23-4160 **2D23-4160**

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
 - FFC_221
-

2D23-7001 **2D23-7001**

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-8150 **2D23-8150**

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-8157 **2D23-8157**

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-9000 **2D23-9000**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D23-9001 **2D23-9001**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D23-9002 **2D23-9002**

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D23-9008 **2D23-9008**

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D23-9010 **2D23-9010**

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D23-9011 **2D23-9011**

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D23-9020 **2D23-9020**

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D23-9021 **2D23-9021**

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D23-9022 **2D23-9022**

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D23-9023 **2D23-9023**

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D23-9024 2D23-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D23-9025 2D23-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D23-9026 2D23-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D23-9027 2D23-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D23-9028 2D23-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D23-9029 2D23-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D23-9030 2D23-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D23-9031 2D23-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D23-9032 2D23-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D23-9041 2D23-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D23-9042 2D23-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D23-9050 2D23-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D23-9051 2D23-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D23-9052 2D23-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D23-9054 2D23-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D23-9060 2D23-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D23-9061 2D23-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D23-9062 2D23-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D23-9063 2D23-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D23-9073 2D23-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D23-9074 2D23-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D23-9075 2D23-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2D23-9076 2D23-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2D23-9081 2D23-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D23-9082 2D23-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D23-9090 2D23-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D23-9091 2D23-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D23-9092 2D23-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2D23-FF3D 2D23-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-FFF3 2D23-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2D23-FFF4 2D23-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-FFF6 2D23-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-FFFA 2D23-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-FFFE 2D23-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D24-102E 2D24-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 :
General Problem Resolution

Failing Item:

- FFC_722
-

2D24-3002 2D24-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 :
General Problem Resolution

Failing Item:

- FFC_722
-

2D24-3010 2D24-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 :
General Problem Resolution

Failing Item:

- FFC_722
-

2D24-3020 2D24-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D24-3100 2D24-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D24-3109 2D24-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D24-310C 2D24-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D24-310D 2D24-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D24-3110 2D24-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D24-4010 2D24-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D24-4020 2D24-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D24-4030 2D24-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D24-4040 2D24-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D24-4041 2D24-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D24-4050 2D24-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D24-4060 2D24-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D24-4080 2D24-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D24-4085 2D24-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D24-4100 2D24-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D24-4101 2D24-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D24-4102 2D24-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D24-4110 2D24-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D24-4120 2D24-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D24-4121 2D24-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D24-4150 2D24-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
 - FFC_221
-

2D24-4160 2D24-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
 - FFC_221
-

2D24-4170 2D24-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D24-4171 2D24-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D24-7001 2D24-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D24-8008 2D24-8008

Explanation: A permanent Cache Power Pack failure occurred.

Response: Use MAP3200.

Failing Item:

- FFC_2D24
-

2D24-8009 2D24-8009

Explanation: Impending Cache Power Pack failure.

Response: Use MAP3200.

Failing Item:

- FFC_2D24
-

2D24-8150 2D24-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-8157 2D24-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

2D24-9000 • 2D24-9031

- FFC_2D24

2D24-9000 2D24-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D24-9001 2D24-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D24-9002 2D24-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D24-9008 2D24-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D24-9010 2D24-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D24-9011 2D24-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D24-9020 2D24-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D24-9021 2D24-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D24-9022 2D24-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D24-9023 2D24-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D24-9024 2D24-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D24-9025 2D24-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D24-9026 2D24-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D24-9027 2D24-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D24-9028 2D24-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D24-9029 2D24-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D24-9030 2D24-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D24-9031 2D24-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D24-9032 2D24-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D24-9041 2D24-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D24-9042 2D24-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D24-9050 2D24-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D24-9051 2D24-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D24-9052 2D24-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D24-9054 2D24-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D24-9060 2D24-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D24-9061 2D24-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D24-9062 2D24-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D24-9063 2D24-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D24-9073 2D24-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D24-9074 2D24-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D24-9075 2D24-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D24-9076 2D24-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D24-9081 2D24-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D24-9082 2D24-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D24-9090 2D24-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D24-9091 2D24-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D24-9092 2D24-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234.

2D24-FF3D 2D24-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-FFF3 2D24-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235.

2D24-FFF4 2D24-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D24-FFF6 2D24-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D24-FFFA 2D24-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D24-FFFC 2D24-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D24-FFFD 2D24-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D24-FFFE 2D24-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D25-102E 2D25-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-3002 2D25-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-3010 2D25-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-3020 2D25-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D25-3100 2D25-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D25-3109 2D25-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D25-3110 2D25-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D25-4010 2D25-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D25-4020 2D25-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D25-4030 2D25-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2D25-4040 2D25-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2D25-4041 2D25-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D25-4050 2D25-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D25-4060 2D25-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D25-4100 2D25-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2D25-4101 2D25-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2D25-4110 2D25-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2D25-4150 2D25-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
 - FFC_221
-

2D25-4160 2D25-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
 - FFC_221
-

2D25-7001 2D25-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-8150 2D25-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

2D25-8157 • 2D25-9029

- FFC_2D25

2D25-8157 2D25-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25

2D25-9000 2D25-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D25-9001 2D25-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D25-9002 2D25-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D25-9008 2D25-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D25-9010 2D25-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D25-9011 2D25-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D25-9020 2D25-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D25-9021 2D25-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D25-9022 2D25-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D25-9023 2D25-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D25-9024 2D25-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D25-9025 2D25-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D25-9026 2D25-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D25-9027 2D25-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D25-9028 2D25-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D25-9029 2D25-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D25-9030 2D25-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D25-9031 2D25-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D25-9032 2D25-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D25-9041 2D25-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D25-9042 2D25-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D25-9050 2D25-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D25-9051 2D25-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D25-9052 2D25-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D25-9054 2D25-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D25-9060 2D25-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D25-9061 2D25-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D25-9062 2D25-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D25-9063 2D25-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D25-9073 2D25-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D25-9074 2D25-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D25-9075 2D25-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2D25-9076 2D25-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2D25-9081 2D25-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D25-9082 2D25-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D25-9090 2D25-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D25-9091 2D25-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D25-9092 2D25-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2D25-FF3D 2D25-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-FFF3 2D25-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2D25-FFF4 2D25-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-FFF6 2D25-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-FFFA 2D25-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-FFFE 2D25-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2D26-102E 2D26-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-3002 2D26-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-3010 2D26-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-3020 2D26-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D26-3100 2D26-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D26-3109 2D26-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D26-3110 2D26-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D26-4010 2D26-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D26-4020 2D26-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D26-4030 2D26-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D26-4040 2D26-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D26-4041 2D26-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D26-4050 2D26-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D26-4060 2D26-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D26-4100 2D26-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D26-4101 2D26-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D26-4110 2D26-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D26-4150 2D26-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
 - FFC_221
-

2D26-4160 2D26-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
 - FFC_221
-

2D26-7001 2D26-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D26-8008 2D26-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D26-8009 2D26-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D26-8150 2D26-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
-

2D26-8157 2D26-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
-

2D26-9000 2D26-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D26-9001 2D26-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D26-9002 2D26-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D26-9008 2D26-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D26-9010 2D26-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D26-9011 2D26-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D26-9020 2D26-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D26-9021 2D26-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D26-9022 2D26-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D26-9023 2D26-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D26-9024 2D26-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D26-9025 2D26-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D26-9026 2D26-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D26-9027 2D26-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D26-9028 2D26-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D26-9029 2D26-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D26-9030 2D26-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D26-9031 2D26-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D26-9032 2D26-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D26-9041 2D26-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D26-9042 2D26-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D26-9050 2D26-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D26-9051 2D26-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D26-9052 2D26-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D26-9054 2D26-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D26-9060 2D26-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D26-9061 2D26-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D26-9062 2D26-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D26-9063 2D26-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D26-9073 2D26-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D26-9074 2D26-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D26-9075 2D26-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D26-9076 2D26-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D26-9081 2D26-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D26-9082 2D26-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D26-9090 2D26-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D26-9091 2D26-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D26-9092 2D26-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D26-FF3D 2D26-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D26
-

2D26-FFF3 2D26-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D26-FFF4 2D26-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-FFF6 2D26-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-FFFA 2D26-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-FFFE 2D26-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D27-102E 2D27-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-3002 2D27-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-3010 2D27-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-3020 2D27-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D27-3100 2D27-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D27-3109 2D27-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D27-3110 2D27-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D27-4010 2D27-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D27-4020 2D27-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D27-4030 2D27-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D27-4040 2D27-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D27-4041 2D27-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D27-4050 2D27-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D27-4060 2D27-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D27-4100 2D27-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D27-4101 2D27-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D27-4110 2D27-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D27-4150 2D27-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
 - FFC_221
-

2D27-4160 2D27-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
 - FFC_221
-

2D27-7001 2D27-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2D27-8150 2D27-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
-

2D27-8157 2D27-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
-

2D27-9000 2D27-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D27-9001 2D27-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D27-9002 2D27-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D27-9008 2D27-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D27-9010 2D27-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D27-9011 2D27-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D27-9020 2D27-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D27-9021 2D27-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D27-9022 2D27-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D27-9023 2D27-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D27-9024 2D27-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D27-9025 2D27-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D27-9026 2D27-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D27-9027 2D27-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D27-9028 2D27-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D27-9029 2D27-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D27-9030 2D27-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D27-9031 2D27-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D27-9032 2D27-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D27-9041 2D27-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D27-9042 2D27-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D27-9050 2D27-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D27-9051 2D27-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D27-9052 2D27-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D27-9054 2D27-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D27-9060 2D27-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D27-9061 2D27-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D27-9062 2D27-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D27-9063 2D27-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D27-9073 2D27-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D27-9074 2D27-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D27-9075 2D27-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D27-9076 2D27-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D27-9081 2D27-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D27-9082 2D27-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D27-9090 2D27-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D27-9091 2D27-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D27-9092 2D27-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D27-FF3D 2D27-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D27
-

2D27-FFF3 2D27-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D27-FFF4 2D27-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-FFF6 2D27-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-FFFA 2D27-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-FFFE 2D27-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D28-102E 2D28-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-3002 2D28-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-3010 2D28-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-3020 2D28-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D28-3100 2D28-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D28-3109 2D28-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D28-3110 2D28-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D28-4010 2D28-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D28-4020 2D28-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D28-4030 2D28-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D28-4040 2D28-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D28-4041 2D28-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D28-4050 2D28-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D28-4060 2D28-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D28-4100 2D28-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D28-4101 2D28-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D28-4110 2D28-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D28-4150 2D28-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
 - FFC_221
-

2D28-4160 2D28-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
 - FFC_221
-

2D28-7001 2D28-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2D28-8008 2D28-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D28-8009 2D28-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D28-8150 2D28-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
-

2D28-8157 2D28-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
-

2D28-9000 2D28-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D28-9001 2D28-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D28-9002 2D28-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D28-9008 2D28-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D28-9010 2D28-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D28-9011 2D28-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D28-9020 2D28-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D28-9021 2D28-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D28-9022 2D28-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D28-9023 2D28-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D28-9024 2D28-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D28-9025 2D28-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D28-9026 **2D28-9026**

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D28-9027 **2D28-9027**

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D28-9028 **2D28-9028**

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D28-9029 **2D28-9029**

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D28-9030 **2D28-9030**

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D28-9031 **2D28-9031**

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D28-9032 **2D28-9032**

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D28-9041 **2D28-9041**

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D28-9042 **2D28-9042**

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D28-9050 **2D28-9050**

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D28-9051 **2D28-9051**

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D28-9052 **2D28-9052**

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D28-9054 **2D28-9054**

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D28-9060 **2D28-9060**

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D28-9061 **2D28-9061**

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D28-9062 **2D28-9062**

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D28-9063 **2D28-9063**

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D28-9073 **2D28-9073**

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D28-9074 2D28-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D28-9075 2D28-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D28-9076 2D28-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D28-9081 2D28-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D28-9082 2D28-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D28-9090 2D28-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D28-9091 2D28-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D28-9092 2D28-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D28-FF3D 2D28-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D28
-

2D28-FFF3 2D28-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D28-FFF4 2D28-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-FFF6 2D28-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-FFFA 2D28-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-FFFE 2D28-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2D40-102E 2D40-102E

Explanation: Out of alternate disk storage for storage.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D40-3002 2D40-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D40-3010 2D40-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D40-3020 2D40-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D40-3100 2D40-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D40-3109 2D40-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D40-3110 2D40-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D40-4010 2D40-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D40-4020 2D40-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D40-4030 2D40-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2D40-4040 2D40-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2D40-4041 2D40-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D40-4050 2D40-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D40-4060 2D40-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D40-4100 2D40-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2D40-4101 2D40-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2D40-4110 2D40-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2D40-4150 2D40-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D40
 - FFC_221
-

2D40-4160 2D40-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D40
 - FFC_221
-

2D40-7001 2D40-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2D40-8150 2D40-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D40

2D40-8157 2D40-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D40

2D40-9000 2D40-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D40-9001 2D40-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D40-9002 2D40-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D40-9008 2D40-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D40-9010 2D40-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D40-9011 2D40-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D40-9020 2D40-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D40-9021 2D40-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D40-9022 2D40-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D40-9023 2D40-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D40-9024 2D40-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D40-9025 2D40-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D40-9026 2D40-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D40-9027 2D40-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D40-9028 2D40-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D40-9029 2D40-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D40-9030 2D40-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D40-9031 2D40-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D40-9032 2D40-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D40-9041 2D40-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D40-9042 2D40-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D40-9050 2D40-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D40-9051 2D40-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D40-9052 2D40-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D40-9054 2D40-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D40-9060 2D40-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D40-9061 2D40-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D40-9062 2D40-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D40-9063 2D40-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D40-9073 2D40-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D40-9074 2D40-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D40-9075 2D40-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2D40-9076 • 303FF

2D40-9076 2D40-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2D40-9081 2D40-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D40-9082 2D40-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D40-9090 2D40-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D40-9091 2D40-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D40-9092 2D40-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2D40-FF3D 2D40-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210.

Failing Item:

- FFC_2D40
-

2D40-FFF3 2D40-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2D40-FFF4 2D40-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D40-FFF6 2D40-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D40-FFFA 2D40-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D40-FFFE 2D40-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

300C0 300C0

Explanation: A disk drive module detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

301C0 301C0

Explanation: Multiple disk drive modules detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

303FE 303FE

Explanation: A disk drive Microcode Error was detected.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

303FF 303FF

Explanation: An SCSI status that is not valid was received.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

31000 31000

Explanation: The disk drive was reset by the adapter. The disk drive might be going to fail.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

33PAA 33PAA

Explanation: Excessive link reconfigurations were detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

3000-1002 3000-1002

Explanation: There is not enough available spare space to re-establish full redundancy in a declustered array.

Response: Use MAP5001

40000 40000

Explanation: The SSA adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40004 40004

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40008 40008

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40016 40016

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40032 40032

Explanation: A module on the adapter failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40064 40064

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40128 40128

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41004 41004

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41008 41008

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41016 41016

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41032 41032

Explanation: A module on the adapter failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41064 41064

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41128 41128

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42000 42000

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42200 **42200**

Explanation: Other adapters on the SSA loop are using levels of microcode that are not compatible.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42500 **42500**

Explanation: An SSA adapter detected a failure in its fast-write cache.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42510 **42510**

Explanation: Not enough DRAM available to run an SSA fast-write cache.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42515 **42515**

Explanation: An SSA adapter is attempting to use its fast-write cache, but a fast-write cache card is not installed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42520 **42520**

Explanation: An SSA fast-write cache failure was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42521 **42521**

Explanation: An SSA fast-write cache option card failure was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42522 **42522**

Explanation: An SSA fast-write cache option card failure was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42523 **42523**

Explanation: An incorrect version number was detected in the fast-write cache option card.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42524 **42524**

Explanation: A fast-write disk drive (or drives) contains unsynchronized data, but the fast-write cache option card cannot be detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42525 **42525**

Explanation: A fast-write problem occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42526 **42526**

Explanation: This adapter does not support the SSA Fast-Write Cache Option.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42527 **42527**

Explanation: A dormant SSA fast-write cache entry exists.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42528 **42528**

Explanation: A fast-write SSA disk drive has been detected that was previously unsynchronized, but has since been configured on a different adapter.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42529 **42529**

Explanation: The fast-write cache is disabled. The battery is charging.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4252A **4252A**

Explanation: The supply voltage to the fast-write cache option card is low. The card has switched to Self-Refresh mode.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4252B **4252B**

Explanation: The battery to the fast-write cache option card no longer has the power to maintain data.

Response: Refer to the SRN table in the User's Guide

and Maintenance Information for the SSA adapter.

4252C 4252C

Explanation: The battery to the fast-write cache option card needs to be exchanged for a new one.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42540 42540

Explanation: Two-way fast-write cache is configured to operate only when both caches are available. One cache, however, is not available.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

43PAA 43PAA

Explanation: An SSA device on the loop is preventing the completion of the loop configuration.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive or to the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

44PAA 44PAA

Explanation: A disk drive module has a Failed status.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive or to the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

45PAA 45PAA

Explanation: The SSA adapter has detected an open SSA loop.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive or to the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

46000 46000

Explanation: A RAID array is in the Off-Line state because more than one disk drive is not available.

Response: Refer to the SRN table in the User's Guide

and Maintenance Information for the SSA adapter.

46500 46500

Explanation: A member disk drive is missing from a SSA array or the original SSA adapter is not available.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

47000 47000

Explanation: An attempt was made to store in the SSA adapter the details of more than 32 RAID arrays.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

47500 47500

Explanation: Part of the RAID array data might have been lost.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48000 48000

Explanation: The SSA adapter detected a link configuration that is not valid.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48500 48500

Explanation: The array filter detected a link configuration that is not valid.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48600 48600

Explanation: One member disk drive of an array is not on the SSA loop that contains the other member disk drives of the array.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48700 48700

Explanation: Two or more member disk drives of an SSA array are on different loops.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48750 48750

Explanation: An array is in the Off-Line state because the primary or secondary half of the array is not present.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48755 48755

Explanation: The SSA adapter is unknown to the array.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48760 48760

Explanation: An array is in the Off-Line state because the split/join procedure was not performed correctly.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48800 48800

Explanation: The Invalid-Strip table is full.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48900 48900

Explanation: An SSA array is not available; a multiple-device error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48950 48950

Explanation: A disk drive caused an Array-Build operation to fail.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49000 49000

Explanation: A RAID array is in the Degraded state.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49100 49100

Explanation: A RAID array is in the Exposed state.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49500 49500

Explanation: No hot-spare disk drives are available for an array that is configured for hot-spare disk drives.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49510 49510

Explanation: Hot-spare configuration is not synchronized.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49520 49520

Explanation: Hot-spare tuning has been lost.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49530 49530

Explanation: The number of disk drives that remain in a hot-spare pool is less than the specified number.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49540 49540

Explanation: Adapters that do not support hot-spare pools were detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49700 49700

Explanation: The parity for the RAID array is not complete.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49800 49800

Explanation: A different adapter was detected on each loop.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4A100 4A100

Explanation: The adapter cannot initialize an SSA disk drive.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4BPAA 4BPAA

Explanation: An SSA disk drive at PAA cannot be configured, because its UID cannot be read.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

50000 50000

Explanation: The SSA adapter failed to respond to the device driver.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50001 50001

Explanation: A Data Parity error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50002 50002

Explanation: An SSA adapter DMA error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50004 50004

Explanation: A Channel Check occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50005 50005

Explanation: A software error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50006 50006

Explanation: A Channel Check occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50007 50007

Explanation: The IOCC detected an internal error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50008 50008

Explanation: Unable to read or write the POS registers or PCI configuration space.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50010 50010

Explanation: An SSA adapter or device-driver protocol error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50012 50012

Explanation: The SSA adapter microcode hung.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50013 50013

Explanation: The SSA adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50100 50100

Explanation: An attempt was made to log an error against a pdisk that is not available to the using system.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50200 50200

Explanation: Duplicate SSA cluster number detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50411 50411

Explanation: SSA adapter detected a SS_SIC_CLASS1 error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50422 50422

Explanation: SSA adapter detected a SS_TIMEOUT error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

 50425 50425

Explanation: SSA adapter detected a SS_LINK_CONFIG_FAILED error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

504XX 504XX

Explanation: The SSA adapter microcode hung.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

440-102 440-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_440
-

440-104 440-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_440
-

440-105 440-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_440
-

440-106 440-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_440
-

440-108 440-108

Explanation: The bus test failed.

Failing Item:

- FFC_440
-

440-110 440-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_440
-

 440-112 440-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_440
-

440-114 440-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_440
-

440-116 440-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_440
-

440-117 440-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_440
-

440-118 440-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_440
 - FFC_B88
-

440-120 440-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_440
-

440-122 440-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_440
-

440-124 440-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_440
-

440-126 **440-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_440
 - FFC_B88
-

440-128 **440-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_440
 - SOFTWARE
-

440-129 **440-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_440
 - SOFTWARE
-

440-130 **440-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_440
-

440-132 **440-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_440
-

440-133 **440-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_440
-

440-134 **440-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

440-135 **440-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_440
 - FFC_B88
 - SOFTWARE
-

440-136 **440-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_440
-

440-137 **440-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_440
 - FFC_B88
 - FFC_190
-

440-138 **440-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_440
-

440-140 **440-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_440
-

440-640 **440-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

441-102 • 441-128

441-102 441-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_441
-

441-104 441-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_441
-

441-105 441-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_441
-

441-106 441-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_441
-

441-108 441-108

Explanation: The bus test failed.

Failing Item:

- FFC_441
-

441-110 441-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_441
-

441-112 441-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_441
-

441-114 441-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_441
-

441-116 441-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_441
-

441-117 441-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_441
-

441-118 441-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_441
 - FFC_B88
-

441-120 441-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_441
-

441-122 441-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_441
-

441-124 441-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_441
-

441-126 441-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_441
 - FFC_B88
-

441-128 441-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_441
- SOFTWARE

441-129 **441-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_441
 - SOFTWARE
-

441-130 **441-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_441
-

441-132 **441-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_441
-

441-133 **441-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_441
-

441-134 **441-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

441-135 **441-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_441
 - FFC_B88
 - SOFTWARE
-

441-136 **441-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_441
-

441-137 **441-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_441
 - FFC_B88
 - FFC_190
-

441-138 **441-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_441
-

441-140 **441-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_441
-

441-640 **441-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

442-102 **442-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_442
-

442-104 **442-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_442
-

442-105 **442-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_442
-

442-106 **442-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_442
-

442-108 **442-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_442
-

442-110 **442-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_442
-

442-112 **442-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_442
-

442-114 **442-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_442
-

442-116 **442-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.**Failing Item:**

- FFC_442
-

442-117 **442-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_442
-

442-118 **442-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_442
 - FFC_B88
-

442-120 **442-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_442
-

442-122 **442-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_442
-

442-124 **442-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_442
-

442-126 **442-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_442
 - FFC_B88
-

442-128 **442-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_442
 - SOFTWARE
-

442-129 **442-129****Explanation:** Error log analysis indicates a SCSI bus problem.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_442
 - SOFTWARE
-

442-130 **442-130****Explanation:** Error log analysis indicates a problem reported by the disk drive's self-monitoring function.**Failing Item:**

- FFC_442
-

442-132 442-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_442
-

442-133 442-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_442
-

442-134 442-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

442-135 442-135

Explanation: The device failed to configure.

Failing Item:

- FFC_442
 - FFC_B88
 - SOFTWARE
-

442-136 442-136

Explanation: The certify operation failed.

Failing Item:

- FFC_442
-

442-137 442-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_442
 - FFC_B88
 - FFC_190
-

442-138 442-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_442
-

442-140 442-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_442
-

442-640 442-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

443-102 443-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_443
-

443-104 443-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_443
-

443-105 443-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_443
-

443-106 443-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_443
-

443-108 443-108

Explanation: The bus test failed.

Failing Item:

- FFC_443
-

443-110 443-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_443

443-112 **443-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_443
-

443-114 **443-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_443
-

443-116 **443-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.**Failing Item:**

- FFC_443
-

443-117 **443-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_443
-

443-118 **443-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_443
 - FFC_B88
-

443-120 **443-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_443
-

443-122 **443-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_443
-

443-124 **443-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_443
-

443-126 **443-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_443
 - FFC_B88
-

443-128 **443-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_443
 - SOFTWARE
-

443-129 **443-129****Explanation:** Error log analysis indicates a SCSI bus problem.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_443
 - SOFTWARE
-

443-130 **443-130****Explanation:** Error log analysis indicates a problem reported by the disk drive's self-monitoring function.**Failing Item:**

- FFC_443
-

443-132 **443-132****Explanation:** A disk drive hardware error occurred.**Failing Item:**

- FFC_443
-

443-133 **443-133****Explanation:** Use the Subsystem Service Guide to complete diagnosis.**Failing Item:**

- FFC_443
-

443-134 **443-134****Explanation:** The adapter failed to configure.**Failing Item:**

- FFC_B88
-

- SOFTWARE

443-135 443-135

Explanation: The device failed to configure.

Failing Item:

- FFC_443
 - FFC_B88
 - SOFTWARE
-

443-136 443-136

Explanation: The certify operation failed.

Failing Item:

- FFC_443
-

443-137 443-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_443
 - FFC_B88
 - FFC_190
-

443-138 443-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_443
-

443-140 443-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_443
-

443-640 443-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

444-101 444-101

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
 - FFC_444
-

444-102 444-102

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
 - FFC_444
-

444-103 444-103

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_227
-

444-104 444-104

Explanation: Enhanced error handling failure on Eads chip.

Failing Item:

- FFC_227
-

444-105 444-105

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_444
-

444-106 444-106

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_776
 - FFC_646
-

444-107 444-107

Explanation: EEH failure on Eads chip.

Failing Item:

- FFC_776
 - FFC_646
-

444-108 444-108

Explanation: Enhanced error handling failure on adapter.

Failing Item:

444-201 • 444-305

- FFC_776
- FFC_646

444-201 444-201

Explanation: Internal adapter test failed.

Failing Item:

- FFC_444
- FFC_227

444-202 444-202

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_444
- FFC_227

444-203 444-203

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_444
- FFC_227

444-204 444-204

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_444

444-205 444-205

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_444

444-206 444-206

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_444
- SOFTWARE

444-207 444-207

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_444

- SOFTWARE

444-208 444-208

Explanation: Enhanced error handling failure opening the adapter.

Failing Item:

- FFC_444
- FFC_227

444-301 444-301

Explanation: Internal adapter test failed.

Failing Item:

- FFC_444
- FFC_227
- SOFTWARE

444-302 444-302

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_444
- FFC_227
- SOFTWARE

444-303 444-303

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_444
- FFC_227
- SOFTWARE

444-304 444-304

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_444
- SOFTWARE

444-305 444-305

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_444
- SOFTWARE

444-700 **444-700**

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_444
 - SOFTWARE
-

444-701 **444-701**

Explanation: Error log analysis indicates that this adapter has failed to initialize due to enhanced error handling errors.

Failing Item:

- FFC_444
 - FFC_227
-

446-102 **446-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_446
-

446-104 **446-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_446
-

446-105 **446-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_446
-

446-106 **446-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_446
-

446-108 **446-108**

Explanation: The bus test failed.

Failing Item:

- FFC_446
-

446-110 **446-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_446

446-112 **446-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_446
-

446-114 **446-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_446
-

446-116 **446-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_446
-

446-117 **446-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_446
-

446-118 **446-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_446
 - FFC_B88
-

446-120 **446-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_446
-

446-122 **446-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_446
-

446-124 **446-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_446

446-126 **446-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_446
 - FFC_B88
-

446-128 **446-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_446
 - SOFTWARE
-

446-129 **446-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_446
 - SOFTWARE
-

446-130 **446-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_446
-

446-132 **446-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_446
-

446-133 **446-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_446
-

446-134 **446-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

446-135 **446-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_446
 - FFC_B88
 - SOFTWARE
-

446-136 **446-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_446
-

446-137 **446-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_446
 - FFC_B88
 - FFC_190
-

446-138 **446-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_446
-

446-140 **446-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_446
-

446-640 **446-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

447-101 447-101

Explanation: The Fibre Channel Adapter configuration failed.

Failing Item:

- FFC_447
-

447-102 447-102

Explanation: The Reset test failed.

Failing Item:

- FFC_447
-

447-103 447-103

Explanation: The Register test failed.

Failing Item:

- FFC_447
-

447-104 447-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_447
-

447-105 447-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_447
-

447-106 447-106

Explanation: Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_447
-

447-107 447-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_447
-

447-109 447-109

Explanation: Enhanced Error Handling Failure on EADs chip.

Failing Item:

- FFC_221
-

447-110 447-110

Explanation: Enhanced Error Handling Failure on adapter.

Failing Item:

- FFC_447
-

447-201 447-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-202 447-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-203 447-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-204 447-204

Explanation: The DMA test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-205 447-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_447
 - FFC_221
-

447-701 447-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_447
 - FFC_221
-

 447-703 447-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_447
-

447-704 447-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_447
-

447-705 447-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_447
-

447-706 447-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_447
-

451-102 451-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_451
-

451-104 451-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_451
-

451-105 451-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_451
-

 451-106 451-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_451
-

451-108 451-108

Explanation: The bus test failed.

Failing Item:

- FFC_451
-

451-110 451-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_451
-

451-112 451-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_451
-

451-114 451-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_451
-

451-116 451-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_451
-

451-117 451-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_451
-

451-118 451-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_451
- FFC_B88

451-120 451-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_451
-

451-122 451-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_451
-

451-124 451-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_451
-

451-126 451-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_451
 - FFC_B88
-

451-128 451-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_451
 - SOFTWARE
-

451-129 451-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_451
 - SOFTWARE
-

451-130 451-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_451

451-132 451-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_451
-

451-133 451-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_451
-

451-134 451-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

451-135 451-135

Explanation: The device failed to configure.

Failing Item:

- FFC_451
 - FFC_B88
 - SOFTWARE
-

451-136 451-136

Explanation: The certify operation failed.

Failing Item:

- FFC_451
-

451-137 451-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_451
 - FFC_B88
 - FFC_190
-

451-138 451-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

451-140 • 453-124

- FFC_451

451-140 451-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_451

451-640 451-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

453-102 453-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_453

453-104 453-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_453

453-105 453-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_453

453-106 453-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_453

453-108 453-108

Explanation: The bus test failed.

Failing Item:

- FFC_453

453-110 453-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_453

453-112 453-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_453

453-114 453-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_453

453-116 453-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_453

453-117 453-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_453

453-118 453-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_453
- FFC_B88

453-120 453-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_453

453-122 453-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_453

453-124 453-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_453

453-126 453-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_453
 - FFC_B88
-

453-128 453-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_453
 - SOFTWARE
-

453-129 453-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_453
 - SOFTWARE
-

453-130 453-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_453
-

453-132 453-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_453
-

453-133 453-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_453
-

453-134 453-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE
-

453-135 453-135

Explanation: The device failed to configure.

Failing Item:

- FFC_453
 - FFC_B88
 - SOFTWARE
-

453-136 453-136

Explanation: The certify operation failed.

Failing Item:

- FFC_453
-

453-137 453-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_453
 - FFC_B88
 - FFC_190
-

453-138 453-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_453
-

453-140 453-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_453
-

453-640 453-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

458-110 458-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_458
-

458-120 458-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_458
-

458-130 458-130

Explanation: The Load command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-135 458-135

Explanation: The Unload command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-140 458-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_458
-

458-150 458-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-160 458-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-169 458-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-170 458-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_458
 - FFC_B88
 - MEDIA
-

458-180 458-180

Explanation: The Load command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-185 458-185

Explanation: The Unload command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-190 458-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_458
-

458-200 458-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-210 458-210

Explanation: The device configuration failed.

Failing Item:

- FFC_458
 - FFC_B88
-

458-220 458-220

Explanation: The Release command failed.

Failing Item:

- FFC_458
-

458-230 458-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_458
-

458-240 458-240

Explanation: The Openx command failed.

Failing Item:

- FFC_458
-

458-300 458-300

Explanation: The device configuration failed.

Failing Item:

- FFC_458
 - SOFTWARE
-

458-310 458-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_458
 - SOFTWARE
-

458-320 458-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_458
 - MEDIA
-

458-411 458-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-412 458-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-413 458-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-414 458-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-415 458-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-416 458-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-417 458-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-418 458-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-419 **458-419****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-420 **458-420****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-421 **458-421****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-422 **458-422****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-423 **458-423****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-511 **458-511****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
 - FFC_B88
-

458-512 **458-512****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
 - FFC_B88
-

458-513 **458-513****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
 - FFC_B88
-

458-514 **458-514****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
 - FFC_B88
-

458-515 **458-515****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
 - FFC_B88
-

458-516 **458-516****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
 - FFC_B88
-

458-517 **458-517****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
 - FFC_B88
-

458-518 **458-518****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_458
- FFC_B88

458-519 458-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
- FFC_B88

458-520 458-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
- FFC_B88

458-521 458-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
- FFC_B88

458-522 458-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
- FFC_B88

458-523 458-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
- FFC_B88

458-611 458-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-612 458-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-613 458-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-614 458-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-615 458-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-616 458-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-617 458-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-618 **458-618****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-619 **458-619****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-620 **458-620****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-621 **458-621****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-622 **458-622****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-623 **458-623****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-711 **458-711****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-712 **458-712****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-713 **458-713****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-714 **458-714****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-715 **458-715****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-716 **458-716****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-717 **458-717****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-718 **458-718****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-719 **458-719****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-720 **458-720****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-721 **458-721****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-722 **458-722****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-723 **458-723****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_458
 - FFC_B88
 - SOFTWARE
-

459-110 **459-110****Explanation:** The Reserve command failed.**Failing Item:**

- FFC_459
-

459-120 **459-120****Explanation:** The Inquiry command failed.**Failing Item:**

- FFC_459
-

459-130 **459-130****Explanation:** The Load command failed.**Failing Item:**

- FFC_459
 - MEDIA
-

459-135 **459-135****Explanation:** The Unload command failed.**Failing Item:**

- FFC_459
 - MEDIA
-

459-140 **459-140****Explanation:** The Mode Select command failed.**Failing Item:**

- FFC_459
-

459-150 **459-150****Explanation:** The Test Unit Ready command failed.**Failing Item:**

- FFC_459
 - MEDIA
-

459-160 **459-160****Explanation:** The Send Diagnostic command failed.**Failing Item:**

- FFC_459
-

459-169 • 459-411

- MEDIA

459-169 459-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_459
- MEDIA

459-170 459-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_459
- FFC_B88
- MEDIA

459-180 459-180

Explanation: The Load command failed.

Failing Item:

- FFC_459
- MEDIA

459-185 459-185

Explanation: The Unload command failed.

Failing Item:

- FFC_459
- MEDIA

459-190 459-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_459

459-200 459-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_459
- MEDIA

459-210 459-210

Explanation: The device configuration failed.

Failing Item:

- FFC_459
- FFC_B88

459-220 459-220

Explanation: The Release command failed.

Failing Item:

- FFC_459

459-230 459-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_459

459-240 459-240

Explanation: The Openx command failed.

Failing Item:

- FFC_459

459-300 459-300

Explanation: The device configuration failed.

Failing Item:

- FFC_459
- SOFTWARE

459-310 459-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_459
- SOFTWARE

459-320 459-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_459
- MEDIA

459-411 459-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-412 **459-412**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-413 **459-413**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-414 **459-414**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-415 **459-415**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-416 **459-416**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-417 **459-417**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-418 **459-418**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-419 **459-419**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-41A **459-41A**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-41B **459-41B**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-41C **459-41C**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-41D **459-41D**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-41E 459-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-41F 459-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-420 459-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-421 459-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-422 459-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-423 459-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-511 459-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-512 459-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-513 459-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-514 459-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-515 459-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-516 459-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-517 459-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-518 **459-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-519 **459-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-520 **459-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-521 **459-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-522 **459-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-523 **459-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
- FFC_B88

459-611 **459-611**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-612 **459-612**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-613 **459-613**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-614 **459-614**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-615 **459-615**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-616 **459-616**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-617 **459-617****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-618 **459-618****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-619 **459-619****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-620 **459-620****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-621 **459-621****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-622 **459-622****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-623 **459-623****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-711 **459-711****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-712 **459-712****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-713 **459-713****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-714 **459-714****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-715 **459-715****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-716 **459-716****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-717 **459-717****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-718 **459-718****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-719 **459-719****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-720 **459-720****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-721 **459-721****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-722 **459-722****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-723 **459-723****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_459
 - FFC_B88
 - SOFTWARE
-

541-XXX **541-XXX****Explanation:** A DLT tape device problem has occurred.**Response:** Refer to the DLT tape device documentation.**Failing Item:**

- FFC_541
-

542-XXX **542-XXX****Explanation:** An 8mm 60GB tape device problem has occurred.**Response:** Refer to the 8mm 60GB tape device documentation.**Failing Item:**

- FFC_542
-

56B-102 **56B-102****Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_56B
-

56B-104 **56B-104****Explanation:** The motor failed to restart.**Failing Item:**

- FFC_56B
-

56B-105 **56B-105****Explanation:** The drive did not become ready.**Failing Item:**

- FFC_56B
-

56B-106 • 56B-130

56B-106 56B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_56B
-

56B-108 56B-108

Explanation: The bus test failed.

Failing Item:

- FFC_56B
-

56B-110 56B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_56B
-

56B-112 56B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_56B
-

56B-114 56B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_56B
-

56B-116 56B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_56B
-

56B-117 56B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_56B
-

56B-118 56B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_56B
 - FFC_B88
-

56B-120 56B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_56B
-

56B-122 56B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_56B
-

56B-124 56B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_56B
-

56B-126 56B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_56B
 - FFC_B88
-

56B-128 56B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56B
 - SOFTWARE
-

56B-129 56B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56B
 - SOFTWARE
-

56B-130 56B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_56B
-

56B-132 **56B-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_56B
-

56B-133 **56B-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_56B
-

56B-134 **56B-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

56B-135 **56B-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_56B
 - FFC_B88
 - SOFTWARE
-

56B-136 **56B-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_56B
-

56B-137 **56B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_56B
 - FFC_B88
 - FFC_190
-

56B-138 **56B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_56B
-

56B-140 **56B-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_56B
-

56B-640 **56B-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

56D-102 **56D-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_56D
-

56D-104 **56D-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_56D
-

56D-105 **56D-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_56D
-

56D-106 **56D-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_440
-

56D-108 **56D-108**

Explanation: The bus test failed.

Failing Item:

- FFC_56D
-

56D-110 **56D-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_56D

56D-112 **56D-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_56D
-

56D-114 **56D-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_56D
-

56D-116 **56D-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_56D
-

56D-117 **56D-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_56D
-

56D-118 **56D-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_56D
 - FFC_B88
-

56D-120 **56D-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_56D
-

56D-122 **56D-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_56D
-

56D-124 **56D-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_56D
-

56D-126 **56D-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_56D
 - FFC_B88
-

56D-128 **56D-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56D
 - SOFTWARE
-

56D-129 **56D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56D
 - SOFTWARE
-

56D-130 **56D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_56D
-

56D-132 **56D-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_56D
-

56D-133 **56D-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_56D
-

56D-134 **56D-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

56D-135 **56D-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_56D
- FFC_B88
- SOFTWARE

56D-136 **56D-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_56D

56D-137 **56D-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_56D
- FFC_B88
- FFC_190

56D-138 **56D-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_56D

56D-140 **56D-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_56D

56D-640 **56D-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

57B-102 **57B-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_57B

57B-104 **57B-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_57B

57B-105 **57B-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_57B

57B-106 **57B-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_57B

57B-108 **57B-108**

Explanation: The bus test failed.

Failing Item:

- FFC_57B

57B-110 **57B-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_57B

57B-112 **57B-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_57B

57B-114 **57B-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_57B

57B-116 **57B-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

57B-117 • 57B-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_57B

57B-117 57B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_57B

57B-118 57B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_57B
- FFC_B88

57B-120 57B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_57B

57B-122 57B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_57B

57B-124 57B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_57B

57B-126 57B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_57B
- FFC_B88

57B-128 57B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_57B
- SOFTWARE

57B-129 57B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_57B
- SOFTWARE

57B-130 57B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_57B

57B-132 57B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_57B

57B-133 57B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_57B

57B-134 57B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

57B-135 57B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_57B
- FFC_B88
- SOFTWARE

57B-136 57B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_57B

57B-137 **57B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_57B
 - FFC_B88
 - FFC_190
-

57B-138 **57B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_57B
-

57B-140 **57B-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_57B
-

57B-640 **57B-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

57D-102 **57D-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_57D
-

57D-104 **57D-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_57D
-

57D-105 **57D-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_57D
-

57D-106 **57D-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_57D
-

57D-108 **57D-108**

Explanation: The bus test failed.

Failing Item:

- FFC_57D
-

57D-110 **57D-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_57D
-

57D-112 **57D-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_57D
-

57D-114 **57D-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_57D
-

57D-116 **57D-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_57D
-

57D-117 **57D-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_57D
-

57D-118 **57D-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_57D
 - FFC_B88
-

57D-120 57D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_57D
-

57D-122 57D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_57D
-

57D-124 57D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_57D
-

57D-126 57D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_57D
 - FFC_B88
-

57D-128 57D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_57D
 - SOFTWARE
-

57D-129 57D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_57D
 - SOFTWARE
-

57D-130 57D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_57D
-

57D-132 57D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_57D
-

57D-133 57D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_57D
-

57D-134 57D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

57D-135 57D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_57D
 - FFC_B88
 - SOFTWARE
-

57D-136 57D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_57D
-

57D-137 57D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_57D
 - FFC_B88
 - FFC_190
-

57D-138 57D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_57D

57D-140 57D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_57D

57D-640 57D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

58B-102 58B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_58B

58B-104 58B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_58B

58B-105 58B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_58B

58B-106 58B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_58B

58B-108 58B-108

Explanation: The bus test failed.

Failing Item:

- FFC_58B

58B-110 58B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_58B

58B-112 58B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_58B

58B-114 58B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_58B

58B-116 58B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_58B

58B-117 58B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_58B

58B-118 58B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_58B
- FFC_B88

58B-120 58B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_58B

58B-122 58B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_58B

58B-124 58B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_58B

58B-126 58B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_58B
- FFC_B88

58B-128 58B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_58B
- SOFTWARE

58B-129 58B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_58B
- SOFTWARE

58B-130 58B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_58B

58B-132 58B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_58B

58B-133 58B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_58B

58B-134 58B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

58B-135 58B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_58B
- FFC_B88
- SOFTWARE

58B-136 58B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_58B

58B-137 58B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_58B
- FFC_B88
- FFC_190

58B-138 58B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_58B

58B-140 58B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_58B

58B-640 58B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

58D-102 58D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_58D
-

58D-104 58D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_58D
-

58D-105 58D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_58D
-

58D-106 58D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_58D
-

58D-108 58D-108

Explanation: The bus test failed.

Failing Item:

- FFC_58D
-

58D-110 58D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_58D
-

58D-112 58D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_58D
-

58D-114 58D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_58D
-

58D-116 58D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_58D
-

58D-117 58D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_58D
-

58D-118 58D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_58D
 - FFC_B88
-

58D-120 58D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_58D
-

58D-122 58D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_58D
-

58D-124 58D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_58D
-

58D-126 58D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_58D
 - FFC_B88
-

58D-128 58D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_58D
- SOFTWARE

58D-129 **58D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_58D
 - SOFTWARE
-

58D-130 **58D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_58D
-

58D-132 **58D-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_58D
-

58D-133 **58D-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_58D
-

58D-134 **58D-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

58D-135 **58D-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_58D
 - FFC_B88
 - SOFTWARE
-

58D-136 **58D-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_58D
-

58D-137 **58D-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_58D
 - FFC_B88
 - FFC_190
-

58D-138 **58D-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_58D
-

58D-140 **58D-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_58D
-

58D-640 **58D-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

59B-102 **59B-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_59B
-

59B-104 **59B-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_59B
-

59B-105 **59B-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_59B
-

59B-106 **59B-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_59B
-

59B-108 **59B-108**

Explanation: The bus test failed.

Failing Item:

- FFC_59B
-

59B-110 **59B-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_59B
-

59B-112 **59B-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_59B
-

59B-114 **59B-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_59B
-

59B-116 **59B-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_59B
-

59B-117 **59B-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_59B
-

59B-118 **59B-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_59B
 - FFC_B88
-

59B-120 **59B-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_59B
-

59B-122 **59B-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_59B
-

59B-124 **59B-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_59B
-

59B-126 **59B-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_59B
 - FFC_B88
-

59B-128 **59B-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_59B
 - SOFTWARE
-

59B-129 **59B-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_59B
 - SOFTWARE
-

59B-130 **59B-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_59B
-

59B-132 59B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_59B

59B-133 59B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_59B

59B-134 59B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

59B-135 59B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_59B
- FFC_B88
- SOFTWARE

59B-136 59B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_59B

59B-137 59B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_59B
- FFC_B88
- FFC_190

59B-138 59B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_59B

59B-140 59B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_59B

59B-640 59B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

59D-102 59D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_59D

59D-104 59D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_59D

59D-105 59D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_59D

59D-106 59D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_59D

59D-108 59D-108

Explanation: The bus test failed.

Failing Item:

- FFC_59D

59D-110 59D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_59D

59D-112 **59D-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_59D
-

59D-114 **59D-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_59D
-

59D-116 **59D-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_59D
-

59D-117 **59D-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_59D
-

59D-118 **59D-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_59D
 - FFC_B88
-

59D-120 **59D-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_59D
-

59D-122 **59D-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_59D
-

59D-124 **59D-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_59D
-

59D-126 **59D-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_59D
 - FFC_B88
-

59D-128 **59D-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_59D
 - SOFTWARE
-

59D-129 **59D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_59D
 - SOFTWARE
-

59D-130 **59D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_59D
-

59D-132 **59D-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_59D
-

59D-133 **59D-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_59D
-

59D-134 **59D-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

59D-135 • 60230

- SOFTWARE

59D-135 59D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_59D
- FFC_B88
- SOFTWARE

59D-136 59D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_59D

59D-137 59D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_59D
- FFC_B88
- FFC_190

59D-138 59D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_59D

59D-140 59D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_59D

59D-640 59D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

60000 60000

Explanation: The SSA adapter is missing from the expected configuration.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

60200 60200

Explanation: The SSA unit cannot be turned on.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60210 60210

Explanation: A disk drive module has its Check light On.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60220 60220

Explanation: A fan-and-power-supply assembly has its Check light On.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60230 60230

Explanation: The SSA unit has an unexpected Check light On.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60240 60240

Explanation: An SSA configuration problem occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

7XXXX 7XXXX

Explanation: An SSA disk drive is missing from the expected configuration of the SSA loop.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and to the User's Guide and Maintenance Information for the SSA adapter. Note: In this SRN, an x represents a digit 0 through F.

601-102 601-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_601

601-104 601-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_601

601-105 601-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_601

601-106 601-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_601

601-108 601-108

Explanation: The bus test failed.

Failing Item:

- FFC_601

601-110 601-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_601

601-112 601-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_601

601-114 601-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_601

601-116 601-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_601

601-117 601-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_601

601-118 601-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_601
- FFC_B88

601-120 601-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_601

601-122 601-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_601

601-124 • 601-140

601-124 601-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_601
-

601-126 601-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_601
 - FFC_B88
-

601-128 601-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_601
 - SOFTWARE
-

601-129 601-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_601
 - SOFTWARE
-

601-130 601-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_601
-

601-132 601-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_601
-

601-133 601-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_601
-

601-134 601-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

601-135 601-135

Explanation: The device failed to configure.

Failing Item:

- FFC_601
 - FFC_B88
 - SOFTWARE
-

601-136 601-136

Explanation: The certify operation failed.

Failing Item:

- FFC_601
-

601-137 601-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_601
 - FFC_B88
 - FFC_190
-

601-138 601-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_601
-

601-140 601-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_601
-

601-640 **601-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

60B-102 **60B-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_60B
-

60B-104 **60B-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_60B
-

60B-105 **60B-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_60B
-

60B-106 **60B-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_60B
-

60B-108 **60B-108**

Explanation: The bus test failed.

Failing Item:

- FFC_60B
-

60B-110 **60B-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_60B
-

60B-112 **60B-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_60B
-

60B-114 **60B-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_60B
-

60B-116 **60B-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_60B
-

60B-117 **60B-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_60B
-

60B-118 **60B-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_60B
 - FFC_B88
-

60B-120 **60B-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_60B
-

60B-122 **60B-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_60B
-

60B-124 **60B-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_60B
-

60B-126 **60B-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_60B
 - FFC_B88
-

60B-128 **60B-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_60B
 - SOFTWARE
-

60B-129 **60B-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_60B
 - SOFTWARE
-

60B-130 **60B-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_60B
-

60B-132 **60B-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_60B
-

60B-133 **60B-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_60B
-

60B-134 **60B-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

60B-135 **60B-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_60B
 - FFC_B88
-

- SOFTWARE
-

60B-136 **60B-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_60B
-

60B-137 **60B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_60B
 - FFC_B88
 - FFC_190
-

60B-138 **60B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_60B
-

60B-140 **60B-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_60B
-

60B-640 **60B-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

613-XXX **613-XXX**

Explanation: An 8-mm 80-GB VXA-2 tape device problem has occurred.

Failing Item:

- FFC_613
-

61B-102 **61B-102****Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_61B
-

61B-104 **61B-104****Explanation:** The motor failed to restart.**Failing Item:**

- FFC_61B
-

61B-105 **61B-105****Explanation:** The drive did not become ready.**Failing Item:**

- FFC_61B
-

61B-106 **61B-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_61B
-

61B-108 **61B-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_61B
-

61B-110 **61B-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_61B
-

61B-112 **61B-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_61B
-

61B-114 **61B-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_61B
-

61B-116 **61B-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_61B
-

61B-117 **61B-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_61B
-

61B-118 **61B-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_61B
 - FFC_B88
-

61B-120 **61B-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_61B
-

61B-122 **61B-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_61B
-

61B-124 **61B-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_61B
-

61B-126 **61B-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_61B
 - FFC_B88
-

61B-128 **61B-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
- FFC_B88
- FFC_61B
- SOFTWARE

61B-129 **61B-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61B
 - SOFTWARE
-

61B-130 **61B-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_61B
-

61B-132 **61B-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_61B
-

61B-133 **61B-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_61B
-

61B-134 **61B-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

61B-135 **61B-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_61B
 - FFC_B88
 - SOFTWARE
-

61B-136 **61B-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_61B
-

61B-137 **61B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_61B
 - FFC_B88
 - FFC_190
-

61B-138 **61B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_61B
-

61B-140 **61B-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_61B
-

61B-640 **61B-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

61D-102 **61D-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_61D
-

61D-104 **61D-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_61D
-

61D-105 **61D-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_61D
-

61D-106 **61D-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_61D
-

61D-108 **61D-108**

Explanation: The bus test failed.

Failing Item:

- FFC_61D
-

61D-110 **61D-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_61D
-

61D-112 **61D-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_61D
-

61D-114 **61D-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_61D
-

61D-116 **61D-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_61D
-

61D-117 **61D-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_61D
-

61D-118 **61D-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_61D
 - FFC_B88
-

61D-120 **61D-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_61D
-

61D-122 **61D-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_61D
-

61D-124 **61D-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_61D
-

61D-126 **61D-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_61D
 - FFC_B88
-

61D-128 **61D-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61D
 - SOFTWARE
-

61D-129 **61D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61D
 - SOFTWARE
-

61D-130 **61D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_61D
-

61D-132 61D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_61D
-

61D-133 61D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_61D
-

61D-134 61D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

61D-135 61D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_61D
 - FFC_B88
 - SOFTWARE
-

61D-136 61D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_61D
-

61D-137 61D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_61D
 - FFC_B88
 - FFC_190
-

61D-138 61D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_61D
-

61D-140 61D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_61D
-

61D-640 61D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

61E-102 61E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_61E
-

61E-104 61E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_61E
-

61E-105 61E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_61E
-

61E-106 61E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_61E
-

61E-108 61E-108

Explanation: The bus test failed.

Failing Item:

- FFC_61E
-

61E-110 61E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_61E

61E-112 **61E-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_61E
-

61E-114 **61E-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_61E
-

61E-116 **61E-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_61E
-

61E-117 **61E-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_61E
-

61E-118 **61E-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_61E
 - FFC_B88
-

61E-120 **61E-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_61E
-

61E-122 **61E-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_61E
-

61E-124 **61E-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_61E
-

61E-126 **61E-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_61E
 - FFC_B88
-

61E-128 **61E-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61E
 - SOFTWARE
-

61E-129 **61E-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61E
 - SOFTWARE
-

61E-130 **61E-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_61E
-

61E-132 **61E-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_61E
-

61E-133 **61E-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_61E
-

61E-134 **61E-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

61E-135 • 621-116

- SOFTWARE

61E-135 61E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_61E
- FFC_B88
- SOFTWARE

61E-136 61E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_61E

61E-137 61E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_61E
- FFC_B88
- FFC_190

61E-138 61E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_61E

61E-140 61E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_61E

61E-640 61E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

621-102 621-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_621

621-104 621-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_621

621-105 621-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_621

621-106 621-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_621

621-108 621-108

Explanation: The bus test failed.

Failing Item:

- FFC_621

621-110 621-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_621

621-112 621-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_621

621-114 621-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_621

621-116 621-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_621

621-117 621-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_621

621-118 621-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_621
- FFC_B88

621-120 621-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_621

621-122 621-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_621

621-124 621-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_621

621-126 621-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_621
- FFC_B88

621-128 621-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_621
- SOFTWARE

621-129 621-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_621
- SOFTWARE

621-130 621-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_621

621-132 621-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_621

621-133 621-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_621

621-134 621-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

621-135 621-135

Explanation: The device failed to configure.

Failing Item:

- FFC_621
- FFC_B88
- SOFTWARE

621-136 621-136

Explanation: The certify operation failed.

Failing Item:

- FFC_621

 621-137 621-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_621
 - FFC_B88
 - FFC_190
-

621-138 621-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_621
-

621-140 621-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_621
-

621-640 621-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

623-102 623-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_623
-

623-104 623-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_623
-

623-105 623-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_623
-

 623-106 623-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_623
-

623-108 623-108

Explanation: The bus test failed.

Failing Item:

- FFC_623
-

623-110 623-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_623
-

623-112 623-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_623
-

623-114 623-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_623
-

623-116 623-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_623
-

623-117 623-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_623
-

623-118 623-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_623
 - FFC_B88
-

623-120 623-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_623
-

623-122 623-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_623
-

623-124 623-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_623
-

623-126 623-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_623
 - FFC_B88
-

623-128 623-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_623
 - SOFTWARE
-

623-129 623-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_623
 - SOFTWARE
-

623-130 623-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_623

623-132 623-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_623
-

623-133 623-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_623
-

623-134 623-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

623-135 623-135

Explanation: The device failed to configure.

Failing Item:

- FFC_623
 - FFC_B88
 - SOFTWARE
-

623-136 623-136

Explanation: The certify operation failed.

Failing Item:

- FFC_623
-

623-137 623-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_623
 - FFC_B88
 - FFC_190
-

623-138 623-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

623-140 • 624-124

- FFC_623

623-140 623-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_623

623-640 623-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

624-102 624-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_624

624-104 624-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_624

624-105 624-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_624

624-106 624-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_624

624-108 624-108

Explanation: The bus test failed.

Failing Item:

- FFC_624

624-110 624-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_624

624-112 624-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_624

624-114 624-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_624

624-116 624-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_624

624-117 624-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_624

624-118 624-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_624
- FFC_B88

624-120 624-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_624

624-122 624-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_624

624-124 624-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_624

624-126 **624-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_624
 - FFC_B88
-

624-128 **624-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_624
 - SOFTWARE
-

624-129 **624-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_624
 - SOFTWARE
-

624-130 **624-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_624
-

624-132 **624-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_624
-

624-133 **624-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_624
-

624-134 **624-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

624-135 **624-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_624
 - FFC_B88
 - SOFTWARE
-

624-136 **624-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_624
-

624-137 **624-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_624
 - FFC_B88
 - FFC_190
-

624-138 **624-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_624
-

624-140 **624-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_624
-

624-640 **624-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

62D-102 **62D-102****Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_62D
-

62D-104 **62D-104****Explanation:** The motor failed to restart.**Failing Item:**

- FFC_62D
-

62D-105 **62D-105****Explanation:** The drive did not become ready.**Failing Item:**

- FFC_62D
-

62D-106 **62D-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_62D
-

62D-108 **62D-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_62D
-

62D-110 **62D-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_62D
-

62D-112 **62D-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_62D
-

62D-114 **62D-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_62D
-

62D-116 **62D-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_62D
-

62D-117 **62D-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_62D
-

62D-118 **62D-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_62D
 - FFC_B88
-

62D-120 **62D-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_62D
-

62D-122 **62D-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_62D
-

62D-124 **62D-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_62D
-

62D-126 **62D-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_62D
 - FFC_B88
-

62D-128 **62D-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
- FFC_B88
- FFC_62D
- SOFTWARE

62D-129 **62D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_62D
 - SOFTWARE
-

62D-130 **62D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_62D
-

62D-132 **62D-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_62D
-

62D-133 **62D-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_62D
-

62D-134 **62D-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

62D-135 **62D-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_62D
 - FFC_B88
 - SOFTWARE
-

62D-136 **62D-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_62D
-

62D-137 **62D-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_62D
 - FFC_B88
 - FFC_190
-

62D-138 **62D-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_62D
-

62D-140 **62D-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_62D
-

62D-640 **62D-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

62E-102 **62E-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_62E
-

62E-104 **62E-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_62E
-

62E-105 **62E-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_62E
-

62E-106 **62E-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_62E
-

62E-108 **62E-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_62E
-

62E-110 **62E-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_62E
-

62E-112 **62E-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_62E
-

62E-114 **62E-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_62E
-

62E-116 **62E-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.**Failing Item:**

- FFC_62E
-

62E-117 **62E-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_62E
-

62E-118 **62E-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_62E
 - FFC_B88
-

62E-120 **62E-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_62E
-

62E-122 **62E-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_62E
-

62E-124 **62E-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_62E
-

62E-126 **62E-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_62E
 - FFC_B88
-

62E-128 **62E-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_62E
 - SOFTWARE
-

62E-129 **62E-129****Explanation:** Error log analysis indicates a SCSI bus problem.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_62E
 - SOFTWARE
-

62E-130 **62E-130****Explanation:** Error log analysis indicates a problem reported by the disk drive's self-monitoring function.**Failing Item:**

- FFC_62E
-

62E-132 **62E-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_62E
-

62E-133 **62E-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_62E
-

62E-134 **62E-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

62E-135 **62E-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_62E
 - FFC_B88
 - SOFTWARE
-

62E-136 **62E-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_62E
-

62E-137 **62E-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_62E
 - FFC_B88
 - FFC_190
-

62E-138 **62E-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_62E
-

62E-140 **62E-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_62E
-

62E-640 **62E-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

636-101 **636-101**

Explanation: EPROM test failure.

Failing Item:

- FFC_636
-

636-102 **636-102**

Explanation: Adapter SDRAM failure.

Failing Item:

- FFC_636
-

636-103 **636-103**

Explanation: Adapter checksum failure.

Failing Item:

- FFC_636
-

636-104 **636-104**

Explanation: Adapter memory test failure.

Failing Item:

- FFC_636
-

636-105 **636-105**

Explanation: Adapter buffer test failure.

Failing Item:

- FFC_636
-

636-106 **636-106**

Explanation: Adapter cache test failure.

Failing Item:

- FFC_636
-

636-107 **636-107****Explanation:** Internal loop-back test failure.**Failing Item:**

- FFC_636
-

636-108 **636-108****Explanation:** External wrap test failure.**Failing Item:**

- FFC_636
-

636-109 **636-109****Explanation:** Enhanced error handling failure on the bus.**Failing Item:**

- FFC_221
-

636-110 **636-110****Explanation:** Enhanced error handling failure on the Eads chip.**Failing Item:**

- FFC_221
-

636-111 **636-111****Explanation:** Enhanced error handling failure on the adapter.**Failing Item:**

- FFC_636
-

636-201 **636-201****Explanation:** Hardware failure opening adapter.**Failing Item:**

- FFC_636
 - FFC_221
-

636-202 **636-202****Explanation:** Interrupt test failure.**Failing Item:**

- FFC_636
 - FFC_221
-

636-203 **636-203****Explanation:** Adapter DMA test failure.**Failing Item:**

- FFC_636
 - FFC_221
-

636-204 **636-204****Explanation:** Enhanced error handling failure opening the adapter.**Failing Item:**

- FFC_636
 - FFC_221
-

636-701 **636-701****Explanation:** ELA indicates an I/O failure on the adapter.**Failing Item:**

- FFC_636
-

638-102 **638-102****Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_638
-

638-104 **638-104****Explanation:** The motor failed to restart.**Failing Item:**

- FFC_638
-

638-105 **638-105****Explanation:** The drive did not become ready.**Failing Item:**

- FFC_638
-

638-106 **638-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_638
-

638-108 **638-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_638
-

638-110 **638-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_638
-

638-112 638-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_638
-

638-114 638-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_638
-

638-116 638-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_638
-

638-117 638-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_638
-

638-118 638-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_638
 - FFC_B88
-

638-120 638-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_638
-

638-122 638-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_638
-

638-124 638-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_638
-

638-126 638-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_638
 - FFC_B88
-

638-128 638-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_638
 - SOFTWARE
-

638-129 638-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_638
 - SOFTWARE
-

638-130 638-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_638
-

638-132 638-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_638
-

638-133 638-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_638
-

638-134 638-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

638-135 • 639-116

- SOFTWARE

638-135 638-135

Explanation: The device failed to configure.

Failing Item:

- FFC_638
- FFC_B88
- SOFTWARE

638-136 638-136

Explanation: The certify operation failed.

Failing Item:

- FFC_638

638-137 638-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_638
- FFC_B88
- FFC_190

638-138 638-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_638

638-140 638-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_638

638-640 638-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

639-102 639-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_639

639-104 639-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_639

639-105 639-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_639

639-106 639-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_639

639-108 639-108

Explanation: The bus test failed.

Failing Item:

- FFC_639

639-110 639-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_639

639-112 639-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_639

639-114 639-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_639

639-116 639-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_639

639-117 639-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_639

639-118 639-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_639
- FFC_B88

639-120 639-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_639

639-122 639-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_639

639-124 639-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_639

639-126 639-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_639
- FFC_B88

639-128 639-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_639
- SOFTWARE

639-129 639-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_639
- SOFTWARE

639-130 639-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_639

639-132 639-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_639

639-133 639-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_639

639-134 639-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

639-135 639-135

Explanation: The device failed to configure.

Failing Item:

- FFC_639
- FFC_B88
- SOFTWARE

639-136 639-136

Explanation: The certify operation failed.

Failing Item:

- FFC_639

 639-137 639-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_639
 - FFC_B88
 - FFC_190
-

639-138 639-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_639
-

639-140 639-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_639
-

639-640 639-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63A-102 63A-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63A
-

63A-104 63A-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63A
-

63A-105 63A-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63A

 63A-106 63A-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63A
-

63A-108 63A-108

Explanation: The bus test failed.

Failing Item:

- FFC_63A
-

63A-110 63A-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63A
-

63A-112 63A-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63A
-

63A-114 63A-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63A
-

63A-116 63A-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63A
-

63A-117 63A-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63A
-

63A-118 63A-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63A
- FFC_B88

63A-120 63A-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63A
-

63A-122 63A-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63A
-

63A-124 63A-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63A
-

63A-126 63A-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63A
 - FFC_B88
-

63A-128 63A-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63A
 - SOFTWARE
-

63A-129 63A-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63A
 - SOFTWARE
-

63A-130 63A-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63A

63A-132 63A-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63A
-

63A-133 63A-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63A
-

63A-134 63A-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

63A-135 63A-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63A
 - FFC_B88
 - SOFTWARE
-

63A-136 63A-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63A
-

63A-137 63A-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63A
 - FFC_B88
 - FFC_190
-

63A-138 63A-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

63A-140 • 63B-124

- FFC_63A

63A-140 63A-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_63A

63A-640 63A-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63B-102 63B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63B

63B-104 63B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63B

63B-105 63B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63B

63B-106 63B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63B

63B-108 63B-108

Explanation: The bus test failed.

Failing Item:

- FFC_63B

63B-110 63B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63B

63B-112 63B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63B

63B-114 63B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63B

63B-116 63B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63B

63B-117 63B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63B

63B-118 63B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63B
- FFC_B88

63B-120 63B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63B

63B-122 63B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63B

63B-124 63B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63B

63B-126 **63B-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63B
 - FFC_B88
-

63B-128 **63B-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63B
 - SOFTWARE
-

63B-129 **63B-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63B
 - SOFTWARE
-

63B-130 **63B-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63B
-

63B-132 **63B-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63B
-

63B-133 **63B-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63B
-

63B-134 **63B-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

63B-135 **63B-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_63B
 - FFC_B88
 - SOFTWARE
-

63B-136 **63B-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_63B
-

63B-137 **63B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63B
 - FFC_B88
 - FFC_190
-

63B-138 **63B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63B
-

63B-140 **63B-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63B
-

63B-640 **63B-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63C-102 63C-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63C
-

63C-104 63C-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63C
-

63C-105 63C-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63C
-

63C-106 63C-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63C
-

63C-108 63C-108

Explanation: The bus test failed.

Failing Item:

- FFC_63C
-

63C-110 63C-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63C
-

63C-112 63C-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63C
-

63C-114 63C-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63C
-

63C-116 63C-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63C
-

63C-117 63C-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63C
-

63C-118 63C-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63C
 - FFC_B88
-

63C-120 63C-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63C
-

63C-122 63C-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63C
-

63C-124 63C-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63C
-

63C-126 63C-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63C
 - FFC_B88
-

63C-128 63C-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_63C
- SOFTWARE

63C-129 **63C-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63C
 - SOFTWARE
-

63C-130 **63C-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63C
-

63C-132 **63C-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63C
-

63C-133 **63C-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63C
-

63C-134 **63C-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

63C-135 **63C-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_63C
 - FFC_B88
 - SOFTWARE
-

63C-136 **63C-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_63C
-

63C-137 **63C-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63C
 - FFC_B88
 - FFC_190
-

63C-138 **63C-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63C
-

63C-140 **63C-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63C
-

63C-640 **63C-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63D-102 **63D-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63D
-

63D-104 **63D-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_63D
-

63D-105 **63D-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_63D
-

63D-106 63D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63D
-

63D-108 63D-108

Explanation: The bus test failed.

Failing Item:

- FFC_63D
-

63D-110 63D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63D
-

63D-112 63D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63D
-

63D-114 63D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63D
-

63D-116 63D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63D
-

63D-117 63D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63D
-

63D-118 63D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63D
 - FFC_B88
-

63D-120 63D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63D
-

63D-122 63D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63D
-

63D-124 63D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63D
-

63D-126 63D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63D
 - FFC_B88
-

63D-128 63D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63D
 - SOFTWARE
-

63D-129 63D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63D
 - SOFTWARE
-

63D-130 63D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63D
-

63D-132 **63D-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63D
-

63D-133 **63D-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63D
-

63D-134 **63D-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

63D-135 **63D-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_63D
 - FFC_B88
 - SOFTWARE
-

63D-136 **63D-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_63D
-

63D-137 **63D-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63D
 - FFC_B88
 - FFC_190
-

63D-138 **63D-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63D
-

63D-140 **63D-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63D
-

63D-640 **63D-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63E-102 **63E-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63E
-

63E-104 **63E-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_63E
-

63E-105 **63E-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_63E
-

63E-106 **63E-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_63E
-

63E-108 **63E-108**

Explanation: The bus test failed.

Failing Item:

- FFC_63E
-

63E-110 **63E-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_63E

63E-112 **63E-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63E
-

63E-114 **63E-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63E
-

63E-116 **63E-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63E
-

63E-117 **63E-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63E
-

63E-118 **63E-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63E
 - FFC_B88
-

63E-120 **63E-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63E
-

63E-122 **63E-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63E
-

63E-124 **63E-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63E
-

63E-126 **63E-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63E
 - FFC_B88
-

63E-128 **63E-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63E
 - SOFTWARE
-

63E-129 **63E-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63E
 - SOFTWARE
-

63E-130 **63E-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63E
-

63E-132 **63E-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63E
-

63E-133 **63E-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63E
-

63E-134 **63E-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

63E-135 63E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63E
 - FFC_B88
 - SOFTWARE
-

63E-136 63E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63E
-

63E-137 63E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63E
 - FFC_B88
 - FFC_190
-

63E-138 63E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63E
-

63E-140 63E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63E
-

63E-640 63E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63F-102 63F-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63F
-

63F-104 63F-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63F
-

63F-105 63F-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63F
-

63F-106 63F-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63F
-

63F-108 63F-108

Explanation: The bus test failed.

Failing Item:

- FFC_63F
-

63F-110 63F-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63F
-

63F-112 63F-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63F
-

63F-114 63F-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63F
-

63F-116 63F-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

63F-117 • 63F-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63F
-

63F-117 63F-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63F
-

63F-118 63F-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63F
 - FFC_B88
-

63F-120 63F-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63F
-

63F-122 63F-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63F
-

63F-124 63F-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63F
-

63F-126 63F-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63F
 - FFC_B88
-

63F-128 63F-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63F
 - SOFTWARE
-

63F-129 63F-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63F
 - SOFTWARE
-

63F-130 63F-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63F
-

63F-132 63F-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63F
-

63F-133 63F-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63F
-

63F-134 63F-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

63F-135 63F-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63F
 - FFC_B88
 - SOFTWARE
-

63F-136 63F-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63F
-

63F-137 **63F-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63F
 - FFC_B88
 - FFC_190
-

63F-138 **63F-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63F
-

63F-140 **63F-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63F
-

63F-640 **63F-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

640-102 **640-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_640
-

640-104 **640-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_640
-

640-105 **640-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_640
-

640-106 **640-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_640
-

640-108 **640-108**

Explanation: The bus test failed.

Failing Item:

- FFC_640
-

640-110 **640-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_640
-

640-112 **640-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_640
-

640-114 **640-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_640
-

640-116 **640-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_640
-

640-117 **640-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_640
-

640-118 **640-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_640
 - FFC_B88
-

640-120 **640-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_640
-

640-122 **640-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_640
-

640-124 **640-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_640
-

640-126 **640-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_640
 - FFC_B88
-

640-128 **640-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_640
 - SOFTWARE
-

640-129 **640-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_640
 - SOFTWARE
-

640-130 **640-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_640

640-132 **640-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_640
-

640-133 **640-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_640
-

640-134 **640-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

640-135 **640-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_640
 - FFC_B88
 - SOFTWARE
-

640-136 **640-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_640
-

640-137 **640-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_640
 - FFC_B88
 - FFC_190
-

640-138 **640-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_640

640-140 640-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_640

640-640 640-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

643-102 643-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_643

643-104 643-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_643

643-105 643-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_643

643-106 643-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_643

643-108 643-108

Explanation: The bus test failed.

Failing Item:

- FFC_643

643-110 643-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_643

643-112 643-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_643

643-114 643-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_643

643-116 643-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_643

643-117 643-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_643

643-118 643-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_643
- FFC_B88

643-120 643-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_643

643-122 643-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_643

643-124 643-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_643

643-126 **643-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_643
 - FFC_B88
-

643-128 **643-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_643
 - SOFTWARE
-

643-129 **643-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_643
 - SOFTWARE
-

643-130 **643-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_643
-

643-132 **643-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_643
-

643-133 **643-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_643
-

643-134 **643-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

643-135 **643-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_643
 - FFC_B88
 - SOFTWARE
-

643-136 **643-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_643
-

643-137 **643-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_643
 - FFC_B88
 - FFC_190
-

643-138 **643-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_643
-

643-140 **643-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_643
-

643-640 **643-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

644-102 644-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_644
-

644-104 644-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_644
-

644-105 644-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_644
-

644-106 644-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_644
-

644-108 644-108

Explanation: The bus test failed.

Failing Item:

- FFC_644
-

644-110 644-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_644
-

644-112 644-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_644
-

644-114 644-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_644
-

644-116 644-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_644
-

644-117 644-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_644
-

644-118 644-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_644
 - FFC_B88
-

644-120 644-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_644
-

644-122 644-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_644
-

644-124 644-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_644
-

644-126 644-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_644
 - FFC_B88
-

644-128 644-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_644
- SOFTWARE

644-129 **644-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_644
 - SOFTWARE
-

644-130 **644-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_644
-

644-132 **644-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_644
-

644-133 **644-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_644
-

644-134 **644-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

644-135 **644-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_644
 - FFC_B88
 - SOFTWARE
-

644-136 **644-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_644
-

644-137 **644-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_644
 - FFC_B88
 - FFC_190
-

644-138 **644-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_644
-

644-140 **644-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_644
-

644-640 **644-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

646-101 **646-101**

Explanation: External Test Failure.

Failing Item:

- FFC_D46
-

646-102 **646-102**

Explanation: External Test Failure.

Failing Item:

- FFC_240
-

646-103 **646-103**

Explanation: I/O Test Failure.

Failing Item:

- FFC_646
-

646-104 **646-104**
Explanation: Adapter On-card Test Failure.**Failing Item:**

- FFC_646
 - FFC_221
-

646-105 **646-105****Explanation:** Wrap Test Failure.**Failing Item:**

- FFC_646
-

646-106 **646-106****Explanation:** Enhanced Error Handling failure on bus.**Failing Item:**

- FFC_646
-

646-107 **646-107****Explanation:** EEH failure on PCI-PCI bridge chip.**Failing Item:**

- FFC_646
-

646-108 **646-108****Explanation:** Enhanced Error Handling failure on adapter.**Failing Item:**

- FFC_646
-

646-201 **646-201****Explanation:** Configuration Register Test Failure.**Failing Item:**

- FFC_646
 - FFC_221
-

646-202 **646-202****Explanation:** Wrap Test Failure.**Failing Item:**

- FFC_646
 - FFC_221
-

646-204 **646-204****Explanation:** External Test Failure.**Failing Item:**

- FFC_D46
 - FFC_240
-

646-205 **646-205****Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.**Failing Item:**

- FFC_D46
 - FFC_646
-

646-206 **646-206****Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.**Failing Item:**

- FFC_240
 - FFC_646
-

646-302 **646-302****Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.**Failing Item:**

- FFC_240
 - FFC_D46
 - FFC_221
-

646-303 **646-303****Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.**Failing Item:**

- FFC_D46
 - FFC_646
 - FFC_221
-

646-401 **646-401****Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution. Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_240
 - FFC_D46
 - FFC_646
 - FFC_221
-

646-701 **646-701**

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_646
-

646-702 **646-702**

Explanation: Error log analysis indicates that an adapter check has occurred.

Failing Item:

- FFC_646
-

646-703 **646-703**

Explanation: Error log analysis indicates that a DMA failure has occurred.

Failing Item:

- FFC_646
 - FFC_221
-

646-704 **646-704**

Explanation: Error log analysis indicates that a PCI Bus error has occurred.

Failing Item:

- FFC_646
 - FFC_221
-

646-705 **646-705**

Explanation: Error log analysis indicates that a Programmed I/O error has occurred.

Failing Item:

- FFC_646
 - FFC_221
-

646-706 **646-706**

Explanation: ELA indicates a command write failure occurred.

Failing Item:

- FFC_646
-

646-707 **646-707**

Explanation: ELA indicates an internal adapter error has occurred.

Failing Item:

- FFC_646
-

64A-102 **64A-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64A
-

64A-104 **64A-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_64A
-

64A-105 **64A-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_64A
-

64A-106 **64A-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_64A
-

64A-108 **64A-108**

Explanation: The bus test failed.

Failing Item:

- FFC_64A
-

64A-110 **64A-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_64A
-

64A-112 **64A-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64A
-

64A-114 **64A-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64A
-

64A-116 **64A-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64A

64A-117 64A-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64A

64A-118 64A-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64A
- FFC_B88

64A-120 64A-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64A

64A-122 64A-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64A

64A-124 64A-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64A

64A-126 64A-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64A
- FFC_B88

64A-128 64A-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_64A
- SOFTWARE

64A-129 64A-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_64A
- SOFTWARE

64A-130 64A-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64A

64A-132 64A-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64A

64A-133 64A-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64A

64A-134 64A-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

64A-135 64A-135

Explanation: The device failed to configure.

Failing Item:

- FFC_64A
- FFC_B88
- SOFTWARE

64A-136 64A-136

Explanation: The certify operation failed.

Failing Item:

- FFC_64A

64A-137 **64A-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64A
 - FFC_B88
 - FFC_190
-

64A-138 **64A-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64A
-

64A-140 **64A-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_64A
-

64A-640 **64A-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64B-102 **64B-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64B
-

64B-104 **64B-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_64B
-

64B-105 **64B-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_64B
-

64B-106 **64B-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_64B
-

64B-108 **64B-108**

Explanation: The bus test failed.

Failing Item:

- FFC_64B
-

64B-110 **64B-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_64B
-

64B-112 **64B-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64B
-

64B-114 **64B-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64B
-

64B-116 **64B-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64B
-

64B-117 **64B-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64B
-

64B-118 **64B-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64B
 - FFC_B88
-

64B-120 **64B-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64B
-

64B-122 **64B-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64B
-

64B-124 **64B-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64B
-

64B-126 **64B-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64B
 - FFC_B88
-

64B-128 **64B-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64B
 - SOFTWARE
-

64B-129 **64B-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64B
 - SOFTWARE
-

64B-130 **64B-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64B

64B-132 **64B-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64B
-

64B-133 **64B-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64B
-

64B-134 **64B-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

64B-135 **64B-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_64B
 - FFC_B88
 - SOFTWARE
-

64B-136 **64B-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_64B
-

64B-137 **64B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64B
 - FFC_B88
 - FFC_190
-

64B-138 **64B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

64B-140 • 64C-124

- FFC_64B

64B-140 64B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_64B

64B-640 64B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64C-102 64C-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64C

64C-104 64C-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64C

64C-105 64C-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64C

64C-106 64C-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64C

64C-108 64C-108

Explanation: The bus test failed.

Failing Item:

- FFC_64C

64C-110 64C-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64C

64C-112 64C-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64C

64C-114 64C-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64C

64C-116 64C-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64C

64C-117 64C-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64C

64C-118 64C-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64C
- FFC_B88

64C-120 64C-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64C

64C-122 64C-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64C

64C-124 64C-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64C

64C-126 **64C-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64C
 - FFC_B88
-

64C-128 **64C-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64C
 - SOFTWARE
-

64C-129 **64C-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64C
 - SOFTWARE
-

64C-130 **64C-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64C
-

64C-132 **64C-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64C
-

64C-133 **64C-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64C
-

64C-134 **64C-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE
-

64C-135 **64C-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_64C
 - FFC_B88
 - SOFTWARE
-

64C-136 **64C-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_64C
-

64C-137 **64C-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64C
 - FFC_B88
 - FFC_190
-

64C-138 **64C-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64C
-

64C-140 **64C-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_64C
-

64C-640 **64C-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64D-102 64D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64D
-

64D-104 64D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64D
-

64D-105 64D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64D
-

64D-106 64D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64D
-

64D-108 64D-108

Explanation: The bus test failed.

Failing Item:

- FFC_64D
-

64D-110 64D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64D
-

64D-112 64D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64D
-

64D-114 64D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64D
-

64D-116 64D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64D
-

64D-117 64D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64D
-

64D-118 64D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64D
 - FFC_B88
-

64D-120 64D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64D
-

64D-122 64D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64D
-

64D-124 64D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64D
-

64D-126 64D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64D
 - FFC_B88
-

64D-128 64D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_64D
- SOFTWARE

64D-129 **64D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64D
 - SOFTWARE
-

64D-130 **64D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64D
-

64D-132 **64D-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64D
-

64D-133 **64D-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64D
-

64D-134 **64D-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

64D-135 **64D-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_64D
 - FFC_B88
 - SOFTWARE
-

64D-136 **64D-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_64D
-

64D-137 **64D-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64D
 - FFC_B88
 - FFC_190
-

64D-138 **64D-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64D
-

64D-140 **64D-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_64D
-

64D-640 **64D-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64E-102 **64E-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64E
-

64E-104 **64E-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_64E
-

64E-105 **64E-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_64E
-

64E-106 **64E-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_64E
-

64E-108 **64E-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_64E
-

64E-110 **64E-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_64E
-

64E-112 **64E-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_64E
-

64E-114 **64E-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_64E
-

64E-116 **64E-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.**Failing Item:**

- FFC_64E
-

64E-117 **64E-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_64E
-

64E-118 **64E-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_64E
 - FFC_B88
-

64E-120 **64E-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_64E
-

64E-122 **64E-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_64E
-

64E-124 **64E-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_64E
-

64E-126 **64E-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_64E
 - FFC_B88
-

64E-128 **64E-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_64E
 - SOFTWARE
-

64E-129 **64E-129****Explanation:** Error log analysis indicates a SCSI bus problem.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_64E
 - SOFTWARE
-

64E-130 **64E-130****Explanation:** Error log analysis indicates a problem reported by the disk drive's self-monitoring function.**Failing Item:**

- FFC_64E
-

64E-132 **64E-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64E
-

64E-133 **64E-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64E
-

64E-134 **64E-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

64E-135 **64E-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_64E
 - FFC_B88
 - SOFTWARE
-

64E-136 **64E-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_64E
-

64E-137 **64E-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64E
 - FFC_B88
 - FFC_190
-

64E-138 **64E-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64E
-

64E-140 **64E-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_64E
-

64E-640 **64E-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64F-102 **64F-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64F
-

64F-104 **64F-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_64F
-

64F-105 **64F-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_64F
-

64F-106 **64F-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_64F
-

64F-108 **64F-108**

Explanation: The bus test failed.

Failing Item:

- FFC_64F
-

64F-110 **64F-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_64F

64F-112 **64F-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64F
-

64F-114 **64F-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64F
-

64F-116 **64F-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64F
-

64F-117 **64F-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64F
-

64F-118 **64F-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64F
 - FFC_B88
-

64F-120 **64F-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64F
-

64F-122 **64F-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64F
-

64F-124 **64F-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64F
-

64F-126 **64F-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64F
 - FFC_B88
-

64F-128 **64F-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64F
 - SOFTWARE
-

64F-129 **64F-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64F
 - SOFTWARE
-

64F-130 **64F-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64F
-

64F-132 **64F-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64F
-

64F-133 **64F-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64F
-

64F-134 **64F-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

64F-135 **64F-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_64F
- FFC_B88
- SOFTWARE

64F-136 **64F-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_64F

64F-137 **64F-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64F
- FFC_B88
- FFC_190

64F-138 **64F-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64F

64F-140 **64F-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_64F

64F-640 **64F-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

650-XXX **650-XXX**

Explanation: Disk drive configuration failed.

Failing Item:

- FFC_650

651-140 **651-140**

Explanation: Display character test failed.

Failing Item:

- FFC_165
- FFC_221

651-199 **651-199**

Explanation: This is a test of the flow of a Serviceable Event from this system to the management console. This is not a real problem.

657-001 **657-001**

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_657

657-002 **657-002**

Explanation: Adapter failure.

Failing Item:

- FFC_657
- SOFTWARE

657-003 **657-003**

Explanation: Adapter failure.

Failing Item:

- FFC_657
- FFC_227

657-004 **657-004**

Explanation: Display failure.

Failing Item:

- FFC_657
- MONITOR
- CABLE

657-005 **657-005**

Explanation: Adapter failure.

Failing Item:

- FFC_657

65A-102 • 65A-126

- FFC_227
- MONITOR
- CABLE

65A-102 65A-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65A

65A-104 65A-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65A

65A-105 65A-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65A

65A-106 65A-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65A

65A-108 65A-108

Explanation: The bus test failed.

Failing Item:

- FFC_65A

65A-110 65A-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65A

65A-112 65A-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65A

65A-114 65A-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65A

65A-116 65A-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65A

65A-117 65A-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65A

65A-118 65A-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65A
- FFC_B88

65A-120 65A-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65A

65A-122 65A-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65A

65A-124 65A-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65A

65A-126 65A-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65A
- FFC_B88

65A-128 **65A-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65A
 - SOFTWARE
-

65A-129 **65A-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65A
 - SOFTWARE
-

65A-130 **65A-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65A
-

65A-132 **65A-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65A
-

65A-133 **65A-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65A
-

65A-134 **65A-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65A-135 **65A-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_65A
 - FFC_B88
-

- SOFTWARE
-

65A-136 **65A-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_65A
-

65A-137 **65A-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65A
 - FFC_B88
 - FFC_190
-

65A-138 **65A-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65A
-

65A-140 **65A-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65A
-

65A-640 **65A-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65B-102 **65B-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65B
-

65B-104 65B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65B
-

65B-105 65B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65B
-

65B-106 65B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65B
-

65B-108 65B-108

Explanation: The bus test failed.

Failing Item:

- FFC_65B
-

65B-110 65B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65B
-

65B-112 65B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65B
-

65B-114 65B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65B
-

65B-116 65B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65B
-

65B-117 65B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65B
-

65B-118 65B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65B
 - FFC_B88
-

65B-120 65B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65B
-

65B-122 65B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65B
-

65B-124 65B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65B
-

65B-126 65B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65B
 - FFC_B88
-

65B-128 65B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65B
 - SOFTWARE
-

65B-129 **65B-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65B
 - SOFTWARE
-

65B-130 **65B-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65B
-

65B-132 **65B-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65B
-

65B-133 **65B-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65B
-

65B-134 **65B-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65B-135 **65B-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_65B
 - FFC_B88
 - SOFTWARE
-

65B-136 **65B-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_65B
-

65B-137 **65B-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65B
 - FFC_B88
 - FFC_190
-

65B-138 **65B-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65B
-

65B-140 **65B-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65B
-

65B-640 **65B-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65C-102 **65C-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65C
-

65C-104 **65C-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_65C
-

65C-105 **65C-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_65C
-

65C-106 **65C-106****Explanation:** The electronics card test failed.**Failing Item:**

- FFC_65C
-

65C-108 **65C-108****Explanation:** The bus test failed.**Failing Item:**

- FFC_65C
-

65C-110 **65C-110****Explanation:** The media format is corrupted.**Failing Item:**

- FFC_65C
-

65C-112 **65C-112****Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_65C
-

65C-114 **65C-114****Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_65C
-

65C-116 **65C-116****Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.**Failing Item:**

- FFC_65C
-

65C-117 **65C-117****Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_65C
-

65C-118 **65C-118****Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_65C
 - FFC_B88
-

65C-120 **65C-120****Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_65C
-

65C-122 **65C-122****Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_65C
-

65C-124 **65C-124****Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_65C
-

65C-126 **65C-126****Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_65C
 - FFC_B88
-

65C-128 **65C-128****Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_65C
 - SOFTWARE
-

65C-129 **65C-129****Explanation:** Error log analysis indicates a SCSI bus problem.**Failing Item:**

- FFC_190
 - FFC_B88
 - FFC_65C
 - SOFTWARE
-

65C-130 **65C-130****Explanation:** Error log analysis indicates a problem reported by the disk drive's self-monitoring function.**Failing Item:**

- FFC_65C
-

65C-132 **65C-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65C
-

65C-133 **65C-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65C
-

65C-134 **65C-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65C-135 **65C-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_65C
 - FFC_B88
 - SOFTWARE
-

65C-136 **65C-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_65C
-

65C-137 **65C-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65C
 - FFC_B88
 - FFC_190
-

65C-138 **65C-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65C
-

65C-140 **65C-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65C
-

65C-640 **65C-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65D-102 **65D-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65D
-

65D-104 **65D-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_65D
-

65D-105 **65D-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_65D
-

65D-106 **65D-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_65D
-

65D-108 **65D-108**

Explanation: The bus test failed.

Failing Item:

- FFC_65D
-

65D-110 **65D-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_65D

65D-112 **65D-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65D
-

65D-114 **65D-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65D
-

65D-116 **65D-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65D
-

65D-117 **65D-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65D
-

65D-118 **65D-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65D
 - FFC_B88
-

65D-120 **65D-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65D
-

65D-122 **65D-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65D
-

65D-124 **65D-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65D
-

65D-126 **65D-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65D
 - FFC_B88
-

65D-128 **65D-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65D
 - SOFTWARE
-

65D-129 **65D-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65D
 - SOFTWARE
-

65D-130 **65D-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65D
-

65D-132 **65D-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65D
-

65D-133 **65D-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65D
-

65D-134 **65D-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

65D-135 **65D-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_65D
- FFC_B88
- SOFTWARE

65D-136 **65D-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_65D

65D-137 **65D-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65D
- FFC_B88
- FFC_190

65D-138 **65D-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65D

65D-140 **65D-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_65D

65D-640 **65D-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65E-102 **65E-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65E

65E-104 **65E-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_65E

65E-105 **65E-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_65E

65E-106 **65E-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_65E

65E-108 **65E-108**

Explanation: The bus test failed.

Failing Item:

- FFC_65E

65E-110 **65E-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_65E

65E-112 **65E-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65E

65E-114 **65E-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65E

65E-116 **65E-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

65E-117 • 65E-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65E
-

65E-117 65E-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65E
-

65E-118 65E-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65E
 - FFC_B88
-

65E-120 65E-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65E
-

65E-122 65E-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65E
-

65E-124 65E-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65E
-

65E-126 65E-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65E
 - FFC_B88
-

65E-128 65E-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65E
 - SOFTWARE
-

65E-129 65E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65E
 - SOFTWARE
-

65E-130 65E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65E
-

65E-132 65E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65E
-

65E-133 65E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65E
-

65E-134 65E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65E-135 65E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65E
 - FFC_B88
 - SOFTWARE
-

65E-136 65E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65E
-

65E-137 **65E-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65E
 - FFC_B88
 - FFC_190
-

65E-138 **65E-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65E
-

65E-140 **65E-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65E
-

65E-640 **65E-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65F-102 **65F-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65F
-

65F-104 **65F-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_65F
-

65F-105 **65F-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_65F
-

65F-106 **65F-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_65F
-

65F-108 **65F-108**

Explanation: The bus test failed.

Failing Item:

- FFC_65F
-

65F-110 **65F-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_65F
-

65F-112 **65F-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65F
-

65F-114 **65F-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65F
-

65F-116 **65F-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65F
-

65F-117 **65F-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65F
-

65F-118 **65F-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65F
 - FFC_B88
-

65F-120 65F-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65F
-

65F-122 65F-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65F
-

65F-124 65F-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65F
-

65F-126 65F-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65F
 - FFC_B88
-

65F-128 65F-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65F
 - SOFTWARE
-

65F-129 65F-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65F
 - SOFTWARE
-

65F-130 65F-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65F

65F-132 65F-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65F
-

65F-133 65F-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65F
-

65F-134 65F-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65F-135 65F-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65F
 - FFC_B88
 - SOFTWARE
-

65F-136 65F-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65F
-

65F-137 65F-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65F
 - FFC_B88
 - FFC_190
-

65F-138 65F-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65F

65F-140 **65F-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65F
-

65F-640 **65F-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

662-101 **662-101**

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

662-102 **662-102**

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

662-103 **662-103**

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_662
 - FFC_221
-

662-212 **662-212**

Explanation: FIFO empty bit set.

Failing Item:

- FFC_662
-

662-213 **662-213**

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_662
-

662-214 **662-214**

Explanation: FIFO full bit set.

Failing Item:

- FFC_662
-

662-215 **662-215**

Explanation: FIFO full bit clear.

Failing Item:

- FFC_662
-

662-216 **662-216**

Explanation: FIFO data miscompare.

Failing Item:

- FFC_662
-

662-217 **662-217**

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_662
-

662-218 **662-218**

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_662
-

662-219 **662-219**

Explanation: SCSI parity error.

Response: Go to MAP0050 : SCSI Bus Problems.

662-220 **662-220**

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_662
-

662-221 **662-221**

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_662
 - FFC_221
-

662-222 662-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_662
-

662-223 662-223

Explanation: Mismatch during the write/read of the memory I/O register.

Response: Go to MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_662
-

662-224 662-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_662
 - FFC_221
-

662-225 662-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_662
-

662-226 662-226

Explanation: SCSI wrap or PTC failure.

Response: Go to MAP0050 : SCSI Bus Problems.

662-227 662-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_662
 - FFC_221
-

662-230 662-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

662-231 662-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

662-232 662-232

Explanation: SCSI bus data mismatch.

Response: Go to MAP0050 : SCSI Bus Problems.

662-240 662-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

662-242 662-242

Explanation: SCSI bus problem.

Response: Go to MAP0050 : SCSI Bus Problems.

662-301 662-301

Explanation: The parent device open failed.

Failing Item:

- FFC_662
 - FFC_221
-

662-701 662-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_662
-

662-801 662-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

662-802 662-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

662-803 662-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use

the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

663-101 **663-101**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Central Processing Unit test failure.

Failing Item:

- FFC_663
- FFC_C94
- FFC_C95

663-102 **663-102**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Timer test failure.

Failing Item:

- FFC_663
- FFC_C94
- FFC_C95

663-103 **663-103**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Bus Interface test failure.

Failing Item:

- FFC_663
- FFC_C94
- FFC_C95

663-104 **663-104**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Dynamic Random Access Memory test failure.

Failing Item:

- FFC_C94
- FFC_663
- FFC_C95

663-105 **663-105**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Memory Protection test failure.

Failing Item:

- FFC_663
- FFC_C94
- FFC_C95

663-106 **663-106**

Explanation: IBM ARTIC960RxD PCI Adapter Debug Port test failure.

Failing Item:

- FFC_663
- FFC_C94
- FFC_C95

663-107 **663-107**

Explanation: Interface board wrap test failure.

Failing Item:

- FFC_C95
- FFC_663
- FFC_C97

663-110 **663-110**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Download Diagnostics test failure.

Failing Item:

- FFC_C94
- FFC_663
- FFC_C95

663-123 **663-123**

Explanation: Interface board non-wrap test failure.

Failing Item:

- FFC_C95
- FFC_663
- FFC_C94

663-150 **663-150**

Explanation: Device configuration failure.

Failing Item:

- FFC_663
- SOFTWARE
- FFC_227

663-151 **663-151**

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_663
- SOFTWARE
- FFC_227

663-152 **663-152**

Explanation: Failure and error in determining which type of IBM ARTIC960RxD PCI Adapter.

Failing Item:

- FFC_663
-

663-153 **663-153**

Explanation: Error log analysis indicates a IBM ARTIC960RxD or RxF PCI Adapter failure. Action: Use the errpt command to check error log.

Failing Item:

- FFC_663
 - FFC_227
 - FFC_C94
 - SOFTWARE
-

663-154 **663-154**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter initialization failure.

Failing Item:

- FFC_C94
 - FFC_663
 - FFC_C95
-

663-155 **663-155**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter initialization failure.

Failing Item:

- FFC_663
 - FFC_C94
 - FFC_C95
-

663-156 **663-156**

Explanation: IBM ARTIC960RxD or RxF PCI Adapter initialization failure.

Failing Item:

- FFC_C95
 - FFC_663
 - FFC_C94
-

663-157 **663-157**

Explanation: Cable wrap test failure.

Failing Item:

- FFC_C98
 - FFC_C97
 - FFC_C95
-

669-101 **669-101**

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_221
-

669-102 **669-102**

Explanation: Enhanced error handling failure on Eads chip.

Failing Item:

- FFC_221
-

669-103 **669-103**

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_669
-

669-201 **669-201**

Explanation: Configuration register test failure.

Response: Before going to MAP0210 , look at the label on the adapter. If the label is A-A, use SRN 66C-201 instead.

Failing Item:

- FFC_669
 - FFC_221
-

669-202 **669-202**

Explanation: I/O register test failure.

Failing Item:

- FFC_669
-

669-203 **669-203**

Explanation: Adapter memory test failure.

Failing Item:

- FFC_669
-

669-204 **669-204**

Explanation: Adapter initialization test failure.

Failing Item:

- FFC_669
-

669-205 **669-205**

Explanation: Internal loopback test failure.

Failing Item:

- FFC_669
-

669-206 **669-206**

Explanation: External wrap test failure (1000 Mbps).

Failing Item:

- FFC_669
-

669-701 **669-701**

Explanation: Error Log Analysis indicates that this device failed to initialize because it is not the IBM version of this adapter. AIX operating system cannot configure this non-IBM version of the adapter.

Failing Item:

- FFC_669
-

669-702 **669-702**

Explanation: Error Log Analysis indicates that this device failed to initialize due to a problem with the EEPROM on the adapter.

Failing Item:

- FFC_669
-

669-703 **669-703**

Explanation: Error Log Analysis indicates that this device has failed to initialize due to a self-test failure.

Failing Item:

- FFC_669
-

669-704 **669-704**

Explanation: Error Log Analysis indicates that this device has failed to initialize due to firmware download error.

Failing Item:

- FFC_669
-

66A-101 **66A-101**

Explanation: Diagnostics indicates adapter configuration failure.

66C-101 **66C-101**

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_221
-

66C-102 **66C-102**

Explanation: Enhanced error handling failure on Eads chip.

Failing Item:

- FFC_221
-

66C-103 **66C-103**

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_66C
-

66C-201 **66C-201**

Explanation: Configuration register test failure.

Failing Item:

- FFC_66C
 - FFC_221
-

66C-202 **66C-202**

Explanation: I/O register test failure.

Failing Item:

- FFC_66C
-

66C-203 **66C-203**

Explanation: Adapter memory test failure.

Failing Item:

- FFC_66C
-

66C-204 **66C-204**

Explanation: Adapter initialization test failure.

Failing Item:

- FFC_66C
-

66C-205 **66C-205**

Explanation: Internal loopback test failure.

Failing Item:

- FFC_66C
-

66C-206 **66C-206**

Explanation: External wrap test failure (1000 Mbps).

Failing Item:

- FFC_66C
-

66C-207 **66C-207**

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_66C
-

66C-208 **66C-208**

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_66C
-

66C-702 **66C-702**

Explanation: Error Log Analysis indicates that this device failed to initialize due to a problem with the EEPROM on the adapter.

Failing Item:

- FFC_66C
-

66C-703 **66C-703**

Explanation: Error Log Analysis indicates that this device has failed to initialize due to a self-test failure.

Failing Item:

- FFC_66C
-

66C-704 **66C-704**

Explanation: Error Log Analysis indicates that this device has failed to initialize due to firmware download error.

Failing Item:

- FFC_66C
-

66D-101 **66D-101**

Explanation: The PCI wrap test failed.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
 - FFC_227
-

66D-102 **66D-102**

Explanation: The POST indicates an adapter failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
 - FFC_E2A
-

66D-103 **66D-103**

Explanation: The POST indicates an adapter channel failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
-

66D-104 **66D-104**

Explanation: The POST indicates a defective cable.

Failing Item:

- FFC_190
-

66D-105 **66D-105**

Explanation: The POST indicates a defective backplane or external enclosure.

Failing Item:

- FFC_B3A
-

66D-106 **66D-106**

Explanation: The POST indicates the last disk drive reconnected caused a channel failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722
-

66D-108 **66D-108**

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_221
-

66D-109 **66D-109**

Explanation: The test indicates an adapter failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
-

66D-110 **66D-110**

Explanation: The disk reported a Predictive Failure Analysis error (PFA).

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722
-

66D-111 **66D-111**

Explanation: The disk drive has been failed by the adapter.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-112 66D-112

Explanation: ELA indicates that the disk reported a hard data error.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-113 66D-113

Explanation: ELA indicates that the disk reported a hard equipment error.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-114 66D-114

Explanation: ELA indicates a cache failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-115 66D-115

Explanation: ELA indicates that the cache battery is either low on power or has failed.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E3A

66D-116 66D-116

Explanation: Failed to disable data scrub.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D

66D-117 66D-117

Explanation: POST indicates cache failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-118 66D-118

Explanation: Adapter test indicates a cache failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-119 66D-119

Explanation: Adapter test indicates that write cache is missing.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-120 66D-120

Explanation: Adapter test indicates that cache size is invalid.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-121 66D-121

Explanation: Adapter test indicates that the cache battery is low on power.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E3A

66D-122 66D-122

Explanation: Adapter test indicates cache battery failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E3A

66D-123 **66D-123**

Explanation: ELA indicates an adapter failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
-

66D-124 **66D-124**

Explanation: Enhanced error handling failure on PCI-PCI Bridge.

Failing Item:

- FFC_221
-

66D-125 **66D-125**

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_66D
 - FFC_221
-

66D-400 **66D-400**

Explanation: The POST test indicates a channel failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
 - FFC_190
 - FFC_B3A
 - FFC_722
-

66D-701 **66D-701**

Explanation: Error Log Analysis indicates an enhanced error handling error.

Failing Item:

- FFC_66D
 - FFC_221
-

66E-100 **66E-100**

Explanation: Unable to configure the parent device.

Failing Item:

- FFC_66E
-

66E-102 **66E-102**

Explanation: SCSI command Inquiry has failed. Unable to get Additional Vital Product Data.

Failing Item:

- FFC_66E
-

66E-103 **66E-103**

Explanation: SCSI command Reserve has failed.

Failing Item:

- FFC_66E
-

66E-104 **66E-104**

Explanation: SCSI command Mode Sense has failed.

Failing Item:

- FFC_66E
-

66E-105 **66E-105**

Explanation: SCSI command Mode Select has failed.

Failing Item:

- FFC_66E
-

66E-106 **66E-106**

Explanation: SCSI command Allow Media Removal has failed.

Failing Item:

- FFC_66E
-

66E-107 **66E-107**

Explanation: SCSI command Prevent Media Removal has failed.

Failing Item:

- FFC_66E
-

66E-108 **66E-108**

Explanation: SCSI command Start Stop Unit has failed.

Failing Item:

- FFC_66E
-

66E-109 **66E-109**

Explanation: SCSI command Test Unit Ready has failed.

Failing Item:

- FFC_66E
-

66E-10A **66E-10A**

Explanation: SCSI command Send Diagnostic has failed.

Failing Item:

- FFC_66E
-

66E-10B **66E-10B**

Explanation: SCSI command Release has failed.

Failing Item:

- FFC_66E
-

66E-10F **66E-10F**

Explanation: Undetermined hardware error has occurred.

Failing Item:

- FFC_66E
-

66E-200 **66E-200**

Explanation: Unable to configure the device.

Failing Item:

- FFC_66E
 - FFC_B88
-

66E-201 **66E-201**

Explanation: DVD-RAM drive is unable to eject the tray.

Response: Verify that no external object prevents the drive from ejecting the tray. Verify that no media is stuck inside the drive. Otherwise, use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-202 **66E-202**

Explanation: DVD-RAM drive is unable to load the tray.

Response: Verify that no external object prevents the drive from loading the tray. Verify that the test medium is inserted properly in the tray.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-203 **66E-203**

Explanation: DVD-RAM drive is unable to detect the test medium.

Response: Verify that the test medium is inserted properly. Clean the drive. Run the test with another test medium. Otherwise , use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-204 **66E-204**

Explanation: A SCSI reservation conflict has occurred.

Failing Item:

- FFC_66E
 - FFC_B88
-

66E-205 **66E-205**

Explanation: The Random Write/Read/Compare Test has detected a medium error while testing the DVD-RAM test medium.

Response: Run Diagnostic on this drive with another DVD-RAM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-206 **66E-206**

Explanation: The Random Write/Read/Compare Test has detected a hardware error while testing the DVD-RAM test medium.

Response: Run Diagnostic on this drive with another DVD-RAM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_66E
 - MEDIA
-

66E-207 **66E-207**

Explanation: The Random Read Test has detected a medium error while testing the CD-ROM test medium.

Response: Run Diagnostic on this drive with another CD-ROM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-208 **66E-208**

Explanation: The Random Read Test has detected a hardware error while testing the CD-ROM test medium.

Response: Run Diagnostic on this drive with another CD-ROM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_66E
 - MEDIA
-

66E-209 **66E-209**

Explanation: DVD-RAM drive is unable to determine the media type.

Response: Verify that the proper test medium is inserted. Clean the drive. Run Diagnostic on this drive with another test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-20A **66E-20A**

Explanation: DVD-RAM drive has faulty write-protect-detection mechanism.

Response: Verify that the DVD-RAM test medium is not write-protected. Run Diagnostic on this drive with another DVD-RAM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-20B **66E-20B**

Explanation: DVD-RAM drive has detected a media error.

Response: Verify that the DVD-RAM test medium is inserted properly. Run Diagnostic on this drive with another DVD-RAM test medium. If the test fails with the new test media, replace the defective DVD-ROM drive.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-300 **66E-300**

Explanation: SCSI command timeout has occurred.

Response: Replace the defective DVD-ROM drive.

Failing Item:

- FFC_66E
 - FFC_B88
 - FFC_190
-

66E-301 **66E-301**

Explanation: Unit Attention has occurred.

Failing Item:

- FFC_B88
 - FFC_190
 - FFC_66E
-

66E-700 **66E-700**

Explanation: ELA indicates an irrecoverable hardware error.

Failing Item:

- FFC_66E
-

66E-701 **66E-701**

Explanation: ELA indicates an undetermined hardware error.

Failing Item:

- FFC_66E
-

670-102 **670-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_670
-

670-104 **670-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_670
-

670-105 **670-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_670
-

670-106 670-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_670
-

670-108 670-108

Explanation: The bus test failed.

Failing Item:

- FFC_670
-

670-110 670-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_670
-

670-112 670-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_670
-

670-114 670-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_670
-

670-116 670-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_670
-

670-117 670-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_670
-

670-118 670-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_670
- FFC_B88

670-120 670-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_670
-

670-122 670-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_670
-

670-124 670-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_670
-

670-126 670-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_670
 - FFC_B88
-

670-128 670-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_670
 - SOFTWARE
-

670-129 670-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_670
 - SOFTWARE
-

670-130 670-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_670

670-132 670-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_670
-

670-133 670-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_670
-

670-134 670-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

670-135 670-135

Explanation: The device failed to configure.

Failing Item:

- FFC_670
 - FFC_B88
 - SOFTWARE
-

670-136 670-136

Explanation: The certify operation failed.

Failing Item:

- FFC_670
-

670-137 670-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_670
 - FFC_B88
 - FFC_190
-

670-138 670-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_670
-

670-140 670-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_670
-

670-640 670-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

671-102 671-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_671
-

671-104 671-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_671
-

671-105 671-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_671
-

671-106 671-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_671
-

671-108 671-108

Explanation: The bus test failed.

Failing Item:

- FFC_671
-

671-110 671-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_671

671-112 **671-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_671
-

671-114 **671-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_671
-

671-116 **671-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_671
-

671-117 **671-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_671
-

671-118 **671-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_671
 - FFC_B88
-

671-120 **671-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_671
-

671-122 **671-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_671
-

671-124 **671-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_671
-

671-126 **671-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_671
 - FFC_B88
-

671-128 **671-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_671
 - SOFTWARE
-

671-129 **671-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_671
 - SOFTWARE
-

671-130 **671-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_671
-

671-132 **671-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_671
-

671-133 **671-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_671
-

671-134 **671-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

671-135 • 672-116

- SOFTWARE

671-135 671-135

Explanation: The device failed to configure.

Failing Item:

- FFC_671
- FFC_B88
- SOFTWARE

671-136 671-136

Explanation: The certify operation failed.

Failing Item:

- FFC_671

671-137 671-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_671
- FFC_B88
- FFC_190

671-138 671-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_671

671-140 671-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_671

671-640 671-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

672-102 672-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_672

672-104 672-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_672

672-105 672-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_672

672-106 672-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_672

672-108 672-108

Explanation: The bus test failed.

Failing Item:

- FFC_672

672-110 672-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_672

672-112 672-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_672

672-114 672-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_672

672-116 672-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_672

672-117 672-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_672

672-118 672-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_672
- FFC_B88

672-120 672-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_672

672-122 672-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_672

672-124 672-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_672

672-126 672-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_672
- FFC_B88

672-128 672-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_672
- SOFTWARE

672-129 672-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_672
- SOFTWARE

672-130 672-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_672

672-132 672-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_672

672-133 672-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_672

672-134 672-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

672-135 672-135

Explanation: The device failed to configure.

Failing Item:

- FFC_672
- FFC_B88
- SOFTWARE

672-136 672-136

Explanation: The certify operation failed.

Failing Item:

- FFC_672

 672-137 672-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_672
 - FFC_B88
 - FFC_190
-

672-138 672-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_672
-

672-140 672-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_672
-

672-640 672-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

673-102 673-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_673
-

673-104 673-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_673
-

673-105 673-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_673

 673-106 673-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_673
-

673-108 673-108

Explanation: The bus test failed.

Failing Item:

- FFC_673
-

673-110 673-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_673
-

673-112 673-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_673
-

673-114 673-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_673
-

673-116 673-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_673
-

673-117 673-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_673
-

673-118 673-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_673
- FFC_B88

673-120 673-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_673
-

673-122 673-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_673
-

673-124 673-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_673
-

673-126 673-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_673
 - FFC_B88
-

673-128 673-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_673
 - SOFTWARE
-

673-129 673-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_673
 - SOFTWARE
-

673-130 673-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_673

673-132 673-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_673
-

673-133 673-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_673
-

673-134 673-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

673-135 673-135

Explanation: The device failed to configure.

Failing Item:

- FFC_673
 - FFC_B88
 - SOFTWARE
-

673-136 673-136

Explanation: The certify operation failed.

Failing Item:

- FFC_673
-

673-137 673-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_673
 - FFC_B88
 - FFC_190
-

673-138 673-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

673-140 • 674-150

- FFC_673

673-140 673-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_673

673-640 673-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

674-101 674-101

Explanation: IBM ARTIC960Rx PCI Adapter Central Processing Unit (CPU) test failure.

Failing Item:

- FFC_674
- FFC_C94
- FFC_C95

674-102 674-102

Explanation: IBM ARTIC960Rx PCI Adapter Timer test failure.

Failing Item:

- FFC_674
- FFC_C94
- FFC_C95

674-103 674-103

Explanation: IBM ARTIC960Rx PCI Adapter Bus Interface test failure.

Failing Item:

- FFC_674
- FFC_C94
- FFC_C95

674-104 674-104

Explanation: IBM ARTIC960Rx PCI Adapter Dynamic Random Access Memory (DRAM) test failure.

Failing Item:

- FFC_C94
- FFC_674
- FFC_C95

674-105 674-105

Explanation: IBM ARTIC960Rx PCI Adapter Memory Protection test failure.

Failing Item:

- FFC_674
- FFC_C94
- FFC_C95

674-106 674-106

Explanation: IBM ARTIC960Rx PCI Adapter Debug Port test failure.

Failing Item:

- FFC_674
- FFC_C94
- FFC_C95

674-107 674-107

Explanation: Interface board wrap test failure.

Failing Item:

- FFC_C95
- FFC_674
- FFC_C97

674-110 674-110

Explanation: IBM ARTIC960Rx PCI Adapter Download Diagnostics test failure.

Failing Item:

- FFC_C94
- FFC_674
- FFC_C95

674-123 674-123

Explanation: Interface board non-wrap test failure.

Failing Item:

- FFC_C95
- FFC_C97

674-150 674-150

Explanation: Device configuration failure.

Failing Item:

- FFC_674
- SOFTWARE
- FFC_227

674-151 **674-151**

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_674
- SOFTWARE
- FFC_227

674-152 **674-152**

Explanation: Failure and error in determining which type of IBM ARTIC960Rx PCI Adapter.

Failing Item:

- FFC_674

674-153 **674-153**

Explanation: Error log analysis indicates a IBM ARTIC960Rx PCI Adapter failure. Action: Use the errpt command to check error log.

Failing Item:

- FFC_674
- FFC_227
- FFC_C94
- SOFTWARE

674-154 **674-154**

Explanation: IBM ARTIC960Rx PCI Adapter initialization failure.

Failing Item:

- FFC_C94
- FFC_674
- FFC_C95

674-155 **674-155**

Explanation: IBM ARTIC960Rx PCI Adapter initialization failure.

Failing Item:

- FFC_674
- FFC_C94
- FFC_C95

674-156 **674-156**

Explanation: IBM ARTIC960Rx PCI Adapter initialization failure.

Failing Item:

- FFC_C95
- FFC_674
- FFC_C94

674-157 **674-157**

Explanation: Cable wrap test failure.

Failing Item:

- FFC_C97
- FFC_C95

675-101 **675-101**

Explanation: IBM ARTIC960Hx Adapter Central Processing Unit (CPU) test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-102 **675-102**

Explanation: IBM ARTIC960Hx Adapter Timer test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-103 **675-103**

Explanation: IBM ARTIC960Hx Adapter Bus Interface test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-104 **675-104**

Explanation: IBM ARTIC960Hx Adapter Dynamic Random Access Memory (DRAM) test failure.

Failing Item:

- FFC_C94
- FFC_675
- FFC_C95

675-105 **675-105**

Explanation: IBM ARTIC960Hx Adapter Memory Protection test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-106 **675-106**

Explanation: IBM ARTIC960Hx Adapter Debug Port test failure.

Failing Item:

- FFC_675
 - FFC_C94
 - FFC_C95
-

675-107 **675-107**

Explanation: Interface board wrap test failure.

Failing Item:

- FFC_C95
 - FFC_675
 - FFC_C97
-

675-110 **675-110**

Explanation: IBM ARTIC960Hx Adapter Download Diagnostics test failure.

Failing Item:

- FFC_C94
 - FFC_675
 - FFC_C95
-

675-123 **675-123**

Explanation: Interface board non-wrap test failure.

Failing Item:

- FFC_C95
 - FFC_675
 - FFC_C94
-

675-150 **675-150**

Explanation: Device configuration failure.

Failing Item:

- FFC_675
 - SOFTWARE
 - FFC_227
-

675-151 **675-151**

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_675
 - SOFTWARE
 - FFC_227
-

675-152 **675-152**

Explanation: Failure and error in determining which type of IBM ARTIC960Hx Adapter.

Failing Item:

- FFC_675
-

675-153 **675-153**

Explanation: Error log analysis indicates a IBM ARTIC960Hx Adapter failure.

Response: Use the errprt command to check error log.

Failing Item:

- FFC_675
 - FFC_227
 - FFC_C94
 - SOFTWARE
-

675-154 **675-154**

Explanation: IBM ARTIC960Hx Adapter initialization failure.

Failing Item:

- FFC_C94
 - FFC_675
 - FFC_C95
-

675-155 **675-155**

Explanation: IBM ARTIC960Hx Adapter initialization failure.

Failing Item:

- FFC_675
 - FFC_C94
 - FFC_C95
-

675-156 **675-156**

Explanation: IBM ARTIC960Hx Adapter initialization failure.

Failing Item:

- FFC_C95
 - FFC_675
 - FFC_C94
-

675-157 **675-157**

Explanation: Cable wrap test failure.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_C98

- FFC_C97
- FFC_C95

677-101 677-101

Explanation: The Fibre Channel Adapter configuration failed.

Failing Item:

- FFC_677

677-102 677-102

Explanation: The Reset test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677

677-103 677-103

Explanation: The Register test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677

677-104 677-104

Explanation: The SRAM test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677

677-105 677-105

Explanation: The Internal Wrap test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677

677-106 677-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_677

677-107 677-107

Explanation: The External Wrap test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677

677-109 677-109

Explanation: Enhanced Error Handling Failure on EADs chip.

Failing Item:

- FFC_221

677-110 677-110

Explanation: Enhanced Error Handling Failure on adapter.

Failing Item:

- FFC_677

677-201 677-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_677
- FFC_221

677-202 677-202

Explanation: The Interrupt test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
- FFC_221

677-203 677-203

Explanation: The PCI Wrap test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
- FFC_221

677-204 677-204

Explanation: The DMA test failed.

Response: Use the MAP0210 : General problem resolution.

677-205 • 678-107

Failing Item:

- FFC_677
- FFC_221

677-205 677-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_677
- FFC_221

677-701 677-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_677
- FFC_221

677-703 677-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_677

677-704 677-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_677

677-705 677-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_677

677-706 677-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_677

678-098 678-098

Explanation: Tape drive indicates an error.

Failing Item:

- FFC_678

678-099 678-099

Explanation: Tape drive not found.

Failing Item:

- FFC_678
- FFC_B88

678-101 678-101

Explanation: Timeout while attempting to communicate with SCSI device.

Failing Item:

- FFC_678

678-102 678-102

Explanation: The SCSI device indicates busy.

Failing Item:

- FFC_678

678-103 678-103

Explanation: The SCSI device indicates a reservation conflict.

Failing Item:

- FFC_678

678-104 678-104

Explanation: The SCSI device indicates a check condition.

Failing Item:

- FFC_678

678-105 678-105

Explanation: An error is detected in request sense data.

Failing Item:

- FFC_678

678-107 678-107

Explanation: Sense data from the SCSI drive has unexpected data.

Failing Item:

- FFC_678

678-110 678-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_678
-

678-111 678-111

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_678
-

678-112 678-112

Explanation: The write-protect sensor test failed.

Failing Item:

- FFC_678
-

678-113 678-113

Explanation: Invalid condition from drive after a request sense.

Failing Item:

- FFC_678
-

678-114 678-114

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_678
-

678-120 678-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_678
-

678-130 678-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-131 678-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-134 678-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

678-135 678-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-136 678-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-140 678-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_678
-

678-150 **678-150**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-151 **678-151**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-160 **678-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-161 **678-161**

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_678
 - FFC_B88
-

678-163 **678-163**

Explanation: Invalid condition from the drive after a request sense.

Failing Item:

- FFC_678
 - FFC_B88
-

678-164 **678-164**

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_678
 - FFC_B88
-

678-165 **678-165**

Explanation: Write, Read and Compare Test failed.

Failing Item:

- FFC_678
 - FFC_B88
 - FFC_276
-

678-166 **678-166**

Explanation: Unable to configure the device.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-167 **678-167**

Explanation: An unexpected SCSI error occurred.

Failing Item:

- FFC_678
 - FFC_B88
-

678-168 **678-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-169 **678-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678

- MEDIA

678-16L 678-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-170 678-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- FFC_B88
- MEDIA

678-171 678-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678
- FFC_B88

678-180 678-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-181 678-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-185 678-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-186 678-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-190 678-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_678

678-200 678-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-201 **678-201**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-210 **678-210**

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-211 **678-211**

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-261 **678-261**

Explanation: The device open failed.

Failing Item:

- FFC_678
-

678-300 **678-300**

Explanation: The device configuration failed.

Failing Item:

- FFC_678
 - SOFTWARE
-

678-310 **678-310**

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_678
 - SOFTWARE
-

678-320 **678-320**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-321 **678-321**

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-411 **678-411**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-412 **678-412**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-413 **678-413****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-414 **678-414****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-415 **678-415****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-416 **678-416****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-417 **678-417****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-418 **678-418****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-419 **678-419****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-41A **678-41A****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-41B **678-41B****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-41C **678-41C****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-41D **678-41D****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-41E **678-41E****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-41F 678-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-420 678-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-421 678-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-422 678-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-423 678-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-511 678-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-512 678-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-513 678-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-514 678-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-515 678-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-516 678-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-517 678-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-518 678-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-519 **678-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-51A **678-51A**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-51B **678-51B**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-51C **678-51C**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-51D **678-51D**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-51E **678-51E**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-51F **678-51F**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-520 **678-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-521 **678-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-522 **678-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-523 **678-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-611 **678-611**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-612 **678-612**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678

678-613 • 678-61E

- FFC_B88
- SOFTWARE

678-613 678-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-614 678-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-615 678-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-616 678-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-617 678-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-618 678-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-619 678-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61A 678-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61B 678-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61C 678-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61D 678-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61E 678-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-61F **678-61F****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-620 **678-620****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-621 **678-621****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-622 **678-622****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-623 **678-623****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-711 **678-711****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-712 **678-712****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-713 **678-713****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-714 **678-714****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-715 **678-715****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-716 **678-716****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-717 **678-717****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-718 678-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-719 678-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71A 678-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71B 678-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71C 678-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71D 678-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71E 678-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71F 678-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-720 678-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-721 678-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-722 678-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-723 678-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

679-102 679-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_679
-

679-104 679-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_679
-

679-105 679-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_679
-

679-106 679-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_679
-

679-108 679-108

Explanation: The bus test failed.

Failing Item:

- FFC_679
-

679-110 679-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_679
-

679-112 679-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_679
-

679-114 679-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_679
-

679-116 679-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_679
-

679-117 679-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_679
-

679-118 679-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_679
 - FFC_B88
-

679-120 679-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_679
-

679-122 679-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_679
-

679-124 679-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_679
-

679-126 679-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_679
 - FFC_B88
-

679-128 679-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_679
- SOFTWARE

679-129 **679-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_679
 - SOFTWARE
-

679-130 **679-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_679
-

679-132 **679-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_679
-

679-133 **679-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_679
-

679-134 **679-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

679-135 **679-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_679
 - FFC_B88
 - SOFTWARE
-

679-136 **679-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_679
-

679-137 **679-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_679
 - FFC_B88
 - FFC_190
-

679-138 **679-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_679
-

679-140 **679-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_679
-

679-640 **679-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

67B-100 **67B-100**

Explanation: POST failed: Catastrophic error detected.

Failing Item:

- FFC_67B
-

67B-601 **67B-601**

Explanation: ELA indicates a low battery warning.

Failing Item:

- FFC_11A
-

67B-602 **67B-602**

Explanation: ELA indicates a mesh violation - tamper.

Failing Item:

- FFC_67B
-

67B-603 **67B-603**

Explanation: ELA indicates the coprocessor is held in a reset condition.

Failing Item:

- FFC_67B
-

67B-604 **67B-604**

Explanation: ELA indicates a +3, +5, or +12 V over-voltage condition.

Failing Item:

- FFC_67B
-

67B-605 **67B-605**

Explanation: ELA indicates an out-of-temperature specification.

Failing Item:

- FFC_67B
-

67B-606 **67B-606**

Explanation: ELA indicates a X-ray or dead battery condition.

Failing Item:

- FFC_67B
-

67B-607 **67B-607**

Explanation: ELA indicates: Intrusion latch.

Failing Item:

- FFC_67B
-

67E-001 **67E-001**

Explanation: Adapter problem.

Failing Item:

- FFC_67E
 - FFC_221
 - MONITOR
 - CABLE
-

67E-002 **67E-002**

Explanation: Display problem.

Failing Item:

- FFC_67E
 - MONITOR
 - CABLE
-

67E-003 **67E-003**

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_67E
-

67E-004 **67E-004**

Explanation: The monitor test failed.

Failing Item:

- FFC_67E
 - MONITOR
 - CABLE
-

681-102 **681-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_681
-

681-104 **681-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_681
-

681-105 **681-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_681
-

681-106 **681-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_681
-

681-108 **681-108**

Explanation: The bus test failed.

Failing Item:

- FFC_681
-

681-110 **681-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_681
-

681-112 681-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_681
-

681-114 681-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_681
-

681-116 681-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_681
-

681-117 681-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_681
-

681-118 681-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_681
 - FFC_B88
-

681-120 681-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_681
-

681-122 681-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_681
-

681-124 681-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_681
-

681-126 681-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_681
 - FFC_B88
-

681-128 681-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_681
 - SOFTWARE
-

681-129 681-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_681
 - SOFTWARE
-

681-130 681-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_681
-

681-132 681-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_681
-

681-133 681-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_681
-

681-134 681-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

681-135 681-135

Explanation: The device failed to configure.

Failing Item:

- FFC_681
 - FFC_B88
 - SOFTWARE
-

681-136 681-136

Explanation: The certify operation failed.

Failing Item:

- FFC_681
-

681-137 681-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_681
 - FFC_B88
 - FFC_190
-

681-138 681-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_681
-

681-140 681-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_681
-

681-640 681-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

683-128 683-128

Explanation: Error Log Analysis Indicates hardware failure VSS2105 Model B09.

Failing Item:

- FFC_683
-

686-114 686-114

Explanation: The register verification test failed.

Failing Item:

- FFC_686
-

686-124 686-124

Explanation: The adapter RAM verification test failed.

Failing Item:

- FFC_686
-

686-152 686-152

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_686
 - FFC_D57
-

686-153 686-153

Explanation: The modem control line test failed.

Failing Item:

- FFC_686
-

686-252 686-252

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_686
-

686-253 686-253

Explanation: The modem control line test failed.

Failing Item:

- FFC_686
-

686-501 686-501

Explanation: Adapter Reset failed

Failing Item:

- FFC_686
-

686-511 **686-511**

Explanation: Adapter to host memory test failed (byte tag test).

Failing Item:

- FFC_686
-

686-512 **686-512**

Explanation: Adapter to host memory test failed (word tag test).

Failing Item:

- FFC_686
-

686-513 **686-513**

Explanation: Adapter to host memory test failed (byte pattern test).

Failing Item:

- FFC_686
-

686-514 **686-514**

Explanation: Adapter to host memory test failed (word pattern test).

Failing Item:

- FFC_686
-

686-521 **686-521**

Explanation: Adapter BIOS POST CPU failed.

Failing Item:

- FFC_686
-

686-522 **686-522**

Explanation: Adapter BIOS POST Checksum failed.

Failing Item:

- FFC_686
-

686-523 **686-523**

Explanation: Adapter BIOS POST Timer failed.

Failing Item:

- FFC_686
-

686-524 **686-524**

Explanation: Adapter BIOS POST RAM failed.

Failing Item:

- FFC_686
-

686-526 **686-526**

Explanation: Adapter BIOS POST Async Ports failed.

Failing Item:

- FFC_686
-

686-527 **686-527**

Explanation: Adapter BIOS test failed.

Failing Item:

- FFC_686
-

686-528 **686-528**

Explanation: Adapter BIOS Reset failed.

Failing Item:

- FFC_686
-

686-529 **686-529**

Explanation: Adapter BIOS Download failed.

Failing Item:

- FFC_686
-

686-531 **686-531**

Explanation: Adapter BIOS Command failed.

Failing Item:

- FFC_686
-

686-533 **686-533**

Explanation: Adapter BIOS Timer test failed.

Failing Item:

- FFC_686
-

686-534 **686-534**

Explanation: Adapter BIOS RAM test failed.

Failing Item:

- FFC_686
-

686-541 **686-541**

Explanation: Port async internal loopback test failed (general).

Failing Item:

- FFC_686
-

686-542 **686-542**

Explanation: Port async internal loopback test failed (no response from the port).

Failing Item:

- FFC_686
-

686-551 **686-551**

Explanation: Port async external loopback test failed (general).

Failing Item:

- FFC_686
-

686-552 **686-552**

Explanation: Port async external loopback test failed (data signals).

Failing Item:

- FFC_686
-

686-553 **686-553**

Explanation: Port async external loopback test failed (control signals).

Failing Item:

- FFC_686
-

686-554 **686-554**

Explanation: Port async external loopback test failed (modem signals).

Failing Item:

- FFC_686
-

686-555 **686-555**

Explanation: Port async external loopback test failed (no response from port).

Failing Item:

- FFC_686
-

686-901 **686-901**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-902 **686-902**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-903 **686-903**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-904 **686-904**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-905 **686-905**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-906 **686-906**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-907 **686-907**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-908 **686-908**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-909 **686-909**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-910 **686-910**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-911 **686-911**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-912 **686-912**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-913 **686-913**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-914 **686-914**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-915 **686-915**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-916 **686-916**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-917 **686-917**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-918 **686-918**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-919 **686-919**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-920 **686-920**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-921 **686-921**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_686
 - SOFTWARE
-

686-922 **686-922**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a

network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-923 686-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-924 686-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-925 686-925

Explanation: The adapter failed to configure software

Failing Item:

- FFC_686

686-926 686-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-927 686-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-928 686-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-929 686-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-930 686-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-931 **686-931**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-932 **686-932**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-933 **686-933**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-934 **686-934**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-935 **686-935**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-936 **686-936**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-937 **686-937**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-938 **686-938**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-939 **686-939**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-940 **686-940**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-941 **686-941**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-942 **686-942**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-943 **686-943**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-944 **686-944**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-945 **686-945**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-946 **686-946**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-947 686-947

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-948 686-948

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-949 686-949

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-950 686-950

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

687-111 687-111

Explanation: The controller register test failed.

Failing Item:

- FFC_687
-

687-114 687-114

Explanation: The register verification test failed.

Failing Item:

- FFC_687
-

687-124 687-124

Explanation: The adapter RAM verification test failed.

Failing Item:

- FFC_687
-

687-144 687-144

Explanation: The sync line test failed.

Failing Item:

- FFC_687
-

687-152 687-152

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_837
 - FFC_684
 - FFC_687
 - FFC_152
-

687-153 687-153

Explanation: The modem control line test failed.

Failing Item:

- FFC_687
-

687-244 687-244

Explanation: The sync line test failed.

Failing Item:

- FFC_687
-

687-252 687-252

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_687
-

687-253 687-253
Explanation: The modem control line test failed.
Failing Item:
 • FFC_687

687-501 687-501
Explanation: Adapter Reset failed.
Failing Item:
 • FFC_687

687-502 687-502
Explanation: Adapter Fuse failed.
Failing Item:
 • FFC_687

687-511 687-511
Explanation: Adapter to host memory test failed (byte tag test).
Failing Item:
 • FFC_687

687-512 687-512
Explanation: Adapter to host memory test failed (word tag test).
Failing Item:
 • FFC_687

687-513 687-513
Explanation: Adapter to host memory test failed (byte pattern test).
Failing Item:
 • FFC_687

687-514 687-514
Explanation: Adapter to host memory test failed (word pattern test).
Failing Item:
 • FFC_687

687-521 687-521
Explanation: Adapter BIOS POST CPU failed.
Failing Item:
 • FFC_687

687-522 687-522
Explanation: Adapter BIOS POST Checksum failed.
Failing Item:
 • FFC_687

687-523 687-523
Explanation: Adapter BIOS POST Timer failed.
Failing Item:
 • FFC_687

687-524 687-524
Explanation: Adapter BIOS POST RAM failed.
Failing Item:
 • FFC_687

687-525 687-525
Explanation: Adapter BIOS POST Sync Line failed.
Failing Item:
 • FFC_687

687-527 687-527
Explanation: Adapter BIOS test failed.
Failing Item:
 • FFC_687

687-528 687-528
Explanation: Adapter BIOS Reset failed.
Failing Item:
 • FFC_687

687-529 687-529
Explanation: Adapter BIOS Download failed.
Failing Item:
 • FFC_687

687-531 687-531
Explanation: Adapter BIOS Command failed.
Failing Item:
 • FFC_687

687-533 687-533
Explanation: Adapter BIOS Timer test failed.
Failing Item:
 • FFC_687

687-534 687-534

Explanation: Adapter BIOS RAM test failed.

Failing Item:

- FFC_687
-

687-541 687-541

Explanation: Port sync internal loopback test failed.

Failing Item:

- FFC_687
-

687-551 687-551

Explanation: Port sync external loopback test failed.

Failing Item:

- FFC_687
-

687-600 687-600

Explanation: 232RAN status test failed.

Failing Item:

- FFC_837
-

687-700 687-700

Explanation: 422RAN status test failed.

Failing Item:

- FFC_684
-

687-901 687-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-902 687-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-903 687-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-904 687-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-905 687-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-906 687-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-907 687-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-908 687-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-909 687-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-910 687-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-911 687-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-912 687-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-913 687-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-914 687-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-915 **687-915**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-916 **687-916**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-917 **687-917**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-918 **687-918**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-919 **687-919**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-920 **687-920**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-921 **687-921**

Explanation: The adapter failed to configure.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-922 **687-922**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-923 **687-923**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a

network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-924 687-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-925 687-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_687
- SOFTWARE

687-926 687-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-927 687-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-928 687-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-929 687-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-930 687-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-931 687-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_687

687-932 687-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-933 687-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-934 687-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-935 687-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-936 687-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-937 687-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-938 687-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-939 687-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-940 687-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-941 687-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-942 687-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-943 687-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General

problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-944 687-944

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-945 687-945

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-946 687-946

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-947 687-947

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-948 687-948

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-949 687-949

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-950 687-950

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

689-102 689-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_689

689-104 689-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_689

689-105 689-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_689

689-106 689-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_689

689-108 689-108

Explanation: The bus test failed.

Failing Item:

- FFC_689

689-110 689-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_689

689-112 689-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_689

689-114 689-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_689

689-116 689-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_689

689-117 689-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_689

689-118 689-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_689
- FFC_B88

689-120 689-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_689

689-122 689-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_689

689-124 689-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_689

689-126 689-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_689
- FFC_B88

689-128 689-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_689
- SOFTWARE

689-129 689-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_689
- SOFTWARE

689-130 689-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_689

689-132 689-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_689

689-133 689-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_689

689-134 689-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

689-135 689-135

Explanation: The device failed to configure.

Failing Item:

- FFC_689
- FFC_B88
- SOFTWARE

689-136 689-136

Explanation: The certify operation failed.

Failing Item:

- FFC_689

689-137 689-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_689
 - FFC_B88
 - FFC_190
-

689-138 689-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_689
-

689-140 689-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_689
-

689-640 689-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

68C-101 68C-101

Explanation: Timeout while attempting to communicate with SCSI device.

Failing Item:

- FFC_68C
-

68C-102 68C-102

Explanation: The SCSI device indicates busy.

Failing Item:

- FFC_68C
-

68C-103 68C-103

Explanation: The SCSI device indicates a reservation conflict.

Failing Item:

- FFC_68C
-

68C-104 68C-104

Explanation: The SCSI device indicates a check condition.

Failing Item:

- FFC_68C
-

68C-105 68C-105

Explanation: An error is detected in request sense data.

Failing Item:

- FFC_68C
-

68C-107 68C-107

Explanation: Sense data from the SCSI drive has unexpected data.

Failing Item:

- FFC_68C
-

68C-110 68C-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_68C
-

68C-111 68C-111

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_68C
-

68C-112 68C-112

Explanation: The write-protect sensor test failed.

Failing Item:

- FFC_68C
-

68C-113 68C-113

Explanation: Invalid condition from drive after a request sense.

Failing Item:

- FFC_68C
-

68C-114 68C-114

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_68C
-

68C-120 68C-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_68C
-

68C-130 68C-130

Explanation: The Load command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-134 68C-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

68C-135 68C-135

Explanation: The Unload command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-140 68C-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_68C
-

68C-150 68C-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-160 68C-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-161 68C-161

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-163 68C-163

Explanation: Invalid condition from the drive after a request sense.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-164 68C-164

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-165 68C-165

Explanation: Write, Read and Compare Test failed.

Failing Item:

- FFC_68C
 - FFC_B88
 - FFC_276
-

68C-166 68C-166

Explanation: Unable to configure the device.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-167 68C-167

Explanation: An unexpected SCSI error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-168 68C-168

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

68C-169 68C-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-170 68C-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_68C
 - FFC_B88
 - MEDIA
-

68C-180 68C-180

Explanation: The Load command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-185 68C-185

Explanation: The Unload command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-190 68C-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_68C
-

68C-200 68C-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-201 68C-201

Explanation: Error diagnosed from error log analysis.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-210 68C-210

Explanation: The device configuration failed.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-211 68C-211

Explanation: The device open failed.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-220 68C-220

Explanation: The Release command failed.

Failing Item:

- FFC_68C
-

68C-230 68C-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_68C
-

68C-240 68C-240

Explanation: The Openx command failed.

Failing Item:

- FFC_68C
-

68C-260 68C-260

Explanation: The device configuration failed.

Failing Item:

- FFC_68C
-

68C-261 68C-261

Explanation: The device open failed.

Failing Item:

- FFC_68C
-

68C-300 68C-300

Explanation: The device configuration failed.

Failing Item:

- FFC_68C
- SOFTWARE

68C-310 68C-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_68C
- SOFTWARE

68C-320 68C-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_68C
- MEDIA

68C-411 68C-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-412 68C-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-413 68C-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-414 68C-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88

- SOFTWARE

68C-415 68C-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-416 68C-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-417 68C-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-418 68C-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-419 68C-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-420 68C-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-421 **68C-421**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-422 **68C-422**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-423 **68C-423**

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-511 **68C-511**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-512 **68C-512**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-513 **68C-513**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-514 **68C-514**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-515 **68C-515**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-516 **68C-516**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-517 **68C-517**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-518 **68C-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-519 **68C-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-520 **68C-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

68C-521 • 68C-619

- FFC_68C
- FFC_B88

68C-521 68C-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-522 68C-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-523 68C-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-611 68C-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-612 68C-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-613 68C-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-614 68C-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-615 68C-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-616 68C-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-617 68C-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-618 68C-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-619 68C-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-620 **68C-620**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-621 **68C-621**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-622 **68C-622**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-623 **68C-623**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-711 **68C-711**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-712 **68C-712**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-713 **68C-713**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-714 **68C-714**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-715 **68C-715**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-716 **68C-716**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-717 **68C-717**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-718 **68C-718**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-719 68C-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-720 68C-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-721 68C-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-722 68C-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-723 68C-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68E-001 68E-001

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_68E

68E-002 68E-002

Explanation: Adapter failure.

Failing Item:

- FFC_68E

• SOFTWARE

68E-003 68E-003

Explanation: Adapter failure.

Failing Item:

- FFC_68E
- FFC_227

68E-004 68E-004

Explanation: Display failure.

Failing Item:

- FFC_68E
- MONITOR
- CABLE

68E-005 68E-005

Explanation: Adapter failure.

Failing Item:

- FFC_68E
- FFC_227
- MONITOR
- CABLE

690-102 690-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_690

690-104 690-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_690

690-105 690-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_690

690-106 690-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_690

690-108 690-108

Explanation: The bus test failed.

Failing Item:

- FFC_690
-

690-110 690-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_690
-

690-112 690-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_690
-

690-114 690-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_690
-

690-116 690-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_690
-

690-117 690-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_690
-

690-118 690-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_690
 - FFC_B88
-

690-120 690-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_690
-

690-122 690-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_690
-

690-124 690-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_690
-

690-126 690-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_690
 - FFC_B88
-

690-128 690-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_690
 - SOFTWARE
-

690-129 690-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_690
 - SOFTWARE
-

690-130 690-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_690
-

690-132 690-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_690
-

690-133 690-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_690
-

690-134 690-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

690-135 690-135

Explanation: The device failed to configure.

Failing Item:

- FFC_690
 - FFC_B88
 - SOFTWARE
-

690-136 690-136

Explanation: The certify operation failed.

Failing Item:

- FFC_690
-

690-137 690-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_690
 - FFC_B88
 - FFC_190
-

690-138 690-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_690
-

690-140 690-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_690
-

690-640 690-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

692-110 692-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_692
-

692-120 692-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_692
-

692-130 692-130

Explanation: The Load command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-135 692-135

Explanation: The Unload command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-140 692-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_692
-

692-150 692-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_692
- MEDIA

692-160 692-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-169 692-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-170 692-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_692
 - FFC_B88
 - MEDIA
-

692-180 692-180

Explanation: The Load command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-185 692-185

Explanation: The Unload command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-190 692-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_692
-

692-200 692-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-210 692-210

Explanation: The device configuration failed.

Failing Item:

- FFC_692
 - FFC_B88
-

692-220 692-220

Explanation: The Release command failed.

Failing Item:

- FFC_692
-

692-230 692-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_692
-

692-240 692-240

Explanation: The Openx command failed.

Failing Item:

- FFC_692
-

692-300 692-300

Explanation: The device configuration failed.

Failing Item:

- FFC_692
 - SOFTWARE
-

692-310 692-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_692
 - SOFTWARE
-

692-320 692-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_692
 - MEDIA
-

692-411 692-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
-

692-412 • 692-423

- FFC_B88
- SOFTWARE

692-412 692-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-413 692-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-414 692-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-415 692-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-416 692-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-417 692-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-418 692-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-419 692-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-420 692-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-421 692-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-422 692-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-423 692-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-511 **692-511**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-512 **692-512**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-513 **692-513**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-514 **692-514**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-515 **692-515**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-516 **692-516**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-517 **692-517**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-518 **692-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-519 **692-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-520 **692-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-521 **692-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-522 **692-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-523 **692-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-611 692-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-612 692-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-613 692-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-614 692-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-615 692-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-616 692-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-617 692-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-618 692-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-619 692-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-620 692-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-621 692-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-622 692-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-623 **692-623****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-711 **692-711****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-712 **692-712****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-713 **692-713****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-714 **692-714****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-715 **692-715****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-716 **692-716****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-717 **692-717****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-718 **692-718****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-719 **692-719****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-720 **692-720****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-721 **692-721****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-722 **692-722**
Explanation: A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-723 **692-723****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_692
 - FFC_B88
 - SOFTWARE
-

693-100 **693-100****Explanation:** Adapter open failed.**Failing Item:**

- FFC_693
 - FFC_227
-

693-101 **693-101****Explanation:** Adapter config register test failed.**Failing Item:**

- FFC_693
 - FFC_227
-

693-102 **693-102****Explanation:** Adapter reset failed.**Failing Item:**

- FFC_693
 - FFC_227
-

693-103 **693-103****Explanation:** Adapter I/O register test failed.**Failing Item:**

- FFC_693
 - FFC_227
-

693-104 **693-104****Explanation:** Adapter microcode download test failed.**Failing Item:**

- FFC_693
 - FFC_227
-

693-105 **693-105****Explanation:** Adapter internal wrap test failed.**Failing Item:**

- FFC_693
 - FFC_227
-

693-106 **693-106****Explanation:** Adapter close failed.**Failing Item:**

- FFC_693
 - FFC_227
-

697-100 **697-100****Explanation:** Charm memory write failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-101 **697-101****Explanation:** Charm memory read failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-102 **697-102****Explanation:** PCI configuration register write failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-103 **697-103****Explanation:** Charm software reset failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-104 **697-104****Explanation:** Packet memory error.**Failing Item:**

- FFC_697
 - SOFTWARE
-

- FFC_227

697-105 **697-105**

Explanation: Control memory failure.

Failing Item:

- FFC_697
- SOFTWARE
- FFC_227

697-106 **697-106**

Explanation: Link-R detected bad parity.

Failing Item:

- FFC_697

697-107 **697-107**

Explanation: Suni detected bad parity.

Failing Item:

- FFC_697

697-108 **697-108**

Explanation: Suni initialization failure.

Failing Item:

- FFC_697

697-109 **697-109**

Explanation: Loss of light detected in Link test.
Action: Check wrap plug installation.

Failing Item:

- WRAP_PLUG
- FFC_697

697-10B **697-10B**

Explanation: External Loopback failed Action: Check wrap plug installation.

Failing Item:

- WRAP_PLUG
- FFC_697

697-10C **697-10C**

Explanation: Internal Loopback failed.

Failing Item:

- FFC_697
- SOFTWARE
- FFC_227

697-10D **697-10D**

Explanation: DMS failed.

Failing Item:

- FFC_697
- FFC_227
- SOFTWARE

697-121 **697-121**

Explanation: Adapter memory test failure.

Failing Item:

- FFC_697

697-122 **697-122**

Explanation: Adapter checksum failure.

Failing Item:

- FFC_697

697-123 **697-123**

Explanation: Internal wrap test failure

Failing Item:

- FFC_697

697-124 **697-124**

Explanation: External wrap test failure

Failing Item:

- FFC_697

697-125 **697-125**

Explanation: Enhanced Error Handling failure on bus

Failing Item:

- FFC_221

697-126 **697-126**

Explanation: Enhanced Error Handling failure on EADS chip

Failing Item:

- FFC_221

697-127 **697-127**

Explanation: Enhanced Error Handling failure on adapter

Failing Item:

- FFC_697

697-1FF **697-1FF**
Explanation: EPROM checksum failed**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-200 **697-200****Explanation:** Klog error**Failing Item:**

- SOFTWARE
 - FFC_697
 - FFC_227
-

697-201 **697-201****Explanation:** ASL error**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- SOFTWARE
 - FFC_697
 - FFC_227
-

697-202 **697-202****Explanation:** ODM Initialization error**Failing Item:**

- SOFTWARE
 - FFC_697
 - FFC_227
-

697-203 **697-203****Explanation:** Diagnostic configuration failure.**Failing Item:**

- SOFTWARE
 - FFC_697
 - FFC_227
-

697-205 **697-205****Explanation:** Error in diag open.**Failing Item:**

- SOFTWARE
 - FFC_697
 - FFC_227
-

697-206 **697-206****Explanation:** Error in releasing adapter**Failing Item:**

- SOFTWARE
 - FFC_697
 - FFC_227
-

697-221 **697-221****Explanation:** Hardware failure opening the adapter**Failing Item:**

- FFC_697
 - FFC_221
-

697-222 **697-222****Explanation:** Enhanced Error Handling failure opening the adapter**Failing Item:**

- FFC_697
 - FFC_221
-

697-223 **697-223****Explanation:** Interrupt test failure**Failing Item:**

- FFC_697
 - FFC_221
-

697-224 **697-224****Explanation:** Adapter DMA test failure**Failing Item:**

- FFC_697
 - FFC_221
-

697-701 **697-701****Explanation:** Error Log Analysis indicates an I/O failure on the adapter.**Failing Item:**

- FFC_697
 - FFC_221
-

697-702 **697-702****Explanation:** Error Log Analysis indicates an unrecovered interrupt error.**Failing Item:**

- FFC_697
-

698-100 698-100

Explanation: Charm memory write failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-101 698-101

Explanation: Charm memory read failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-102 698-102

Explanation: PCI configuration register write failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-103 698-103

Explanation: Charm software reset failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-104 698-104

Explanation: Packet memory error

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-105 698-105

Explanation: Control memory failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-106 698-106

Explanation: Link-R detected bad parity.

Failing Item:

- FFC_698
-

698-107 698-107

Explanation: Suni detected bad parity.

Failing Item:

- FFC_698
-

698-108 698-108

Explanation: Suni initialization failure.

Failing Item:

- FFC_698
-

698-109 698-109

Explanation: Loss of light detected in Link test.
Action: Check wrap plug installation.

Failing Item:

- WRAP_PLUG
 - FFC_698
-

698-10B 698-10B

Explanation: External Loopback failed Action: Check wrap plug installation.

Failing Item:

- WRAP_PLUG
 - FFC_698
-

698-10C 698-10C

Explanation: Internal Loopback failed.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-10D 698-10D

Explanation: DMS failed.

Failing Item:

- FFC_698
 - FFC_227
 - SOFTWARE
-

698-121 698-121

Explanation: Adapter memory test failure.

Failing Item:

- FFC_698
-

698-122 698-122

Explanation: Adapter checksum failure.

Failing Item:

- FFC_698
-

698-123 698-123

Explanation: Internal wrap test failure.

Failing Item:

- FFC_698
-

698-124 698-124

Explanation: External wrap test failure.

Failing Item:

- FFC_698
-

698-125 698-125

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221
-

698-126 698-126

Explanation: Enhanced Error Handling failure on EADS chip.

Failing Item:

- FFC_221
-

698-127 698-127

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_698
-

698-1FF 698-1FF

Explanation: EPROM checksum failed.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-200 698-200

Explanation: Klog error.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-201 698-201

Explanation: ASL error.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-202 698-202

Explanation: ODM Initialization error.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-203 698-203

Explanation: Diagnostic configuration failure.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-205 698-205

Explanation: Error in diag open.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-206 698-206

Explanation: Error in releasing adapter.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-221 698-221

Explanation: Hardware failure opening the adapter.

Failing Item:

- FFC_698
 - FFC_221
-

698-222 698-222

Explanation: Enhanced Error Handling failure opening the adapter.

Failing Item:

- FFC_698
 - FFC_221
-

698-223 698-223

Explanation: Interrupt test failure.

Failing Item:

- FFC_698
 - FFC_221
-

698-224 698-224

Explanation: Adapter DMA test failure.

Failing Item:

- FFC_698
 - FFC_221
-

698-701 698-701

Explanation: Error Log Analysis indicates an I/O failure on the adapter.

Failing Item:

- FFC_698
 - FFC_221
-

698-702 698-702

Explanation: Error Log Analysis indicates an unrecovered interrupt error.

Failing Item:

- FFC_698
-

69B-101 69B-101

Explanation: EPROM test failure.

Failing Item:

- FFC_69B
-

69B-102 69B-102

Explanation: Adapter SDRAM failure.

Failing Item:

- FFC_69B
-

69B-103 69B-103

Explanation: Adapter checksum failure.

Failing Item:

- FFC_69B
-

69B-104 69B-104

Explanation: Adapter memory test failure.

Failing Item:

- FFC_69B
-

69B-105 69B-105

Explanation: Adapter buffer test failure.

Failing Item:

- FFC_69B
-

69B-106 69B-106

Explanation: Adapter cache test failure.

Failing Item:

- FFC_69B
-

69B-107 69B-107

Explanation: Internal loopback test failure.

Failing Item:

- FFC_69B
-

69B-108 69B-108

Explanation: External wrap test failure.

Failing Item:

- FFC_69B
-

69B-109 69B-109

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221
-

69B-110 69B-110

Explanation: Enhanced Error Handling failure on Eads chip.

Failing Item:

69B-111 • 69D-110

- FFC_221

69B-111 69B-111

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_69B

69B-201 69B-201

Explanation: Hardware failure opening adapter.

Failing Item:

- FFC_69B
- FFC_221

69B-202 69B-202

Explanation: Interrupt test failure.

Failing Item:

- FFC_69B
- FFC_221

69B-203 69B-203

Explanation: Adapter DMA test failure.

Failing Item:

- FFC_69B
- FFC_221

69B-204 69B-204

Explanation: Enhanced error handling failure opening the adapter.

Failing Item:

- FFC_69B
- FFC_221

69B-701 69B-701

Explanation: Error Log Analysis indicates an I/O failure on the adapter.

Failing Item:

- FFC_69B

69D-101 69D-101

Explanation: EPROM test failure.

Failing Item:

- FFC_69D

69D-102 69D-102

Explanation: Adapter SDRAM failure.

Failing Item:

- FFC_69D

69D-103 69D-103

Explanation: Adapter checksum failure.

Failing Item:

- FFC_69D

69D-104 69D-104

Explanation: Adapter memory test failure.

Failing Item:

- FFC_69D

69D-105 69D-105

Explanation: Adapter buffer test failure.

Failing Item:

- FFC_69D

69D-106 69D-106

Explanation: Adapter cache test failure.

Failing Item:

- FFC_69D

69D-107 69D-107

Explanation: Internal loopback test failure.

Failing Item:

- FFC_69D

69D-108 69D-108

Explanation: External wrap test failure.

Failing Item:

- FFC_69D

69D-109 69D-109

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221

69D-110 69D-110

Explanation: Enhanced Error Handling failure on Eads chip.

Failing Item:

- FFC_221

69D-111 69D-111

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_69D

69D-201 69D-201

Explanation: Hardware failure opening adapter.

Failing Item:

- FFC_69D
- FFC_221

69D-202 69D-202

Explanation: Interrupt test failure.

Failing Item:

- FFC_69D
- FFC_221

69D-203 69D-203

Explanation: Adapter DMA test failure.

Failing Item:

- FFC_69D
- FFC_221

69D-204 69D-204

Explanation: Enhanced error handling failure opening the adapter.

Failing Item:

- FFC_69D
- FFC_221

69D-701 69D-701

Explanation: Error Log Analysis indicates an I/O failure on the adapter.

Failing Item:

- FFC_69D

700-102 700-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_700

700-104 700-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_700

700-105 700-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_700

700-106 700-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_700

700-108 700-108

Explanation: The bus test failed.

Failing Item:

- FFC_700

700-110 700-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_700

700-112 700-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_700

700-114 700-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_700

700-116 700-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_700

700-117 700-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_700
-

700-118 700-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_700
 - FFC_B88
-

700-120 700-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_700
-

700-122 700-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_700
-

700-124 700-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_700
-

700-126 700-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_700
 - FFC_B88
-

700-128 700-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_700
 - SOFTWARE
-

700-129 700-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_700
 - SOFTWARE
-

700-130 700-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_700
-

700-132 700-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_700
-

700-133 700-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

700-134 700-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

700-135 700-135

Explanation: The device failed to configure.

Failing Item:

- FFC_700
 - FFC_B88
 - SOFTWARE
-

700-136 700-136

Explanation: The certify operation failed.

Failing Item:

- FFC_700
-

700-137 **700-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_700
 - FFC_B88
 - FFC_190
-

700-138 **700-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_700
-

700-140 **700-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_700
-

700-640 **700-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

701-102 **701-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_701
-

701-104 **701-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_701
-

701-105 **701-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_701
-

701-106 **701-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_701
-

701-108 **701-108**

Explanation: The bus test failed.

Failing Item:

- FFC_701
-

701-110 **701-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_701
-

701-112 **701-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_701
-

701-114 **701-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_701
-

701-116 **701-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_701
-

701-117 **701-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_701
-

701-118 **701-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_701
 - FFC_B88
-

701-120 • 701-138

701-120 701-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_701
-

701-122 701-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_701
-

701-124 701-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_701
-

701-126 701-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_701
 - FFC_B88
-

701-128 701-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_701
 - SOFTWARE
-

701-129 701-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_701
 - SOFTWARE
-

701-130 701-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_701

701-132 701-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_701
-

701-133 701-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

701-134 701-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

701-135 701-135

Explanation: The device failed to configure.

Failing Item:

- FFC_701
 - FFC_B88
 - SOFTWARE
-

701-136 701-136

Explanation: The certify operation failed.

Failing Item:

- FFC_701
-

701-137 701-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_701
 - FFC_B88
 - FFC_190
-

701-138 701-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_701

701-140 701-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_701

701-640 701-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

702-102 702-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_702

702-104 702-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_702

702-105 702-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_702

702-106 702-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_702

702-108 702-108

Explanation: The bus test failed.

Failing Item:

- FFC_702

702-110 702-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_702

702-112 702-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_702

702-114 702-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_702

702-116 702-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_702

702-117 702-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_702

702-118 702-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_702
- FFC_B88

702-120 702-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_702

702-122 702-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_702

702-124 702-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_702

702-126 702-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_702
- FFC_B88

702-128 702-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_702
- SOFTWARE

702-129 702-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_702
- SOFTWARE

702-130 702-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_702

702-132 702-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_702

702-133 702-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

702-134 702-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

702-135 702-135

Explanation: The device failed to configure.

Failing Item:

- FFC_702
- FFC_B88
- SOFTWARE

702-136 702-136

Explanation: The certify operation failed.

Failing Item:

- FFC_702

702-137 702-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_702
- FFC_B88
- FFC_190

702-138 702-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_702

702-140 702-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_702

702-640 702-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

703-102 703-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_703
-

703-104 703-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_703
-

703-105 703-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_703
-

703-106 703-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_703
-

703-108 703-108

Explanation: The bus test failed.

Failing Item:

- FFC_703
-

703-110 703-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_703
-

703-112 703-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_703
-

703-114 703-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_703
-

703-116 703-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_703
-

703-117 703-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_703
-

703-118 703-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_703
 - FFC_B88
-

703-120 703-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_703
-

703-122 703-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_703
-

703-124 703-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_703
-

703-126 703-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_703
 - FFC_B88
-

703-128 703-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_703
- SOFTWARE

703-129 703-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_703
 - SOFTWARE
-

703-130 703-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_703
-

703-132 703-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_703
-

703-133 703-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

703-134 703-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

703-135 703-135

Explanation: The device failed to configure.

Failing Item:

- FFC_703
 - FFC_B88
 - SOFTWARE
-

703-136 703-136

Explanation: The certify operation failed.

Failing Item:

- FFC_703
-

703-137 703-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_703
 - FFC_B88
 - FFC_190
-

703-138 703-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_703
-

703-140 703-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_703
-

703-640 703-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

704-102 704-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_704
-

704-104 704-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_704
-

704-105 704-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_704
-

704-106 704-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_704
-

704-108 704-108

Explanation: The bus test failed.

Failing Item:

- FFC_704
-

704-110 704-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_704
-

704-112 704-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_704
-

704-114 704-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_704
-

704-116 704-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_704
-

704-117 704-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_704
-

704-118 704-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_704
- FFC_B88

704-120 704-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_704
-

704-122 704-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_704
-

704-124 704-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_704
-

704-126 704-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_704
 - FFC_B88
-

704-128 704-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_704
 - SOFTWARE
-

704-129 704-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_704
 - SOFTWARE
-

704-130 704-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_704

704-132 **704-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_704
-

704-133 **704-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

704-134 **704-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

704-135 **704-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_704
 - FFC_B88
 - SOFTWARE
-

704-136 **704-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_704
-

704-137 **704-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_704
 - FFC_B88
 - FFC_190
-

704-138 **704-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_704
-

704-140 **704-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_704
-

704-640 **704-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

705-102 **705-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_705
-

705-104 **705-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_705
-

705-105 **705-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_705
-

705-106 **705-106**

Explanation: The electronics card test failed.

Failing Item:

- FFC_705
-

705-108 **705-108**

Explanation: The bus test failed.

Failing Item:

- FFC_705
-

705-110 **705-110**

Explanation: The media format is corrupted.

Failing Item:

- FFC_705

705-112 705-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_705
-

705-114 705-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_705
-

705-116 705-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_705
-

705-117 705-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_705
-

705-118 705-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_705
 - FFC_B88
-

705-120 705-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_705
-

705-122 705-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_705
-

705-124 705-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_705
-

705-126 705-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_705
 - FFC_B88
-

705-128 705-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_705
 - SOFTWARE
-

705-129 705-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_705
 - SOFTWARE
-

705-130 705-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_705
-

705-132 705-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_705
-

705-133 705-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

705-134 705-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

705-135 • 706-116

- SOFTWARE

705-135 705-135

Explanation: The device failed to configure.

Failing Item:

- FFC_705
- FFC_B88
- SOFTWARE

705-136 705-136

Explanation: The certify operation failed.

Failing Item:

- FFC_705

705-137 705-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_705
- FFC_B88
- FFC_190

705-138 705-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_705

705-140 705-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_705

705-640 705-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

706-102 706-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_706

706-104 706-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_706

706-105 706-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_706

706-106 706-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_706

706-108 706-108

Explanation: The bus test failed.

Failing Item:

- FFC_706

706-110 706-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_706

706-112 706-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_706

706-114 706-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_706

706-116 706-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_706

706-117 706-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_706

706-118 706-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_706
- FFC_B88

706-120 706-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_706

706-122 706-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_706

706-124 706-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_706

706-126 706-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_706
- FFC_B88

706-128 706-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_706
- SOFTWARE

706-129 706-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_706
- SOFTWARE

706-130 706-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_706

706-132 706-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_706

706-133 706-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

706-134 706-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

706-135 706-135

Explanation: The device failed to configure.

Failing Item:

- FFC_706
- FFC_B88
- SOFTWARE

706-136 706-136

Explanation: The certify operation failed.

Failing Item:

- FFC_706

706-137 706-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_706
- FFC_B88
- FFC_190

706-138 706-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_706

706-140 706-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_706

706-640 706-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

707-102 707-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_707

707-104 707-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_707

707-105 707-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_707

707-106 707-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_707

707-108 707-108

Explanation: The bus test failed.

Failing Item:

- FFC_707

707-110 707-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_707

707-112 707-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_707

707-114 707-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_707

707-116 707-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_707

707-117 707-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_707

707-118 707-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_707
- FFC_B88

707-120 707-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_707
-

707-122 707-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_707
-

707-124 707-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_707
-

707-126 707-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_707
 - FFC_B88
-

707-128 707-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_707
 - SOFTWARE
-

707-129 707-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_707
 - SOFTWARE
-

707-130 707-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_707

707-132 707-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_707
-

707-133 707-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

707-134 707-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

707-135 707-135

Explanation: The device failed to configure.

Failing Item:

- FFC_707
 - FFC_B88
 - SOFTWARE
-

707-136 707-136

Explanation: The certify operation failed.

Failing Item:

- FFC_707
-

707-137 707-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_707
 - FFC_B88
 - FFC_190
-

707-138 707-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

707-140 • 721-124

- FFC_707

707-140 707-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_707

707-640 707-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

721-102 721-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_721

721-104 721-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_721

721-105 721-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_721

721-106 721-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_721

721-108 721-108

Explanation: The bus test failed.

Failing Item:

- FFC_721

721-110 721-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_721

721-112 721-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_721

721-114 721-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_721

721-116 721-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_721

721-117 721-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_721

721-118 721-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_721
- FFC_B88

721-120 721-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_721

721-122 721-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_721

721-124 721-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_721

721-126 **721-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_721
 - FFC_B88
-

721-128 **721-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_721
 - SOFTWARE
-

721-129 **721-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_721
 - SOFTWARE
-

721-130 **721-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_721
-

721-132 **721-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_721
-

721-133 **721-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

721-134 **721-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

721-135 **721-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_721
 - FFC_B88
 - SOFTWARE
-

721-136 **721-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_721
-

721-137 **721-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_721
 - FFC_B88
 - FFC_190
-

721-138 **721-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_721
-

721-140 **721-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_721
-

721-640 **721-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

 722-XXX 722-XXX

Explanation: Unknown disk drive type is failing.

Failing Item:

- FFC_722
-

723-XXX 723-XXX

Explanation: Unknown CD-ROM type is failing.

Failing Item:

- FFC_723
-

724-XXX 724-XXX

Explanation: Unknown tape drive failure.

Failing Item:

- FFC_724
-

733-110 733-110

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-111 733-111

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-112 733-112

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-113 733-113

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-114 733-114

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

 733-115 733-115

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-116 733-116

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-117 733-117

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-118 733-118

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-119 733-119

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-120 733-120

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-130 733-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

 733-131 733-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_733
-

733-135 733-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
 - MEDIA
-

733-136 733-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_733
-

733-140 733-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_733
-

733-150 733-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
 - MEDIA
-

733-151 733-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_733
-

733-160 733-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
 - MEDIA
-

733-168 733-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_733
-

733-169 733-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
 - MEDIA
-

733-16L 733-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

733-170 • 733-201

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-170 733-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- FFC_B88
- MEDIA

733-171 733-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733
- FFC_B88

733-180 733-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-181 733-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-185 733-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-186 733-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-190 733-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_733

733-200 733-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-201 733-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-210 733-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-211 733-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-220 733-220

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-221 733-221

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-222 733-222

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-223 733-223

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-224 733-224

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-225 733-225

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-226 733-226

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-227 733-227

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-228 733-228

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-229 733-229

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-230 733-230

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-231 733-231

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-232 733-232

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-233 • 733-412

733-233 733-233

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-234 733-234

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-235 733-235

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-236 733-236

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-237 733-237

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-238 733-238

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-239 733-239

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-240 733-240

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-300 733-300

Explanation: The device configuration failed.

Failing Item:

- FFC_733
-

- SOFTWARE
-

733-310 733-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_733
 - SOFTWARE
-

733-320 733-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
 - MEDIA
-

733-321 733-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_733
-

733-411 733-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-412 733-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-413 733-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-414 733-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-415 733-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-416 733-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-417 733-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-418 733-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-419 733-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-420 733-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-421 733-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-422 733-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-423 733-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-511 733-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
 - FFC_B88
-

733-512 • 733-611

733-512 733-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-513 733-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-514 733-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-515 733-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-516 733-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-517 733-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-518 733-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-519 733-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-520 733-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-521 733-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-522 733-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-523 733-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-611 733-611

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

 733-612 733-612

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-613 733-613

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-614 733-614

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-615 733-615

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-616 733-616

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-617 733-617

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

- SOFTWARE
-

733-618 733-618

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-619 733-619

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-620 733-620

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-621 733-621

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-622 733-622

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-623 733-623

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

733-624 • 733-634

- FFC_B88
- SOFTWARE

733-624 733-624

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-625 733-625

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-626 733-626

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-627 733-627

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-628 733-628

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-629 733-629

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-630 733-630

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-631 733-631

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-632 733-632

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-633 733-633

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-634 733-634

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

 733-635 733-635

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-636 733-636

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-637 733-637

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-638 733-638

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-639 733-639

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-640 733-640

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

- SOFTWARE
-

733-641 733-641

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-642 733-642

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-643 733-643

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-644 733-644

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-645 733-645

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-646 733-646

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

733-647 • 733-657

- FFC_B88
- SOFTWARE

733-647 733-647

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-648 733-648

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-649 733-649

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-650 733-650

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-651 733-651

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-652 733-652

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-653 733-653

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-654 733-654

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-655 733-655

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-656 733-656

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-657 733-657

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

 733-658 733-658

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-659 733-659

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-660 733-660

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-661 733-661

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-662 733-662

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-663 733-663

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

- SOFTWARE
-

733-664 733-664

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-665 733-665

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-666 733-666

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-667 733-667

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-668 733-668

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-669 733-669

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

733-670 • 733-680

- FFC_B88
- SOFTWARE

733-670 733-670

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-671 733-671

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-672 733-672

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-673 733-673

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-674 733-674

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-675 733-675

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-676 733-676

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-677 733-677

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-678 733-678

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-679 733-679

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-680 733-680

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

 733-681 733-681

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-682 733-682

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-683 733-683

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-684 733-684

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-685 733-685

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-686 733-686

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

- SOFTWARE
-

733-687 733-687

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-688 733-688

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-689 733-689

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-690 733-690

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-691 733-691

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-692 733-692

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

733-693 • 733-703

- FFC_B88
- SOFTWARE

733-693 733-693

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-694 733-694

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-695 733-695

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-696 733-696

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-697 733-697

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-698 733-698

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-699 733-699

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-700 733-700

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-701 733-701

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-702 733-702

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-703 733-703

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

 733-704 733-704

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-705 733-705

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-706 733-706

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-707 733-707

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-708 733-708

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-709 733-709

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

- SOFTWARE
-

733-710 733-710

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-711 733-711

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-712 733-712

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-713 733-713

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-714 733-714

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-715 733-715

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

733-716 • 736-104

- FFC_B88
- SOFTWARE

733-716 733-716

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-717 733-717

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-718 733-718

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-719 733-719

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-720 733-720

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-721 733-721

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-722 733-722

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-723 733-723

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

736-101 736-101

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

736-102 736-102

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
- FFC_821

736-103 736-103

Explanation: The keyboard reset failed.

Failing Item:

- FFC_736
- FFC_821

736-104 736-104

Explanation: Unknown keyboard.

Failing Item:

- FFC_736

736-105 736-105

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_736
 - FFC_821
-

736-106 736-106

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_736
 - FFC_821
-

736-201 736-201

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

736-202 736-202

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
 - FFC_821
-

736-203 736-203

Explanation: The read keyboard ID test failed.

Failing Item:

- FFC_736
 - FFC_821
-

736-204 736-204

Explanation: The keyboard layout ID test failed.

Failing Item:

- FFC_736
-

736-205 736-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_736
 - FFC_821
-

736-206 736-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_736
 - FFC_821
-

736-301 736-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

736-302 736-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
 - FFC_821
-

736-303 736-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_736
-

736-304 736-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_736
-

736-401 736-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

736-402 736-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
 - FFC_821
-

736-403 736-403

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_736
-

736-404 736-404

Explanation: The keyboard is failing.

Failing Item:

- FFC_736
 - FFC_821
-

736-701 736-701

Explanation: Error configuring the device.

Failing Item:

- FFC_736
 - FFC_821
-

736-901 736-901

Explanation: The error log analysis indicates an adapter failure.

Failing Item:

- FFC_821
-

736-902 736-902

Explanation: The error log analysis indicates a device failure.

Failing Item:

- FFC_736
 - FFC_821
-

736-903 736-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_736
 - FFC_821
-

741-102 741-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_741
-

741-104 741-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_741
-

741-105 741-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_741
-

741-106 741-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_741
-

741-108 741-108

Explanation: The bus test failed.

Failing Item:

- FFC_741
-

741-110 741-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_741
-

741-112 741-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_741
-

741-114 741-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_741
-

741-116 741-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_741
-

741-117 741-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_741
-

741-118 741-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_741
 - FFC_B88
-

741-120 741-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_741
-

741-122 741-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_741
-

741-124 741-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_741
-

741-126 741-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_741
 - FFC_B88
-

741-128 741-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_741
 - SOFTWARE
-

741-129 741-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_741
 - SOFTWARE
-

741-130 741-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_741
-

741-132 741-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_741
-

741-133 741-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

741-134 741-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

741-135 741-135

Explanation: The device failed to configure.

Failing Item:

- FFC_741
 - FFC_B88
 - SOFTWARE
-

741-136 741-136

Explanation: The certify operation failed.

Failing Item:

- FFC_741
-

 741-137 741-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_741
 - FFC_B88
 - FFC_190
-

741-138 741-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_741
-

741-140 741-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_741
-

741-640 741-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

745-100 745-100

Explanation: Recovered error.

Response: No action required.

Failing Item:

- MEDIA
 - FFC_745
-

745-200 745-200

Explanation: Drive Not Ready.

Response: Install media, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

 745-300 745-300

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-301 745-301

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-302 745-302

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-303 745-303

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-304 745-304

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-305 745-305

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-306 745-306

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-307 745-307

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-308 745-308

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-309 745-309

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-310 745-310

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-311 745-311

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-312 745-312

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-313 745-313

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-314 745-314

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-315 745-315

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-316 745-316

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

745-317 • 745-327

- MEDIA
- FFC_745

745-317 745-317

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-318 745-318

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-319 745-319

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-320 745-320

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-321 745-321

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-322 745-322

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-323 745-323

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-324 745-324

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-325 745-325

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-326 745-326

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-327 745-327

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-328 745-328

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-329 745-329

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-330 745-330

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-331 745-331

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-332 745-332

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-333 745-333

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-334 745-334

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-335 745-335

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-336 745-336

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-337 745-337

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-338 745-338

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

745-339 • 745-349

- MEDIA
- FFC_745

745-339 745-339

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-340 745-340

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-341 745-341

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-342 745-342

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-343 745-343

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-344 745-344

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-345 745-345

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-346 745-346

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-347 745-347

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-348 745-348

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-349 745-349

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-350 745-350

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-400 745-400

Explanation: General Hardware Failure.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-410 745-410

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-411 745-411

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-412 745-412

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-413 745-413

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-414 745-414

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-415 745-415

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-416 745-416

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-417 745-417

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-418 745-418

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

745-419 • 745-429

- FFC_745
- MEDIA

745-419 745-419

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-420 745-420

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-421 745-421

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-422 745-422

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-423 745-423

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-424 745-424

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-425 745-425

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-426 745-426

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-427 745-427

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-428 745-428

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-429 745-429

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-430 745-430

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-431 745-431

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-432 745-432

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-433 745-433

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-434 745-434

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-435 745-435

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-440 745-440

Explanation: SCSI Hardware Failure.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- SCSI_ADAPTER

745-441 745-441

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-442 745-442

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-443 745-443

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-444 745-444

Explanation: Humidity too High

Response: Lower humidity, replace media, refer to the tape autoloader service information.

Failing Item:

745-445 • 745-472

- FFC_745
- ENVIRONMENT
- MEDIA

745-445 745-445

Explanation: Drive Requires Cleaning

Response: Clean drive, replace media, refer to the tape autoloader service information.

Failing Item:

- CLEAN_MEDIA_DRIVE

745-460 745-460

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-461 745-461

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-462 745-462

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-463 745-463

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-464 745-464

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-465 745-465

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-470 745-470

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-471 745-471

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-472 745-472

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-473 745-473

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-474 745-474

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-475 745-475

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-480 745-480

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-481 745-481

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-482 745-482

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-483 745-483

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-484 745-484

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-485 745-485

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-500 745-500

Explanation: Illegal request to drive

Response: Software conflict, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - SYSTEM
-

745-600 **745-600**
Explanation: Unit Attention**Response:** Software conflict, media changed, refer to the tape autoloader service information.**Failing Item:**

- FFC_745
 - SYSTEM
-

745-700 **745-700****Explanation:** Not Writeable**Response:** Check media for write-protect, refer to the tape autoloader service information.**Failing Item:**

- FFC_745
 - MEDIA
-

745-800 **745-800****Explanation:** Blank Media**Response:** Check media, refer to the tape autoloader service information.**Failing Item:**

- FFC_745
 - MEDIA
-

745-B00 **745-B00****Explanation:** SCSI Interface Failure**Response:** Check SCSI interface, refer to the tape autoloader service information.**Failing Item:**

- FFC_745
 - SCSI_ADAPTER
-

745-D00 **745-D00****Explanation:** Tape Full**Response:** Check replace media, refer to the tape autoloader service information.**Failing Item:**

- FFC_745
 - MEDIA
-

746-101 **746-101****Explanation:** Enhanced error handling failure on the bus.**Failing Item:**

- FFC_221
-

746-102 **746-102****Explanation:** Enhanced error handling failure on a PCI-PCI Bridge.**Failing Item:**

- FFC_293
-

746-103 **746-103****Explanation:** Enhanced error handling failure on the adapter.**Failing Item:**

- FFC_746
 - FFC_221
-

746-212 **746-212****Explanation:** FIFO empty bit set.**Failing Item:**

- FFC_746
-

746-213 **746-213****Explanation:** FIFO empty bit clear.**Failing Item:**

- FFC_746
-

746-214 **746-214****Explanation:** FIFO full bit set.**Failing Item:**

- FFC_746
-

746-215 **746-215****Explanation:** FIFO full bit clear.**Failing Item:**

- FFC_746
-

746-216 **746-216****Explanation:** FIFO data miscompare.**Failing Item:**

- FFC_746
-

746-217 **746-217****Explanation:** SCSI FIFO data miscompare.**Failing Item:**

- FFC_746
-

746-218 746-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_746
-

746-219 746-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems

746-220 746-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_746
-

746-221 746-221

Explanation: Mismatch during the write/read of the configuration register.

Failing Item:

- FFC_746
 - FFC_221
-

746-222 746-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_746
-

746-223 746-223

Explanation: Mismatch during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_746
-

746-224 746-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_746
 - FFC_221
-

746-225 746-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_746
-

746-226 746-226

Explanation: SCSI wrap or PTC failure.

Response: Use MAP0050 : SCSI Bus Problems.

746-227 746-227

Explanation: SCSI adapter test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_746
 - FFC_221
-

746-230 746-230

Explanation: Arbitration test failed.

Response: Use MAP0050 : SCSI Bus Problems.

746-231 746-231

Explanation: Function could not complete.

Response: Use MAP0050 : SCSI Bus Problems.

746-232 746-232

Explanation: SCSI bus data mismatch.

Response: Use MAP0050 : SCSI Bus Problems.

746-240 746-240

Explanation: No terminal power.

Response: Use MAP0050 : SCSI Bus Problems.

746-242 746-242

Explanation: SCSI bus error.

Response: Use MAP0050 : SCSI Bus Problems.

746-301 746-301

Explanation: The parent device open failed.

Failing Item:

- FFC_746
 - FFC_221
-

746-701 746-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_746
-

746-801 **746-801**

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

746-802 **746-802**

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

746-803 **746-803**

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

747-101 **747-101**

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221

747-102 **747-102**

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293

747-103 **747-103**

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_747
- FFC_221

747-212 **747-212**

Explanation: FIFO empty bit set.

Failing Item:

- FFC_747

747-213 **747-213**

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_747

747-214 **747-214**

Explanation: FIFO full bit set.

Failing Item:

- FFC_747

747-215 **747-215**

Explanation: FIFO full bit clear.

Failing Item:

- FFC_747

747-216 **747-216**

Explanation: FIFO data miscompare.

Failing Item:

- FFC_747

747-217 **747-217**

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_747

747-218 **747-218**

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_747

747-219 **747-219**

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems

747-220 **747-220**

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_747

747-221 747-221

Explanation: Mismatch during the write/read of the configuration register.

Failing Item:

- FFC_747
 - FFC_221
-

747-222 747-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_747
-

747-223 747-223

Explanation: Mismatch during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_747
-

747-224 747-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_747
 - FFC_221
-

747-225 747-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_747
-

747-226 747-226

Explanation: SCSI wrap or PTC failure.

Response: Use MAP0050 : SCSI Bus Problems.

747-227 747-227

Explanation: SCSI adapter test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_747
 - FFC_221
-

747-230 747-230

Explanation: Arbitration test failed.

Response: Use MAP0050 : SCSI Bus Problems.

747-231 747-231

Explanation: Function could not complete.

Response: Use MAP0050 : SCSI Bus Problems.

747-232 747-232

Explanation: SCSI bus data mismatch.

Response: Use MAP0050 : SCSI Bus Problems.

747-240 747-240

Explanation: No terminal power.

Response: Use MAP0050 : SCSI Bus Problems.

747-242 747-242

Explanation: SCSI bus error.

Response: Use MAP0050 : SCSI Bus Problems.

747-301 747-301

Explanation: The parent device open failed.

Failing Item:

- FFC_747
 - FFC_221
-

747-701 747-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_747
-

747-801 747-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

747-802 747-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use

747-803 • 757-151

the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

747-803 747-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

749-XXX 749-XXX

Explanation: 7331 Model 205 Tape Library. Refer to service documentation for this device.

Failing Item:

- FFC_749

757-110 757-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_757

757-120 757-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_757

757-130 757-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-131 757-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA

- FFC_757

757-135 757-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-136 757-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-140 757-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_757

757-150 757-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-151 757-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA

- FFC_757

757-160 757-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-168 757-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-169 757-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-16L 757-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-170 757-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- FFC_B88
- MEDIA

757-171 757-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757
- FFC_B88

757-180 757-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-181 757-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-185 757-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-186 757-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-190 757-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_757

757-200 757-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-201 757-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-210 757-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-211 757-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-220 757-220

Explanation: The Release command failed.

Failing Item:

- FFC_757

757-230 757-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_757

757-240 757-240

Explanation: The Openx command failed.

Failing Item:

- FFC_757

757-300 757-300

Explanation: The device configuration failed.

Failing Item:

- FFC_757
- SOFTWARE

 757-310 757-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_757
 - SOFTWARE
-

757-320 757-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
 - MEDIA
-

757-321 757-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_757
-

757-411 757-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-412 757-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

 757-413 757-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-414 757-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-415 757-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-416 757-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-417 757-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-418 757-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-419 757-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-420 757-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-421 757-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-422 757-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-423 757-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-511 757-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-512 757-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-513 757-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-514 757-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-515 757-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-516 757-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-517 757-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-518 757-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-519 757-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-520 757-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-521 757-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-522 757-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-523 757-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
- FFC_B88

757-611 757-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-612 757-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-613 757-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-614 757-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-615 757-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-616 757-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-617 757-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-618 757-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-619 757-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-620 757-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-621 757-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-622 757-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-623 757-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-711 757-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-712 757-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-713 757-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-714 757-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-715 757-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-716 757-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-717 757-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-718 757-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-719 757-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-720 757-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-721 757-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-722 757-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-723 757-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

759-102 759-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_759
-

759-104 759-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_759
-

759-105 759-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_759
-

759-106 759-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_759
-

759-108 759-108

Explanation: The bus test failed.

Failing Item:

- FFC_759
-

759-110 759-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_759
-

759-112 759-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_759
-

759-114 759-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_759
-

759-116 759-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_759
-

759-117 759-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_759
-

759-118 759-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_759
 - FFC_B88
-

759-120 759-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_759
-

759-122 759-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_759
-

759-124 759-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_759
-

759-126 759-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_759
-

- FFC_B88
-

759-128 759-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_759
 - SOFTWARE
-

759-129 759-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_759
 - SOFTWARE
-

759-130 759-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_759
-

759-132 759-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_759
-

759-133 759-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

759-134 759-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

759-135 759-135

Explanation: The device failed to configure.

Failing Item:

- FFC_759
 - FFC_B88
 - SOFTWARE
-

759-136 759-136

Explanation: The certify operation failed.

Failing Item:

- FFC_759
-

759-137 759-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_759
 - FFC_B88
 - FFC_190
-

759-138 759-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_759
-

759-140 759-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_759
-

759-640 759-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

763-1XX 763-1XX

Explanation: Problem detected with a device or device data corrupted

Response: Note: You may need to reinstall ssp.css software.

Failing Item:

- FFC_763
 - SOFTWARE
 - FFC_221
-

763-200 763-200

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-201 763-201

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-202 763-202

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-203 763-203

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-204 763-204

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-205 763-205

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-206 763-206

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-207 763-207

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-208 763-208

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-209 763-209

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-210 763-210

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-211 **763-211**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-212 **763-212**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-213 **763-213**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-214 **763-214**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-215 **763-215**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-216 **763-216**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-217 **763-217**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-218 **763-218**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-219 **763-219**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-220 **763-220**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-221 **763-221**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-222 **763-222**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-223 **763-223**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-224 **763-224**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-225 **763-225**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-226 **763-226**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-227 **763-227**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-228 **763-228**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-229 **763-229**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-230 **763-230**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-231 **763-231**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-232 **763-232**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-233 **763-233**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-234 **763-234**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-235 **763-235**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-236 **763-236**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-237 **763-237**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-238 **763-238**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-239 **763-239**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-240 **763-240**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-241 **763-241**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-242 **763-242**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-243 **763-243**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-244 **763-244**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-245 **763-245**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-246 **763-246**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-247 **763-247**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-248 **763-248**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-249 **763-249**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-250 **763-250**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-251 **763-251**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-252 **763-252**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-253 **763-253**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-254 **763-254**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-255 **763-255**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-256 **763-256**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-257 **763-257**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-258 **763-258**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-259 **763-259**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-260 **763-260**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-261 **763-261**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-262 **763-262**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-263 **763-263**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-264 **763-264**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-265 **763-265**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-266 **763-266**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-267 **763-267**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-268 **763-268**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-269 **763-269**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-270 **763-270**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-271 **763-271**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-272 **763-272**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-273 **763-273**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-274 **763-274**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-275 **763-275**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-276 **763-276**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-277 **763-277**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-278 **763-278**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-279 **763-279**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-280 **763-280**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-281 **763-281**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-282 **763-282**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-283 **763-283**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-284 **763-284**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-285 **763-285**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-286 **763-286**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-287 **763-287**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-288 **763-288**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-289 **763-289**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-290 **763-290**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-291 **763-291**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-292 **763-292**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-293 **763-293**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-294 **763-294**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-295 **763-295**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-296 **763-296**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-297 **763-297**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-298 **763-298**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-299 • 763-7XX

763-299 763-299

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-2A1 763-2A1

Explanation: Problem detected with the internal clock.

Failing Item:

- FFC_763
-

763-2A2 763-2A2

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A3 763-2A3

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A4 763-2A4

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A5 763-2A5

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A6 763-2A6

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A7 763-2A7

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A8 763-2A8

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A9 763-2A9

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-3XX 763-3XX

Explanation: Problem detected with the POS registers.

Failing Item:

- FFC_763
 - FFC_221
-

763-4XX 763-4XX

Explanation: TBIC test failed.

Failing Item:

- FFC_763
 - SOFTWARE
-

763-5XX 763-5XX

Explanation: SRAM test failed.

Failing Item:

- FFC_763
-

763-6XX 763-6XX

Explanation: Microprocessor test failed.

Failing Item:

- FFC_763
-

763-7XX 763-7XX

Explanation: Interrupt test failed.

Failing Item:

- FFC_763
-

763-8XX **763-8XX**

Explanation: FIFO test failed.

Failing Item:

- FFC_763

763-9XX **763-9XX**

Explanation: DMA engine test failed.

Response: Note: Refer to your SP Maintenance Information for the switch cable FRU part number.

Failing Item:

- FFC_763
- FFC_221
- SWITCH_CABLE

763-AX3 **763-AX3**

Explanation: Card wrap test failed.

Response: Note: The terminator FRU part number is listed under the 763 FFC. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_763
- TERMINATOR

763-AX4 **763-AX4**

Explanation: Card wrap test failed.

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- SWITCH_CABLE
- WRAP_PLUG

763-XX2 **763-XX2**

Explanation: Bad adapter card. (except for SRN 763-282)

Response: Replace the SP Switch MX Adapter.

Failing Item:

- FFC_763

764-1XX **764-1XX**

Explanation: Problem detected with a device or device data corrupted.

Response: Note: You may need to reinstall ssp.css software.

Failing Item:

- FFC_764
- SOFTWARE
- FFC_221

764-200 **764-200**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-201 **764-201**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-202 **764-202**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-203 **764-203**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK

764-204 • 764-211

- FFC_764
- WRAP_PLUG

764-204 764-204

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-205 764-205

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-206 764-206

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-207 764-207

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764

- WRAP_PLUG

764-208 764-208

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-209 764-209

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-210 764-210

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-211 764-211

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-212 **764-212**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-213 **764-213**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-214 **764-214**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-215 **764-215**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-216 **764-216**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-217 **764-217**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-218 **764-218**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-219 **764-219**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-220 **764-220**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-221 **764-221**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-222 **764-222**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-223 **764-223**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-224 **764-224**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-225 **764-225**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-226 **764-226**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-227 **764-227**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-228 **764-228**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-229 **764-229**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-230 **764-230**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-231 **764-231**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-232 **764-232**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-233 **764-233**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-234 **764-234**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-235 **764-235**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-236 **764-236**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-237 **764-237**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-238 **764-238**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-239 **764-239**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-240 **764-240**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-241 **764-241**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-242 **764-242**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-243 **764-243**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-244 **764-244**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-245 **764-245**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-246 **764-246**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-247 **764-247**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-248 **764-248**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-249 **764-249**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-250 **764-250**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-251 **764-251**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-252 **764-252**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-253 **764-253**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-254 **764-254**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-255 **764-255**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-256 **764-256**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-257 **764-257**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-258 **764-258**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-259 **764-259**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-260 **764-260**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-261 **764-261**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-262 **764-262**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-263 **764-263**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-264 **764-264**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-265 **764-265**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-266 **764-266**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-267 **764-267**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-268 **764-268**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-269 **764-269**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-270 **764-270**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-271 **764-271**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-272 **764-272**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-273 **764-273**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-274 **764-274**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-275 **764-275**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-276 **764-276**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-277 **764-277**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-278 **764-278**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-279 **764-279**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-280 **764-280**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-281 **764-281**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-282 **764-282**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-283 **764-283**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-284 **764-284**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-285 **764-285**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-286 **764-286**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-287 **764-287**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-288 **764-288**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-289 **764-289**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-290 **764-290**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-291 **764-291**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-292 **764-292**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-293 **764-293**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-294 **764-294**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-295 **764-295**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-296 **764-296**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-297 **764-297**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-298 **764-298**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-299 **764-299**

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-3XX • 772-106

764-3XX 764-3XX

Explanation: Problem detected with the POS registers.

Failing Item:

- FFC_764
 - FFC_221
-

764-4XX 764-4XX

Explanation: TBIC test failed.

Failing Item:

- FFC_764
 - SOFTWARE
-

764-5XX 764-5XX

Explanation: SRAM test failed.

Failing Item:

- FFC_764
-

764-6XX 764-6XX

Explanation: Microprocessor test failed.

Failing Item:

- FFC_764
-

764-7XX 764-7XX

Explanation: Interrupt test failed.

Failing Item:

- FFC_764
-

764-8XX 764-8XX

Explanation: FIFO test failed.

Failing Item:

- FFC_764
-

764-9XX 764-9XX

Explanation: DMA engine test failed.

Response: Note: Refer to your SP Maintenance Information for the switch cable FRU part number.

Failing Item:

- FFC_764
 - FFC_221
 - SWITCH_CABLE
-

764-AX3 764-AX3

Explanation: Card wrap test failed.

Response: Note: The terminator FRU part number is listed under the 763 FFC.

Failing Item:

- FFC_764
 - TERMINATOR
-

764-AX4 764-AX4

Explanation: Card wrap test failed.

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- SWITCH_CABLE
 - WRAP_PLUG
-

764-XX2 764-XX2

Explanation: Bad adapter card. (except for SRN 764-282)

Response: Replace the SP Switch MX Adapter.

Failing Item:

- FFC_764
-

772-102 772-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_772
-

772-104 772-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_772
-

772-105 772-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_772
-

772-106 772-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_772
-

772-108 772-108

Explanation: The bus test failed.

Failing Item:

- FFC_772
-

772-110 772-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_772
-

772-112 772-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_772
-

772-114 772-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_772
-

772-116 772-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_772
-

772-117 772-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_772
-

772-118 772-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_772
 - FFC_B88
-

772-120 772-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_772
-

772-122 772-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_772
-

772-124 772-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_772
-

772-126 772-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_772
 - FFC_B88
-

772-128 772-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_772
 - SOFTWARE
-

772-129 772-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_772
 - SOFTWARE
-

772-130 772-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_772
-

772-132 772-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_772
-

 772-133 772-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

772-134 772-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

772-135 772-135

Explanation: The device failed to configure.

Failing Item:

- FFC_772
 - FFC_B88
 - SOFTWARE
-

772-136 772-136

Explanation: The certify operation failed.

Failing Item:

- FFC_772
-

772-137 772-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_772
 - FFC_B88
 - FFC_190
-

772-138 772-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_772
-

 772-140 772-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_772
-

772-640 772-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

773-102 773-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_773
-

773-104 773-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_773
-

773-105 773-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_773
-

773-106 773-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_773
-

773-108 773-108

Explanation: The bus test failed.

Failing Item:

- FFC_773
-

773-110 773-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_773
-

773-112 773-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_773
-

773-114 773-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_773
-

773-116 773-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_773
-

773-117 773-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_773
-

773-118 773-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_773
 - FFC_B88
-

773-120 773-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_773
-

773-122 773-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_773
-

773-124 773-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_773
-

773-126 773-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_773
 - FFC_B88
-

773-128 773-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_773
 - SOFTWARE
-

773-129 773-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_773
 - SOFTWARE
-

773-130 773-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_773
-

773-132 773-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_773
-

773-133 773-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

773-134 773-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

773-135 • 774-116

- SOFTWARE

773-135 773-135

Explanation: The device failed to configure.

Failing Item:

- FFC_773
- FFC_B88
- SOFTWARE

773-136 773-136

Explanation: The certify operation failed.

Failing Item:

- FFC_773

773-137 773-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_773
- FFC_B88
- FFC_190

773-138 773-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_773

773-140 773-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_773

773-640 773-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

774-102 774-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_774

774-104 774-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_774

774-105 774-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_774

774-106 774-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_774

774-108 774-108

Explanation: The bus test failed.

Failing Item:

- FFC_774

774-110 774-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_774

774-112 774-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_774

774-114 774-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_774

774-116 774-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_774

774-117 774-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_774

774-118 774-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_774
- FFC_B88

774-120 774-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_774

774-122 774-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_774

774-124 774-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_774

774-126 774-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_774
- FFC_B88

774-128 774-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_774
- SOFTWARE

774-129 774-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_774
- SOFTWARE

774-130 774-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_774

774-132 774-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_774

774-133 774-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

774-134 774-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

774-135 774-135

Explanation: The device failed to configure.

Failing Item:

- FFC_774
- FFC_B88
- SOFTWARE

774-136 774-136

Explanation: The certify operation failed.

Failing Item:

- FFC_774

 774-137 774-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_774
 - FFC_B88
 - FFC_190
-

774-138 774-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_774
-

774-140 774-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_774
-

774-640 774-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

776-101 776-101

Explanation: External Test Failure.

Failing Item:

- FFC_D46
-

776-102 776-102

Explanation: External Test Failure.

Failing Item:

- FFC_240
-

776-103 776-103

Explanation: I/O Test Failure.

Failing Item:

- FFC_776

 776-104 776-104

Explanation: Adapter On-card Test Failure.

Failing Item:

- FFC_776
 - FFC_221
-

776-105 776-105

Explanation: Wrap Test Failure.

Failing Item:

- FFC_776
-

776-106 776-106

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_776
-

776-107 776-107

Explanation: Enhanced error handling failure on Eads chip.

Failing Item:

- FFC_776
-

776-108 776-108

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_776
-

776-201 776-201

Explanation: Configuration Register Test Failure.

Failing Item:

- FFC_776
 - FFC_221
-

776-202 776-202

Explanation: Wrap Test Failure.

Failing Item:

- FFC_776
 - FFC_221
-

776-203 776-203

Explanation: Wrap Test Failure.

Failing Item:

- FFC_D46
- FFC_776

776-204 776-204

Explanation: Connect Test Failure.

Failing Item:

- FFC_776
 - FFC_221
-

776-205 776-205

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_D46
 - FFC_776
-

776-206 776-206

Explanation: Wrap Test Failure.

Failing Item:

- FFC_776
 - FFC_221
-

776-301 776-301

Explanation: External Test Failure.

Failing Item:

- FFC_D46
 - FFC_240
 - FFC_776
-

776-302 776-302

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation.

Failing Item:

- FFC_D46
 - FFC_776
 - FFC_221
-

776-303 776-303

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776

776-304 776-304

Explanation: Connect Wrap Test Failure.

Failing Item:

- FFC_D46
 - FFC_776
 - FFC_221
-

776-305 776-305

Explanation: Wrap Test Failure.

Failing Item:

- FFC_D46
 - FFC_776
 - FFC_221
-

776-306 776-306

Explanation: Wrap Test Failure.

Failing Item:

- FFC_D46
 - FFC_776
 - FFC_221
-

776-401 776-401

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
 - FFC_D46
 - FFC_776
 - FFC_221
-

776-404 776-404

Explanation: Connect Test Failure.

Failing Item:

- FFC_240
 - FFC_D46
 - FFC_776
 - FFC_221
-

776-405 776-405

Explanation: Wrap Test Failure.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776

776-406 • 778-002

- FFC_221

776-406 776-406

Explanation: Wrap Test Failure.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-414 776-414

Explanation: Connect Test Failure. This failure occurs if not connected to a functional Token-Ring network.

Response: Run advanced diagnostics for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-415 776-415

Explanation: Wrap Test Failure. This failure occurs if not connected to a functional Token-Ring network.

Response: Run advanced diagnostics for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-416 776-416

Explanation: Wrap Test Failure. This failure occurs if not connected to a functional Token-Ring network.

Response: Run advanced diagnostics for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-701 776-701

Explanation: ELA indicates an adapter error occurred.

Failing Item:

- FFC_776

776-702 776-702

Explanation: ELA indicates an adapter check occurred.

Failing Item:

- FFC_776
- FFC_221

776-703 776-703

Explanation: ELA indicates a DMA failure occurred.

Failing Item:

- FFC_776
- FFC_221

776-704 776-704

Explanation: ELA indicates a PCI bus failure occurred.

Failing Item:

- FFC_776
- FFC_221

776-705 776-705

Explanation: ELA indicates a Programmed I/O failure occurred.

Failing Item:

- FFC_776
- FFC_221

776-706 776-706

Explanation: ELA indicates a command write failure occurred.

Failing Item:

- FFC_776

776-707 776-707

Explanation: ELA indicates an internal adapter error has occurred.

Failing Item:

- FFC_776

778-002 778-002

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_778

778-301 778-301

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_221
-

778-E01 778-E01

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

778-E02 778-E02

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_221
-

77C-102 77C-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_77C
-

77C-104 77C-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_77C
-

77C-105 77C-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_77C
-

77C-106 77C-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_77C
-

77C-108 77C-108

Explanation: The bus test failed.

Failing Item:

- FFC_77C

77C-110 77C-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_77C
-

77C-112 77C-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_77C
-

77C-114 77C-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_77C
-

77C-116 77C-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_77C
-

77C-117 77C-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_77C
-

77C-118 77C-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_77C
 - FFC_B88
-

77C-120 77C-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_77C
-

77C-122 77C-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_77C

77C-124 • 77C-140

77C-124 77C-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_77C
-

77C-126 77C-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_77C
 - FFC_B88
-

77C-128 77C-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_77C
 - SOFTWARE
-

77C-129 77C-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_77C
 - SOFTWARE
-

77C-130 77C-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_77C
-

77C-132 77C-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_77C
-

77C-133 77C-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

77C-134 77C-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

77C-135 77C-135

Explanation: The device failed to configure.

Failing Item:

- FFC_77C
 - FFC_B88
 - SOFTWARE
-

77C-136 77C-136

Explanation: The certify operation failed.

Failing Item:

- FFC_77C
-

77C-137 77C-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_77C
 - FFC_B88
 - FFC_190
-

77C-138 77C-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_77C
-

77C-140 77C-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_77C
-

77C-640 **77C-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

780-101 **780-101**

Explanation: Adapter logic test failure.

Failing Item:

- FFC_780
 - FFC_227
-

780-102 **780-102**

Explanation: Adapter logic test failure.

Failing Item:

- FFC_780
-

780-109 **780-109**

Explanation: Adapter channel Input/Output test failure.

Failing Item:

- FFC_780
-

780-113 **780-113**

Explanation: Adapter Serial Communication Controller (SCC) test failure.

Failing Item:

- FFC_780
-

780-114 **780-114**

Explanation: Adapter logic test failure.

Failing Item:

- FFC_780
 - FFC_227
-

780-120 **780-120**

Explanation: Adapter could not be detected or configured.

Failing Item:

- FFC_780
 - FFC_227
 - SOFTWARE
-

780-140 **780-140**

Explanation: An error was found with the X.21 interface adapter cable.

Failing Item:

- FFC_271
 - FFC_780
-

780-150 **780-150**

Explanation: An error was found with the X.24 interface adapter cable.

Failing Item:

- FFC_272
 - FFC_780
-

780-160 **780-160**

Explanation: An error was found with the X.35 interface adapter cable.

Failing Item:

- FFC_273
 - FFC_780
-

780-170 **780-170**

Explanation: The adapter hardware failed.

Failing Item:

- FFC_780
-

780-180 **780-180**

Explanation: The adapter hardware failed.

Failing Item:

- FFC_780
-

780-190 **780-190**

Explanation: The adapter hardware failed.

Failing Item:

- FFC_780
-

780-210 **780-210**

Explanation: An error was found on the adapter.

Failing Item:

- FFC_780
 - FFC_185
-

780-211 • 780-700

780-211 780-211

Explanation: The adapter card POST test failed.

Failing Item:

- FFC_780
 - FFC_227
-

780-230 780-230

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-232 780-232

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
 - FFC_227
-

780-240 780-240

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-250 780-250

Explanation: An error was found on the adapter.

Failing Item:

- FFC_185
 - FFC_780
-

780-260 780-260

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-270 780-270

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-280 780-280

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-290 780-290

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-300 780-300

Explanation: An adapter error was found during error log analysis.

Failing Item:

- FFC_780
-

780-310 780-310

Explanation: An adapter error was found during error log analysis.

Failing Item:

- FFC_780
 - FFC_185
-

780-320 780-320

Explanation: An adapter error was found during error log analysis.

Failing Item:

- FFC_780
 - FFC_227
-

780-330 780-330

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_780
 - FFC_227
-

780-400 780-400

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_780
 - FFC_227
-

780-700 780-700

Explanation: The adapter failed to configure.

Failing Item:

- FFC_780
 - FFC_227
 - SOFTWARE
-

780-720 780-720

Explanation: Cable wrap test failed.

Failing Item:

- FFC_780
-

780-721 780-721

Explanation: Port wrap test failed.

Failing Item:

- FFC_780
-

780-722 780-722

Explanation: Cable wrap test failed.

Failing Item:

- FFC_780
-

781-101 781-101

Explanation: ROS POST adapter software initialization error.

Failing Item:

- FFC_781
 - FFC_227
-

781-102 781-102

Explanation: Extended DRAM SIP test failed.

Failing Item:

- FFC_781
-

781-103 781-103

Explanation: ROS checksum test failed.

Failing Item:

- FFC_781
-

781-104 781-104

Explanation: Adapter download diagnostics failed

Failing Item:

- FFC_781
 - FFC_227
-

781-105 781-105

Explanation: Memory size test failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-106 781-106

Explanation: Interface ID test failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-107 781-107

Explanation: EIB ID test failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-108 781-108

Explanation: ROS version test failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-109 781-109

Explanation: DUSCC register test failed.

Failing Item:

- FFC_781
-

781-111 781-111

Explanation: DMA register test failed.

Failing Item:

- FFC_781
-

781-112 781-112

Explanation: X.21 PAL test failed.

Failing Item:

- FFC_781
-

781-113 781-113

Explanation: External wrap test failed.

Failing Item:

- FFC_781
-

781-114 781-114

Explanation: Twin tail logic test failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-116 781-116

Explanation: The RS232 cable wrap test failed.

Failing Item:

- FFC_254
-

781-117 781-117

Explanation: The RS422A cable wrap test failed.

Failing Item:

- FFC_253
-

781-118 781-118

Explanation: The V.35 cable wrap test failed.

Failing Item:

- FFC_257
-

781-119 781-119

Explanation: The X.21 cable wrap test failed.

Failing Item:

- FFC_260
-

781-120 781-120

Explanation: The adapter was not detected or could not be configured. test failed.

Failing Item:

- FFC_781
 - FFC_227
 - SOFTWARE
-

781-121 781-121

Explanation: The 4-port jumper cable assembly wrap test failed.

Failing Item:

- FFC_781
 - FFC_227
 - SOFTWARE
-

781-200 781-200

Explanation: The error log analysis indicates the adapter failed.

Failing Item:

- FFC_781
-

781-221 781-221

Explanation: The error log analysis indicates the adapter hardware failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-231 781-231

Explanation: No interface card detected.

Failing Item:

- FFC_227
-

781-501 781-501

Explanation: The power-on self-test (POST) failed.

Failing Item:

- FFC_B77
 - FFC_B69
 - FFC_227
-

781-502 781-502

Explanation: The memory module failed.

Failing Item:

- FFC_B77
-

781-503 781-503

Explanation: Adapter hardware failure.

Failing Item:

- FFC_781
 - FFC_227
-

781-504 781-504

Explanation: Adapter hardware failure.

Failing Item:

- FFC_B69
-

781-505 781-505

Explanation: Adapter hardware failure.

Failing Item:

- FFC_B71
 - FFC_B69
-

781-506	781-506
Explanation:	Adapter hardware failure.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_B72 • FFC_B69

781-507	781-507
Explanation:	Adapter hardware failure.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_B73 • FFC_B69

781-508	781-508
Explanation:	Adapter hardware failure.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_B74 • FFC_B69

781-516	781-516
Explanation:	Adapter Test Failure.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_B77 • FFC_B69

781-517	781-517
Explanation:	Adapter Test Failure.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_B69 • FFC_B77

781-720	781-720
Explanation:	4-port multiprotocol cable
Failing Item:	
	<ul style="list-style-type: none"> • FFC_258 • FFC_781

783-110	783-110
Explanation:	The Reserve command failed.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_783

783-120	783-120
Explanation:	The Inquiry command failed.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_783

783-130	783-130
Explanation:	The Load command failed.
Response:	Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_783 • MEDIA

783-131	783-131
Explanation:	The Load command failed.
Response:	Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.
Failing Item:	
	<ul style="list-style-type: none"> • MEDIA • FFC_783

783-135	783-135
Explanation:	The Unload command failed.
Response:	Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.
Failing Item:	
	<ul style="list-style-type: none"> • FFC_783 • MEDIA

783-136	783-136
Explanation:	The Unload command failed.
Response:	Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.
Failing Item:	
	<ul style="list-style-type: none"> • MEDIA • FFC_783

 783-140 783-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_783
-

783-150 783-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-151 783-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-160 783-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-168 783-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

 783-169 783-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-16L 783-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-170 783-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - FFC_B88
 - MEDIA
-

783-171 783-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
 - FFC_B88
-

 783-180 783-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-181 783-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-185 783-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-186 783-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-190 783-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_783
-

 783-200 783-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-201 783-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-210 783-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-211 783-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-220 783-220

Explanation: The Release command failed.

Failing Item:

- FFC_783
-

783-230 783-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_783
-

783-240 783-240

Explanation: The Openx command failed.

Failing Item:

- FFC_783
-

783-300 783-300

Explanation: The device configuration failed.

Failing Item:

- FFC_783
 - SOFTWARE
-

783-310 783-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_783
 - SOFTWARE
-

783-320 783-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-321 783-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-411 783-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-412 783-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-413 783-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-414 783-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-415 783-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-416 783-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-417 783-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-418 783-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-419 783-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-420 783-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-421 783-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-422 783-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-423 783-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-511 783-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
 - FFC_B88
-

783-512 783-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
 - FFC_B88
-

783-513 783-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
 - FFC_B88
-

783-514 783-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
 - FFC_B88
-

783-515 783-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
 - FFC_B88
-

783-516 783-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

783-517 • 783-615

- FFC_783
- FFC_B88

783-517 783-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-518 783-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-519 783-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-520 783-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-521 783-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-522 783-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-523 783-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-611 783-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-612 783-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-613 783-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-614 783-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-615 783-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-616 **783-616****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-617 **783-617****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-618 **783-618****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-619 **783-619****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-620 **783-620****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-621 **783-621****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-622 **783-622****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-623 **783-623****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-711 **783-711****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-712 **783-712****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-713 **783-713****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-714 **783-714****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-715 783-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-716 783-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-717 783-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-718 783-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-719 783-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-720 783-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-721 783-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-722 783-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-723 783-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

784-102 784-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_784

784-104 784-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_784

784-105 784-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_784

784-106 784-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_784
-

784-108 784-108

Explanation: The bus test failed.

Failing Item:

- FFC_784
-

784-110 784-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_784
-

784-112 784-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_784
-

784-114 784-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_784
-

784-116 784-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_784
-

784-117 784-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_784
-

784-118 784-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_784
 - FFC_B88
-

784-120 784-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_784
-

784-122 784-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_784
-

784-124 784-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_784
-

784-126 784-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_784
 - FFC_B88
-

784-128 784-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_784
 - SOFTWARE
-

784-129 784-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_784
 - SOFTWARE
-

784-130 784-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_784
-

784-132 784-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_784
-

784-133 784-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

784-134 784-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

784-135 784-135

Explanation: The device failed to configure.

Failing Item:

- FFC_784
 - FFC_B88
 - SOFTWARE
-

784-136 784-136

Explanation: The certify operation failed.

Failing Item:

- FFC_784
-

784-137 784-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_784
 - FFC_B88
 - FFC_190
-

784-138 784-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_784
-

784-140 784-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_784
-

784-640 784-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

785-111 785-111

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_227
-

785-114 785-114

Explanation: The register verification test failed.

Failing Item:

- FFC_785
-

785-121 785-121

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_227
-

785-122 785-122

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_227
-

785-123 785-123

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_227
-

785-124 785-124

Explanation: The memory test failed.

Failing Item:

- FFC_785
-

785-151 785-151

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

785-152 785-152

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-153 785-153

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-171 785-171

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

785-172 785-172

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_259
-

785-173 785-173

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

785-181 785-181

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

785-182 785-182

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_261
-

785-183 785-183

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

785-251 785-251

Explanation: Could not perform because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

785-252 785-252

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-253 785-253

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-271 785-271

Explanation: Could not perform because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

 785-272 785-272

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-273 785-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-281 785-281

Explanation: Could not perform because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

785-282 785-282

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-283 785-283

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-481 785-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D57
-

785-482 785-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D57

 785-483 785-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D57
-

785-901 785-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-902 785-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-903 785-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-904 785-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-905 785-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-906 785-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-907 785-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-908 785-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-909 785-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-910 785-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-911 785-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_785

785-912 **785-912**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-913 **785-913**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-914 **785-914**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-915 **785-915**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-916 **785-916**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-917 **785-917**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-918 **785-918**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-919 **785-919**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-920 785-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-921 785-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_785
- SOFTWARE

785-922 785-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-923 785-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-924 785-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-925 785-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_785
- SOFTWARE

785-926 785-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-927 785-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-928 785-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-929 785-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-930 785-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-931 785-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-932 785-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-933 785-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-934 785-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-935 785-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_785

785-936 785-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-937 785-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-938 785-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-939 785-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-940 785-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-941 785-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-942 785-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-943 785-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

786-200 • 787-201

Failing Item:

- SOFTWARE
- FFC_785

786-200 786-200

Explanation: Initiation failed.

Response: Note: You must determine which of the first two FFCs is installed in the system unit. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_786
- FFC_D96
- FFC_227

786-210 786-210

Explanation: The adapter test failed.

Failing Item:

- FFC_786
- FFC_227

786-211 786-211

Explanation: The adapter test failed.

Failing Item:

- FFC_D96
- FFC_227

786-220 786-220

Explanation: The display test failed.

Failing Item:

- FFC_786
- CABLE
- MONITOR

786-221 786-221

Explanation: The display test failed.

Failing Item:

- FFC_D96
- CABLE
- MONITOR

786-710 786-710

Explanation: The ELA indicates HW failure.

Failing Item:

- FFC_786
- FFC_227

786-711 786-711

Explanation: The ELA indicates HW failure.

Failing Item:

- FFC_D96
- FFC_227

787-100 787-100

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787

787-101 787-101

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787
- FFC_227

787-1AA 787-1AA

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787
- RGB
- CABLE
- DISPLAY

787-1XX 787-1XX

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787

787-200 787-200

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95

787-201 787-201

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95
- FFC_227

787-2AA 787-2AA

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95
 - RGB
 - CABLE
 - DISPLAY
-

787-2XX 787-2XX

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95
-

788-001 788-001

Explanation: Adapter Error.

Failing Item:

- FFC_788
 - FFC_227
-

788-002 788-002

Explanation: System Error.

Failing Item:

- SOFTWARE
 - FFC_788
-

788-003 788-003

Explanation: System Error.

Failing Item:

- SOFTWARE
 - FFC_788
-

788-004 788-004

Explanation: System Error.

Failing Item:

- FFC_788
 - SOFTWARE
-

789-101 789-101

Explanation: Failed to release the device.

Failing Item:

- FFC_789
-

789-102 789-102

Explanation: Failed to reserve the device.

Failing Item:

- FFC_789
-

789-103 789-103

Explanation: The device motor failed to start.

Failing Item:

- FFC_789
-

789-104 789-104

Explanation: Failed to make the device ready.

Failing Item:

- FFC_789
-

789-105 789-105

Explanation: Failed to get the inquiry data.

Failing Item:

- FFC_789
-

789-106 789-106

Explanation: The Prevent Media Removal command failed.

Failing Item:

- FFC_789
-

789-107 789-107

Explanation: The Allow Media Removal command failed.

Failing Item:

- FFC_789
-

789-200 789-200

Explanation: The optical disk failed to load.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the error reoccurs use MAP0210 : General problem resolution; otherwise, replace the media.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-201 789-201

Explanation: Failed to unload the optical disk.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors reoccur use MAP0210 : General problem resolution; otherwise, replace the media.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-202 789-202

Explanation: The diagnostic test failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable and rerun the diagnostics. If errors reoccur, or the drive does not support the cleaning procedures use MAP0210 : General problem resolution.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-204 789-204

Explanation: The device failed to configure.

Failing Item:

- FFC_789
 - FFC_B88
-

789-205 789-205

Explanation: The Test Unit Ready command failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the error reoccurs, use MAP0210 : General problem resolution; otherwise, replace the media.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-206 789-206

Explanation: The random write, read and compare test failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use general problem resolution.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-207 789-207

Explanation: A hardware error occurred.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use MAP0210 : General problem resolution.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-208 789-208

Explanation: The Mode Sense command failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use general problem resolution.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-209 789-209

Explanation: The Mode Select command failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use general problem resolution.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-300 789-300

Explanation: A SCSI reservation conflict has occurred.

Failing Item:

- FFC_789
- FFC_B88
- SOFTWARE

789-400 789-400

Explanation: A SCSI command time out has occurred.

Failing Item:

- FFC_789
 - FFC_B88
 - CABLES
 - SOFTWARE
-

789-401 789-401

Explanation: An unknown error has occurred.

Failing Item:

- OPTICAL_DISK
 - FFC_190
 - FFC_B88
 - SOFTWARE
-

789-402 789-402

Explanation: Unit attention condition has occurred.

Failing Item:

- OPTICAL_DISK
 - FFC_190
 - FFC_B88
 - SOFTWARE
-

789-600 789-600

Explanation: ELA indicates that the spare sectors on the disk are exhausted.

Response: Backup the media and replace it. Note: Use the time when the error occurred and the "Spare Sector Availability" service aid to identify the disk that has the error.

Failing Item:

- OPTICAL_DISK
-

789-700 789-700

Explanation: The ELA indicates an equipment error.

Response: Run diagnostics in system verification mode to isolate the problem. If errors are reported, use MAP0210 : General problem resolution; otherwise, the error is due to faulty media. Backup the media and then replace it. Note: Use the time when the error occurred to identify the faulty media.

Failing Item:

- FFC_789
- OPTICAL_DISK

789-701 789-701

Explanation: ELA indicates an irrecoverable data error.

Response: Run diagnostics in system verification mode to isolate the problem. If errors are reported, use MAP0210 : General problem resolution; otherwise, the error is due to faulty media. Backup the media and then replace it. Note: Use the time when the error occurred to identify the faulty media.

Failing Item:

- OPTICAL_DISK
 - FFC_789
-

789-702 789-702

Explanation: ELA indicates that the adapter detected an error.

Response: Use the 7209 Installation and Service information. If the unit checks out to be good, use MAP0210 : General problem resolution.

Failing Item:

- FFC_789
 - FFC_B88
 - CABLES
-

78B-001 78B-001

Explanation: Software error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_78B
-

78B-002 78B-002

Explanation: Adapter failure.

Failing Item:

- FFC_78B
 - SOFTWARE
-

78B-003 78B-003

Explanation: Adapter failure.

Failing Item:

- FFC_78B
 - FFC_227
-

78B-004 78B-004

Explanation: Adapter or display failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

78B-005 • 790-121

- FFC_78B
- MONITOR_OR_CABLE

78B-005 78B-005

Explanation: Adapter failure.

Failing Item:

- FFC_78B
- FFC_227
- MONITOR_OR_CABLE

78D-001 78D-001

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_78D

78D-002 78D-002

Explanation: Adapter failure.

Failing Item:

- FFC_78D
- SOFTWARE

78D-003 78D-003

Explanation: Adapter failure.

Failing Item:

- FFC_78D
- FFC_227

78D-004 78D-004

Explanation: Display failure.

Failing Item:

- FFC_78D
- MONITOR_OR_CABLE

78D-005 78D-005

Explanation: Adapter failure.

Failing Item:

- FFC_78D
- FFC_227
- MONITOR_OR_CABLE

790-101 790-101

Explanation: Configuration Register Test failure.

Failing Item:

- FFC_790

790-102 790-102

Explanation: I/O test failure.

Failing Item:

- FFC_790

790-103 790-103

Explanation: Adapter initialization test failure.

Failing Item:

- FFC_790

790-104 790-104

Explanation: Internal wrap test failure.

Failing Item:

- FFC_790

790-105 790-105

Explanation: Internal wrap test failure.

Failing Item:

- FFC_790

790-106 790-106

Explanation: External wrap (10 Mbps) test failure.

Failing Item:

- FFC_790

790-107 790-107

Explanation: Internal wrap test failure.

Failing Item:

- FFC_790

790-108 790-108

Explanation: External wrap (100 Mbps) test failure.

Failing Item:

- FFC_790

790-109 790-109

Explanation: External wrap (10 Mbps) test failure.

Failing Item:

- FFC_790

790-121 790-121

Explanation: Configuration register test failure.

Failing Item:

- FFC_790

790-122 790-122

Explanation: I/O register test failure.

Failing Item:

- FFC_790
-

790-124 790-124

Explanation: Internal loopback test failure.

Failing Item:

- FFC_790
-

790-125 790-125

Explanation: Internal loopback test failure.

Failing Item:

- FFC_790
-

790-126 790-126

Explanation: External loopback test failure.

Failing Item:

- FFC_790
-

790-150 790-150

Explanation: 10Base-T transceiver test failure.

Failing Item:

- FFC_B08
-

790-151 790-151

Explanation: 10Base-2 transceiver test failure.

Failing Item:

- FFC_B09
-

790-223 790-223

Explanation: Device configuration failure.

Failing Item:

- FFC_790
 - SOFTWARE
-

790-224 790-224

Explanation: 10 Base-T transceiver test failure.

Failing Item:

- FFC_B08
 - FFC_790
-

790-225 790-225

Explanation: 10 Base-2 transceiver test failure.

Failing Item:

- FFC_B09
 - FFC_790
-

790-250 790-250

Explanation: 10 Base-T transceiver test failure.

Failing Item:

- FFC_B08
 - FFC_790
-

790-251 790-251

Explanation: 10 Base-2 transceiver test failure.

Failing Item:

- FFC_B09
 - FFC_790
-

790-701 790-701

Explanation: Error Log Analysis indicates that the adapter is not responding to initialization commands.

Failing Item:

- FFC_790
-

790-702 790-702

Explanation: Error Log Analysis indicates that the device driver has detected a PIO error which it was unable to correct.

Failing Item:

- FFC_790
-

790-703 790-703

Explanation: Error Log Analysis indicates that the adapter has been shutdown due to an unrecoverable error.

Failing Item:

- FFC_790
-

790-704 790-704

Explanation: Error Log Analysis indicates a problem with EEPROM on the adapter.

Failing Item:

- FFC_790
-

790-720 790-720

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_790
 - SOFTWARE
-

791-102 791-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_791
-

791-104 791-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_791
-

791-105 791-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_791
-

791-106 791-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_791
-

791-108 791-108

Explanation: The bus test failed.

Failing Item:

- FFC_791
-

791-110 791-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_791
-

791-112 791-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_791
-

791-114 791-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_791
-

791-116 791-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_791
-

791-117 791-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_791
-

791-118 791-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_791
 - FFC_B88
-

791-120 791-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_791
-

791-122 791-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_791
-

791-124 791-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_791
-

791-126 791-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_791
-

- FFC_B88

791-128 **791-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_791
- SOFTWARE

791-129 **791-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_791
- SOFTWARE

791-130 **791-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_791

791-132 **791-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_791

791-133 **791-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

791-134 **791-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

791-135 **791-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_791
- FFC_B88
- SOFTWARE

791-136 **791-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_791

791-137 **791-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_791
- FFC_B88
- FFC_190

791-138 **791-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_791

791-140 **791-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_791

791-640 **791-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

792-102 • 792-128

792-102 792-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_792
-

792-104 792-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_792
-

792-105 792-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_792
-

792-106 792-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_792
-

792-108 792-108

Explanation: The bus test failed.

Failing Item:

- FFC_792
-

792-110 792-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_792
-

792-112 792-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_792
-

792-114 792-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_792
-

792-116 792-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_792
-

792-117 792-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_792
-

792-118 792-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_792
 - FFC_B88
-

792-120 792-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_792
-

792-122 792-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_792
-

792-124 792-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_792
-

792-126 792-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_792
 - FFC_B88
-

792-128 792-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_792
- SOFTWARE

792-129 **792-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_792
 - SOFTWARE
-

792-130 **792-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_792
-

792-132 **792-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_792
-

792-133 **792-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

792-134 **792-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

792-135 **792-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_792
 - FFC_B88
 - SOFTWARE
-

792-136 **792-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_792
-

792-137 **792-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_792
 - FFC_B88
 - FFC_190
-

792-138 **792-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_792
-

792-140 **792-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_792
-

792-640 **792-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

793-102 **793-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_793
-

793-104 **793-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_793
-

793-105 **793-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_793
-

 793-106 793-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_793
-

793-108 793-108

Explanation: The bus test failed.

Failing Item:

- FFC_793
-

793-110 793-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_793
-

793-112 793-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_793
-

793-114 793-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_793
-

793-116 793-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_793
-

793-117 793-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_793
-

793-118 793-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_793
- FFC_B88

 793-120 793-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_793
-

793-122 793-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_793
-

793-124 793-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_793
-

793-126 793-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_793
 - FFC_B88
-

793-128 793-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_793
 - SOFTWARE
-

793-129 793-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_793
 - SOFTWARE
-

793-130 793-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_793

793-132 793-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_793
-

793-133 793-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

793-134 793-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

793-135 793-135

Explanation: The device failed to configure.

Failing Item:

- FFC_793
 - FFC_B88
 - SOFTWARE
-

793-136 793-136

Explanation: The certify operation failed.

Failing Item:

- FFC_793
-

793-137 793-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_793
 - FFC_B88
 - FFC_190
-

793-138 793-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_793
-

793-140 793-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_793
-

793-640 793-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

799-101 799-101

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
 - FFC_799
-

799-102 799-102

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
 - FFC_799
-

799-201 799-201

Explanation: Internal adapter test failed.

Failing Item:

- FFC_799
 - FFC_227
-

799-202 799-202

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_799
 - FFC_227
-

799-203 799-203

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_799
 - FFC_227
-

799-204 • 778-1405

799-204 799-204

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_799

799-205 799-205

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_799

799-206 799-206

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_799
- SOFTWARE

799-207 799-207

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_799
- SOFTWARE

799-301 799-301

Explanation: Internal adapter test failed.

Failing Item:

- FFC_799
- FFC_227
- SOFTWARE

799-302 799-302

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_799
- FFC_227
- SOFTWARE

799-303 799-303

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_799
- FFC_227

- SOFTWARE

799-304 799-304

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_799
- SOFTWARE

799-305 799-305

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_799
- SOFTWARE

799-700 799-700

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_799
- SOFTWARE

778-1402 778-1402

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_778

778-1403 778-1403

Explanation: Adapter failure.

Failing Item:

- FFC_778
- FFC_221

778-1404 778-1404

Explanation: Adapter failure.

Failing Item:

- FFC_778
- FFC_221

778-1405 778-1405

Explanation: Adapter failure.

Failing Item:

- FFC_778

- FFC_221

778-1500 778-1500

Explanation: Adapter failure.

Failing Item:

- FFC_778
- SOFTWARE

778-1600 778-1600

Explanation: Adapter failure.

Failing Item:

- FFC_778
- FFC_902

778-1601 778-1601

Explanation: Adapter failure.

Failing Item:

- FFC_778
- FFC_902

778-1602 778-1602

Explanation: Adapter failure.

Failing Item:

- FFC_778
- FFC_902

778-1603 778-1603

Explanation: Adapter failure.

Failing Item:

- FFC_778
- FFC_902

778-1604 778-1604

Explanation: Adapter failure.

Failing Item:

- FFC_778
- FFC_902

778-2501 778-2501

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2502 778-2502

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2503 778-2503

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2504 778-2504

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2505 778-2505

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2506 778-2506

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2507 778-2507

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2508 778-2508

Explanation: Adapter error.

Failing Item:

- FFC_778
 - FFC_221
-

778-2509 778-2509

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

778-2510 778-2510

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

778-2511 778-2511

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

778-2601 778-2601

Explanation: Adapter error.

Failing Item:

- FFC_778
 - FFC_221
-

778-2602 778-2602

Explanation: Adapter error.

Failing Item:

- FFC_778
 - FFC_221
-

778-2603 778-2603

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

8XXXX 8XXXX

Explanation: A Configuration Error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive. Note: In this SRN, an x represents a digit 0 through F.

802-655 802-655

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_655
-

802-657 802-657

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_657
-

802-67E 802-67E

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_67E
-

802-684 802-684

Explanation: A potential problem with the RS422 concentrator exists.

Failing Item:

- FFC_684
 - FFC_687
-

802-787 802-787

Explanation: The diagnostics did not detect an installed resource.

Failing Item:

- FFC_787
 - FFC_D95
-

802-78D 802-78D

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_78D
-

802-80C 802-80C

Explanation: A potential problem with a SSA adapter exists. If the system has external SSA drives refer to the SSA Adapters User's Guide and Maintenance Information or the service information for your disk subsystem. If the system has internal SSA drives, go to the SSA MAP in either the system unit's service guide or user's guide.

Response:

Failing Item:

- FFC_80C

802-837 802-837

Explanation: A potential problem with the Enhanced Remote Async Node exists.

Failing Item:

- FFC_837
- FFC_687
- FFC_E10
- FFC_227

807-102 807-102

Explanation: A critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-103 807-103

Explanation: Non-critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-104 807-104

Explanation: An unrecoverable failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-122 807-122

Explanation: A critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152

807-123 807-123

Explanation: A non-critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152

807-124 807-124

Explanation: An unrecoverable power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152

807-132 807-132

Explanation: A critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_807

807-133 807-133

Explanation: A non-critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_807

807-134 807-134

Explanation: An unrecoverable fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_807

807-148 807-148

Explanation: The enclosure indicates a temperature threshold warning.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_807

807-149 807-149

Explanation: The enclosure indicates a temperature threshold failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_807

807-152 807-152

Explanation: A critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-153 807-153

Explanation: A non-critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-154 807-154

Explanation: An unrecoverable repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-162 807-162

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-163 807-163

Explanation: A non-critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-164 807-164

Explanation: An unrecoverable VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-172 807-172

Explanation: A critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-173 807-173

Explanation: A non-critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-174 807-174

Explanation: An unrecoverable enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-182 807-182

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-183 807-183

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-184 807-184

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-192 807-192

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-193 807-193

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-194 807-194

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807

807-201 807-201

Explanation: Device configuration error.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
- FFC_891

807-202 807-202

Explanation: The enclosure failed to open.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
- FFC_891

807-203 807-203

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
- FFC_891

807-204 807-204

Explanation: There is a critical power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

807-205 807-205

Explanation: There is a redundant power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

80C-XXX 80C-XXX

Explanation: A potential problem with an SSA device exists.

Response: The SSA service aid might be of some help, it provides tools for diagnosing and resolving problems on SSA-attached devices. Also refer to the SSA Adapters User's Guide and Maintenance Information .

Failing Item:

- FFC_80C

814-112 • 817-215

814-112 814-112

Explanation: The NVRAM test failed.

Failing Item:

- FFC_814
-

814-113 814-113

Explanation: The VPD test failed.

Failing Item:

- FFC_221
-

814-114 814-114

Explanation: I/O Card NVRAM test failed.

Failing Item:

- FFC_814
-

815-100 815-100

Explanation: The floating-point processor test failed.

Failing Item:

- FFC_815
-

815-101 815-101

Explanation: Floating point processor failed.

Failing Item:

- FFC_815
-

815-102 815-102

Explanation: Floating point processor failed.

Failing Item:

- FFC_815
-

815-200 815-200

Explanation: Power-on self-test indicates a processor failure.

Failing Item:

- FFC_815
 - FFC_7C0
-

815-201 815-201

Explanation: Processor has a status of failed. Processors with a failed status are deconfigured and therefore cannot be tested or used by the system.

Failing Item:

- FFC_815
-

816-140 816-140

Explanation: The four-digit display test failed.

Failing Item:

- FFC_165
 - FFC_816
-

817-123 817-123

Explanation: The I/O planar time-of-day clock test failed.

Failing Item:

- FFC_817
-

817-124 817-124

Explanation: Time of day RAM test failed.

Failing Item:

- FFC_817
-

817-210 817-210

Explanation: The time-of-day clock is at POR.

Failing Item:

- FFC_817
-

817-211 817-211

Explanation: Time of day POR test failed.

Failing Item:

- FFC_817
 - FFC_169
-

817-212 817-212

Explanation: The battery is low.

Failing Item:

- FFC_151
 - FFC_816
-

817-213 817-213

Explanation: The real-time clock is not running.

Failing Item:

- FFC_817
-

817-215 817-215

Explanation: Time of day clock not running test failed.

Failing Item:

- FFC_817
-

817-217 817-217

Explanation: Time of day clock not running.

Failing Item:

- FFC_817
 - FFC_169
-

821-111 821-111

Explanation: Unexpected results from the test.

Failing Item:

- FFC_821
 - FFC_B31
-

821-332 821-332

Explanation: Cannot open device.

Failing Item:

- FFC_821
 - SOFTWARE
-

823-111 823-111

Explanation: Standard Mouse adapter failed.

Failing Item:

- FFC_823
-

823-134 823-134

Explanation: Cannot open device.

Failing Item:

- FFC_823
 - SOFTWARE
-

823-211 823-211

Explanation: Standard mouse adapter failed.

Failing Item:

- FFC_925
 - FFC_823
-

824-220 824-220

Explanation: The tablet adapter fuse failed.

Failing Item:

- FFC_B10
 - FFC_824
-

824-331 824-331

Explanation: An unexpected error occurred.

Failing Item:

- FFC_824
 - FFC_227
-

824-332 824-332

Explanation: The enable/disable device test failed.

Response: Note: Ensure that the wrap plug was not attached when the test was run. If the wrap plug was attached, remove it, and rerun the test. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_824
 - FFC_227
-

824-333 824-333

Explanation: The internal wrap test failed.

Failing Item:

- FFC_824
-

824-334 824-334

Explanation: The tablet adapter fuse failed.

Failing Item:

- FFC_B10
 - FFC_824
-

824-441 824-441

Explanation: An unexpected error occurred.

Failing Item:

- FFC_824
-

824-442 824-442

Explanation: The wrap test failed.

Failing Item:

- FFC_824
-

824-450 824-450

Explanation: Software error caused by hardware failure.

Failing Item:

- FFC_227
-

824-461 **824-461**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_227
-

824-511 **824-511**

Explanation: An unexpected error occurred.

Failing Item:

- FFC_824
-

824-512 **824-512**

Explanation: Tablet adapter reset test failed.

Failing Item:

- FFC_824
-

824-522 **824-522**

Explanation: Adapter fuse failure.

Failing Item:

- FFC_B10
 - FFC_824
-

824-523 **824-523**

Explanation: Device cannot be configured.

Failing Item:

- FFC_824
-

824-524 **824-524**

Explanation: Cannot open device.

Failing Item:

- FFC_824
 - SOFTWARE
-

826-111 **826-111**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

826-112 **826-112**

Explanation: Unable to determine the type of adapter from the VPD.

Failing Item:

- FFC_221
-

826-113 **826-113**

Explanation: The VPD verification test failed.

Failing Item:

- FFC_826
-

826-114 **826-114**

Explanation: The register verification test failed.

Failing Item:

- FFC_826
-

826-121 **826-121**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

826-122 **826-122**

Explanation: The data-wrap communications test failed.

Failing Item:

- FFC_221
-

826-123 **826-123**

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

826-131 **826-131**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

826-132 **826-132**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
-

826-133 **826-133**

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

826-161 **826-161**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_252
-

826-162 **826-162**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_252
-

826-163 **826-163**

Explanation: The modem control line test failed.

Failing Item:

- FFC_252
-

826-171 **826-171**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

826-172 **826-172**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

826-173 **826-173**

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

826-181 **826-181**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

826-182 **826-182**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261
-

826-183 **826-183**

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

826-271 **826-271**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
 - FFC_259
-

826-272 **826-272**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-273 **826-273**

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-281 **826-281**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
 - FFC_259
-

826-282 **826-282**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-283 **826-283**

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-321 **826-321**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-322 **826-322**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
-

826-323 **826-323**

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-331 **826-331**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-332 **826-332**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
-

826-333 **826-333**

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-371 **826-371**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-372 **826-372**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
-

826-373 **826-373**

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-381 **826-381**

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-382 **826-382**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_826
-

826-383 **826-383**

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-481 **826-481**

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

826-482 **826-482**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

826-483 **826-483**

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56
-

826-581 **826-581**

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
 - FFC_D56
-

826-582 **826-582**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_826
 - FFC_D56
-

826-583 **826-583**

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
 - FFC_D56
-

826-901 **826-901**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution. with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-902 **826-902**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-903 **826-903**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-904 **826-904**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-905 **826-905**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-906 **826-906**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-907 **826-907**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-908 826-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-909 826-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90A 826-90A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90B 826-90B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90C 826-90C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90D 826-90D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90E 826-90E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90F 826-90F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-910 826-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-911 826-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-912 826-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-913 826-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-914 826-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-915 826-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-916 826-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-917 **826-917**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-918 **826-918**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-919 **826-919**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-91A **826-91A**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_826
-

826-91B **826-91B**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-91C **826-91C**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-91D **826-91D**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-91E **826-91E**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-91F **826-91F**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-920 **826-920**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-921 **826-921**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_826
- SOFTWARE

826-922 **826-922**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-923 **826-923**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-924 **826-924**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-925 **826-925**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_826
- SOFTWARE

826-926 **826-926**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-927 **826-927**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-928 826-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-929 826-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-92A 826-92A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-92B 826-92B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-92C 826-92C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-92D 826-92D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-92E 826-92E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_826

826-92F 826-92F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-930 826-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-931 826-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-932 826-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-933 826-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-934 826-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-935 826-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-936 826-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-937 826-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-938 826-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-939 826-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93A 826-93A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93B 826-93B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93C 826-93C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93D 826-93D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93E 826-93E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93F 826-93F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-940 826-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-941 826-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-942 826-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-943 826-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

827-112 827-112

Explanation: The parallel port data register write/read test failed.

Failing Item:

- FFC_221

827-121 827-121

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827

827-122 827-122

Explanation: The parallel port data register write/read test failed.

Failing Item:

- FFC_827

827-123 827-123

Explanation: The parallel port control register write/read test failed.

Failing Item:

827-124 • 827-202

- FFC_827

827-124 827-124

Explanation: The parallel port data register read test failed.

Failing Item:

- FFC_827

827-125 827-125

Explanation: The parallel port control register read test failed.

Failing Item:

- FFC_827

827-126 827-126

Explanation: The parallel port control register read test failed.

Failing Item:

- FFC_827

827-131 827-131

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827

827-132 827-132

Explanation: The control port register direction bit (write) test with BIDI enabled failed.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_827

827-133 827-133

Explanation: The control port register direction bit (read) test with BIDI enabled failed.

Failing Item:

- FFC_827

827-141 827-141

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827

827-142 827-142

Explanation: The parallel port control register write/read test with BIDI enabled failed.

Failing Item:

- FFC_827

827-151 827-151

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221

827-152 827-152

Explanation: The parallel port status register read test failed.

Failing Item:

- FFC_827

827-161 827-161

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827

827-162 827-162

Explanation: The parallel port interrupt test failed.

Failing Item:

- FFC_221

827-163 827-163

Explanation: The parallel port interrupt test failed.

Failing Item:

- FFC_221

827-201 827-201

Explanation: The extend control register of the parallel port failed a read/write test.

Failing Item:

- FFC_827

827-202 827-202

Explanation: Input/output to the FIFO (without interrupts) failed.

Failing Item:

- FFC_827

827-203 827-203

Explanation: Input/output to the FIFO (with interrupts) failed.

Failing Item:

- FFC_827
-

827-204 827-204

Explanation: Direct memory access to the FIFO failed.

Failing Item:

- FFC_827
-

828-501 828-501

Explanation: The diskette adapter test failed.

Failing Item:

- FFC_828
-

82C-102 82C-102

Explanation: Adapter test failed.

Failing Item:

- FFC_82C
-

82C-104 82C-104

Explanation: Display test failed.

Failing Item:

- FFC_82C
 - FFC_725
-

831-111 831-111

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

831-112 831-112

Explanation: Unable to determine the type of adapter from the VPD.

Failing Item:

- FFC_221
-

831-113 831-113

Explanation: The VPD verification test failed.

Failing Item:

- FFC_831
-

831-114 831-114

Explanation: The register verification test failed.

Failing Item:

- FFC_831
-

831-121 831-121

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

831-122 831-122

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
-

831-123 831-123

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

831-131 831-131

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

831-132 831-132

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
-

831-133 831-133

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

831-161 831-161

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_252
-

831-162 831-162

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_252
-

831-163 831-163

Explanation: The modem control line test failed.

Failing Item:

- FFC_252
-

831-164 831-164

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
 - FFC_252
-

831-165 831-165

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
 - FFC_252
-

831-166 831-166

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
 - FFC_252
-

831-171 831-171

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

831-172 831-172

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

831-173 831-173

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

831-181 831-181

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

831-182 831-182

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261
-

831-183 831-183

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

831-271 831-271

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
 - FFC_259
-

831-272 831-272

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-273 831-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-281 **831-281**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
 - FFC_259
-

831-282 **831-282**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-283 **831-283**

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-321 **831-321**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-322 **831-322**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-323 **831-323**

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-331 **831-331**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-332 **831-332**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-333 **831-333**

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-371 **831-371**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-372 **831-372**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-373 **831-373**

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-381 **831-381**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-382 **831-382**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-383 **831-383**

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-481 **831-481**

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

831-482 **831-482**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

831-483 **831-483**

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56
-

831-581 **831-581**

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
 - FFC_D56
-

831-582 **831-582**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_831
 - FFC_D56
-

831-583 **831-583**

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
 - FFC_D56
-

831-901 **831-901**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-902 **831-902**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-903 **831-903**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-904 **831-904**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-905 **831-905**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-906 831-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-907 831-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-908 831-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-909 831-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-90A 831-90A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-90B 831-90B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-90C 831-90C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-90D 831-90D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

831-90E • 831-914

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-90E 831-90E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-90F 831-90F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-910 831-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-911 831-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-912 831-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-913 831-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-914 831-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_831

831-915 **831-915**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-916 **831-916**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-917 **831-917**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-918 **831-918**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-919 **831-919**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91A **831-91A**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91B **831-91B**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91C **831-91C**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

831-91D • 831-924

Failing Item:

- SOFTWARE
- FFC_831

831-91D 831-91D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91E 831-91E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91F 831-91F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-920 831-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-921 831-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_831
- SOFTWARE

831-922 831-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-923 831-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-924 831-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-925 **831-925**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_831
 - SOFTWARE
-

831-926 **831-926**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-927 **831-927**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-928 **831-928**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-929 **831-929**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92A **831-92A**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92B **831-92B**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92C **831-92C**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92D **831-92D**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92E **831-92E**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92F **831-92F**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-930 **831-930**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_831
-

831-931 **831-931**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-932 **831-932**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-933 **831-933**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-934 **831-934**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-935 **831-935**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-936 **831-936**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-937 **831-937**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-938 **831-938**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-939 **831-939**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93A **831-93A**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93B **831-93B**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93C **831-93C**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

831-93D • 831-943

resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93D 831-93D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93E 831-93E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93F 831-93F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-940 831-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-941 831-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-942 831-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-943 831-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

836-101 **836-101**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836
-

836-111 **836-111**

Explanation: Cannot run test because the device driver detected a hardware error.

Failing Item:

- FFC_836
 - FFC_227
-

836-112 **836-112**

Explanation: Unable to determine the type of adapter from the VPD.

Failing Item:

- FFC_836
 - FFC_227
-

836-113 **836-113**

Explanation: The VPD verification test failed.

Failing Item:

- FFC_836
-

836-114 **836-114**

Explanation: The register verification test failed.

Failing Item:

- FFC_836
-

836-115 **836-115**

Explanation: The VPD verification test failed.

Failing Item:

- FFC_836
-

836-116 **836-116**

Explanation: The 128-port controller line test failed.

Failing Item:

- FFC_B54
 - FFC_836
-

836-117 **836-117**

Explanation: Remote Async Node test failed.

Failing Item:

- FFC_684

836-118 **836-118**

Explanation: Remote async node test failed.

Failing Item:

- FFC_837
-

836-119 **836-119**

Explanation: Sync line termination test failed.

Failing Item:

- FFC_836
-

836-151 **836-151**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_837
-

836-152 **836-152**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_837
-

836-153 **836-153**

Explanation: The modem control line test failed.

Failing Item:

- FFC_837
-

836-154 **836-154**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_684
 - FFC_836
-

836-155 **836-155**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_684
 - FFC_836
 - FFC_152
-

836-161 **836-161**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_C22
-

836-162 **836-162**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_C22
-

836-163 **836-163**

Explanation: The modem control line test failed.

Failing Item:

- FFC_C22
-

836-164 **836-164**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D06
-

836-171 **836-171**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

836-172 **836-172**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

836-173 **836-173**

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

836-174 **836-174**

Explanation: Cannot run the test because the device driver detected a hardware error while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_263
-

836-175 **836-175**

Explanation: The data wrap communications test failed while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_263
-

836-181 **836-181**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

836-182 **836-182**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261
-

836-183 **836-183**

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

836-251 **836-251**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836

- FFC_837
-

836-252 **836-252**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_836

- FFC_837
-

836-253 **836-253**

Explanation: The modem control line test failed.

Failing Item:

- FFC_836

- FFC_837
-

 836-254 836-254

Explanation: Cannot run the test because the device driver detected a hardware error while running the Remote Async Node wrap test.

Failing Item:

- FFC_836
 - FFC_837
-

836-255 836-255

Explanation: The data wrap communications test failed while running the Remote Async Node wrap test.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_836
 - FFC_684
-

836-271 836-271

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836
 - FFC_837
-

836-272 836-272

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-273 836-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-274 836-274

Explanation: Cannot run the test because the device driver detected a hardware error while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_836
 - FFC_684
-

 836-275 836-275

Explanation: The data wrap communications test failed while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_836
 - FFC_684
-

836-281 836-281

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836
 - FFC_837
-

836-282 836-282

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-283 836-283

Explanation: The modem control line test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-481 836-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

836-482 836-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

836-483 836-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56
-

836-901 **836-901**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-902 **836-902**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-903 **836-903**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-904 **836-904**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_836

836-905 **836-905**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-906 **836-906**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-907 **836-907**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-908 **836-908**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-909 836-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90A 836-90A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90B 836-90B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90C 836-90C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90D 836-90D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90E 836-90E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90F 836-90F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-910 836-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-911 836-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-912 836-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-913 836-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-914 836-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-915 836-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-916 836-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-917 836-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-918 **836-918**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-919 **836-919**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-91A **836-91A**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-91B **836-91B**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_836
-

836-91C **836-91C**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-91D **836-91D**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-91E **836-91E**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-91F **836-91F**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

836-920 • 836-928

- SOFTWARE
- FFC_836

836-920 836-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-921 836-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_836
- SOFTWARE

836-922 836-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-923 836-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-924 836-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-925 836-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_836
- SOFTWARE

836-926 836-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-927 836-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-928 836-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-929 836-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-92A 836-92A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-92B 836-92B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-92C 836-92C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-92D 836-92D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-92E 836-92E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-92F 836-92F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_836

836-930 **836-930**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-931 **836-931**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-932 **836-932**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-933 **836-933**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-934 **836-934**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-935 **836-935**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-936 **836-936**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-937 **836-937**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-938 836-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-939 836-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93A 836-93A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93B 836-93B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93C 836-93C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93D 836-93D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93E 836-93E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93F 836-93F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-940 836-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-941 836-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-942 836-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-943 836-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

840-101 840-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221

840-102 840-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293

840-103 840-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_840
- FFC_221

840-212 840-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_840

840-213 840-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_840

840-214 840-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_840

840-215 840-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_840
-

840-216 840-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_840
-

840-217 840-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_840
-

840-218 840-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_840
-

840-219 840-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems

840-220 840-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_840
-

840-221 840-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_840
 - FFC_221
-

840-222 840-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_840
-

840-223 840-223

Explanation: Miscompare during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_840
-

840-224 840-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_840
 - FFC_221
-

840-225 840-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_840
-

840-226 840-226

Explanation: SCSI wrap or PTC failure.

Response: Go to MAP0050 : SCSI Bus Problems.

840-227 840-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_840
 - FFC_221
-

840-230 840-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

840-231 840-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

840-232 840-232

Explanation: SCSI bus data miscompare.

Response: Go to MAP0050 : SCSI Bus Problems.

840-240 840-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

840-242 840-242

Explanation: SCSI bus error.

Response: Go to MAP0050 : SCSI Bus Problems.

840-301 840-301

Explanation: The parent device open failed.

Failing Item:

- FFC_840
 - FFC_221
-

840-701 840-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_840
-

840-801 840-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

840-802 840-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

840-803 840-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

844-XXX 844-XXX

Explanation: A 7135 controller problem is indicated.

Response: Use 7135 documentation.

Failing Item:

- FFC_844
-

845-XXX 845-XXX

Explanation: A 7135 DASD drawer problem is indicated.

Response: Use 7135 documentation.

Failing Item:

- FFC_845
-

846-XXX 846-XXX

Explanation: A 7135 DASD drawer problem is indicated.

Response: Use 7135 documentation.

Failing Item:

- FFC_846
-

868-101 868-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

868-102 868-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

868-103 868-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_868
 - FFC_221
-

868-110 868-110

Explanation: The adapter diagnostic subcommand test failed.

Failing Item:

- FFC_221
-

868-130 868-130

Explanation: The adapter fuse test failed.

Failing Item:

- FFC_279
-

868-140 868-140

Explanation: The wrap test failed.

Failing Item:

- FFC_868
-

868-150 868-150

Explanation: The BCR registers write/read test failed.

Failing Item:

- FFC_868
-

868-160 868-160

Explanation: The POS registers write/read test failed.

Failing Item:

- FFC_868
-

868-170 868-170

Explanation: The internal/external reset test failed.

Failing Item:

- FFC_868
-

868-180 868-180

Explanation: The adapter command timed out.

Response: Note: Check the fuse before replacing.

Failing Item:

- FFC_279
 - FFC_868
-

868-190 868-190

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_221
-

868-191 868-191

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_868
-

868-192 868-192

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_221
-

868-193 868-193

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_279
-

868-194 868-194

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_868
-

868-200 868-200

Explanation: ROM CRC error.

Failing Item:

- FFC_868
-

868-201 868-201

Explanation: Adapter RAM error.

Failing Item:

- FFC_868
-

868-202 868-202

Explanation: The control logic failed.

Failing Item:

- FFC_868
-

868-203 868-203

Explanation: The control logic failed.

Failing Item:

- FFC_868
-

868-204 868-204

Explanation: The control logic failed.

Failing Item:

- FFC_868
-

868-205 868-205

Explanation: The control logic failed.

Failing Item:

- FFC_868
-

868-206 868-206

Explanation: Diagnostics completed with a previous error.

Failing Item:

- FFC_868
-

868-211 868-211

Explanation: The device failed to configure.

Failing Item:

- FFC_279
 - FFC_868
 - SOFTWARE
-

868-212 868-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_868
-

868-213 868-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_868
-

868-214 868-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_868
-

868-215 868-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_868
-

868-216 868-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_868
-

868-217 868-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_868
-

868-218 868-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_868
-

868-219 868-219

Explanation: SCSI parity error.

Response: Go to MAP0050 : SCSI Bus Problems.

868-220 868-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_868
-

868-221 868-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_868
 - FFC_221
-

868-222 868-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_868
-

868-223 868-223

Explanation: Miscompare during the write/read of the memory I/O register.

Failing Item:

- FFC_868
-

868-224 868-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_868
 - FFC_221
-

868-225 868-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_868
-

868-226 868-226

Explanation: SCSI wrap or PTC failure.

Response: Go to MAP0050 : SCSI Bus Problems.

868-227 868-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_868
 - FFC_221
-

868-230 868-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

868-231 868-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

868-232 868-232

Explanation: SCSI bus data miscompare.

Response: Go to MAP0050 : SCSI Bus Problems.

868-240 868-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

868-242 868-242

Explanation: SCSI bus error.

Response: Go to MAP0050 : SCSI Bus Problems.

868-301 868-301

Explanation: Configuration open failed for parent bus.

Failing Item:

- FFC_868
 - FFC_221
-

868-701 868-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_868
-

868-801 868-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

868-802 868-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

868-803 868-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

887-101 887-101

Explanation: POS register test failed.

Failing Item:

- FFC_887
-

887-102 887-102

Explanation: I/O register test failed.

Failing Item:

- FFC_887
-

887-103 887-103

Explanation: Local RAM test failed.

Failing Item:

- FFC_887
-

887-104 • 887-120

887-104 887-104

Explanation: Vital Product Data (VPD) test failed.

Failing Item:

- FFC_887
-

887-105 887-105

Explanation: LAN coprocessor internal tests failed.

Failing Item:

- FFC_887
-

887-106 887-106

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-107 887-107

Explanation: External loopback test failed.

Failing Item:

- FFC_887
-

887-108 887-108

Explanation: External loopback test failed.

Failing Item:

- FFC_887
-

887-109 887-109

Explanation: External loopback parity tests failed.

Failing Item:

- FFC_887
-

887-110 887-110

Explanation: External loopback fairness test failed.

Failing Item:

- FFC_887
-

887-111 887-111

Explanation: External loopback fairness and parity tests failed.

Failing Item:

- FFC_887
-

887-112 887-112

Explanation: External loopback (twisted pair) test failed.

Failing Item:

- FFC_887
-

887-113 887-113

Explanation: External loopback (twisted pair) parity test failed.

Failing Item:

- FFC_887
-

887-114 887-114

Explanation: Ethernet loopback (twisted pair) fairness test failed.

Failing Item:

- FFC_887
-

887-115 887-115

Explanation: External loopback (twisted pair) fairness and parity tests failed.

Failing Item:

- FFC_887
-

887-116 887-116

Explanation: Twisted pair wrap data failed.

Failing Item:

- FFC_887
-

887-117 887-117

Explanation: Device configuration fails.

Failing Item:

- FFC_887
 - SOFTWARE
-

887-118 887-118

Explanation: Device driver indicates a hardware problem.

Failing Item:

- FFC_887
-

887-120 887-120

Explanation: Device driver indicates a hardware problem.

Failing Item:

- FFC_887

887-121 887-121

Explanation: Ethernet transceiver test failed.

Failing Item:

- FFC_B08
-

887-122 887-122

Explanation: Ethernet 10 Base-2 transceiver test failed.

Failing Item:

- FFC_B09
-

887-123 887-123

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-124 887-124

Explanation: Error log indicates a hardware problem.

Failing Item:

- FFC_887
 - SOFTWARE
-

887-125 887-125

Explanation: Fuse test failed.

Failing Item:

- FFC_887
-

887-202 887-202

Explanation: Vital product data test failed.

Failing Item:

- FFC_887
-

887-203 887-203

Explanation: Vital product data test failed.

Failing Item:

- FFC_887
-

887-209 887-209

Explanation: RJ-45 converter test failed.

Failing Item:

- FFC_887
-

887-304 887-304

Explanation: Coprocessor internal test failed.

Failing Item:

- FFC_887
-

887-305 887-305

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-306 887-306

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-307 887-307

Explanation: External loopback test failed.

Failing Item:

- FFC_887
-

887-319 887-319

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_887
 - SOFTWARE
-

887-400 887-400

Explanation: Fuse test failed.

Failing Item:

- FFC_887
-

887-401 887-401

Explanation: Circuit breaker for Ethernet test failed.

Failing Item:

- FFC_887
-

887-402 887-402

Explanation: Ethernet 10 Base-2 transceiver test failed.

Failing Item:

- FFC_B09
 - FFC_887
-

887-403 **887-403****Explanation:** Ethernet 10 Base-T transceiver test failed.**Failing Item:**

- FFC_B08
 - FFC_887
-

887-405 **887-405****Explanation:** Rerun diagnostics in advanced mode for accurate problem determination.**Failing Item:**

- ETHERNET_NETWORK
 - FFC_887
-

891-102 **891-102****Explanation:** A critical failure has occurred on an undefined element.**Failing Item:**

- FFC_891
-

891-103 **891-103****Explanation:** Non-critical failure has occurred on an undefined element.**Failing Item:**

- FFC_891
-

891-104 **891-104****Explanation:** An unrecoverable failure has occurred on an undefined element.**Failing Item:**

- FFC_891
-

891-122 **891-122****Explanation:** A critical power supply failure has occurred.**Failing Item:**

- FFC_152
-

891-123 **891-123****Explanation:** A non-critical power supply failure has occurred.**Failing Item:**

- FFC_152
-

891-124 **891-124****Explanation:** An unrecoverable power supply failure has occurred.**Failing Item:**

- FFC_152
-

891-132 **891-132****Explanation:** A critical fan failure has occurred.**Failing Item:**

- FFC_166
-

891-133 **891-133****Explanation:** A non-critical fan failure has occurred.**Failing Item:**

- FFC_166
-

891-134 **891-134****Explanation:** An unrecoverable fan failure has occurred.**Failing Item:**

- FFC_166
 - FFC_891
-

891-148 **891-148****Explanation:** The enclosure indicates a temperature threshold warning.**Failing Item:**

- FFC_166
 - FFC_891
-

891-149 **891-149****Explanation:** The enclosure indicates a temperature threshold failure.**Failing Item:**

- FFC_166
 - FFC_891
-

891-152 **891-152****Explanation:** A critical repeater card failure has occurred.**Failing Item:**

- FFC_891
-

891-153 **891-153**

Explanation: A non-critical repeater card failure has occurred.

Failing Item:

- FFC_891
-

891-154 **891-154**

Explanation: An unrecoverable repeater card failure has occurred.

Failing Item:

- FFC_891
-

891-162 **891-162**

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP0210 : General problem resolution.

Failing Item:

- FFC_891
-

891-163 **891-163**

Explanation: A non-critical VPD module failure has occurred.

Failing Item:

- FFC_891
-

891-164 **891-164**

Explanation: An unrecoverable VPD module failure has occurred.

Failing Item:

- FFC_891
-

891-172 **891-172**

Explanation: A critical enclosure services failure has occurred.

Failing Item:

- FFC_891
-

891-173 **891-173**

Explanation: A non-critical enclosure services failure has occurred.

Failing Item:

- FFC_891
-

891-174 **891-174**

Explanation: An unrecoverable enclosure services failure has occurred.

Failing Item:

- FFC_891
-

891-182 **891-182**

Explanation: A critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-183 **891-183**

Explanation: A non-critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-184 **891-184**

Explanation: An unrecoverable failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-192 **891-192**

Explanation: A critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-193 **891-193**

Explanation: A non-critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-194 **891-194**

Explanation: An unrecoverable failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-201 **891-201**

Explanation: Device configuration error.

Failing Item:

- FFC_891
-

891-202 891-202

Explanation: The enclosure failed to open.

Failing Item:

- FFC_891

891-203 891-203

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP0210 : General problem resolution.

Failing Item:

- FFC_891

891-204 891-204

Explanation: There is a critical power supply or fan failure.

Failing Item:

- FFC_152
- FFC_166

891-205 891-205

Explanation: There is a redundant power supply or fan failure.

Failing Item:

- FFC_152
- FFC_166

899-XXX 899-XXX

Explanation: 3490 or 3590 attached tape drive being identified or configured.

Response: Go to the service documentation for the tape drive attached to your system.

Failing Item:

- FFC_899

901-XXX 901-XXX

Explanation: Vendor SCSI device problem. Refer to the service documentation for this device.

902-XXX 902-XXX

Explanation: Vendor display problem. Refer to the service documentation for this display.

903-XXX 903-XXX

Explanation: Vendor Async device problem. Refer to the service documentation for this device.

904-XXX 904-XXX

Explanation: Vendor Parallel device problem. Refer to the service documentation for this device.

905-XXX 905-XXX

Explanation: Vendor device problem. Refer to the service documentation for this device.

912-102 912-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_912

912-104 912-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_912

912-105 912-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_912

912-106 912-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_912

912-108 912-108

Explanation: The bus test failed.

Failing Item:

- FFC_912

912-110 912-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_912
-

912-112 **912-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_912
-

912-114 **912-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_912
-

912-116 **912-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_912
-

912-117 **912-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_912
-

912-118 **912-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_912
 - FFC_B88
-

912-120 **912-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_912
-

912-122 **912-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_912
-

912-124 **912-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_912
-

912-126 **912-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_912
 - FFC_B88
-

912-128 **912-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_912
 - SOFTWARE
-

912-129 **912-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_912
 - SOFTWARE
-

912-130 **912-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_912
-

912-132 **912-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_912
-

912-133 **912-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_912
-

912-134 **912-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

912-135 • 913-116

- SOFTWARE

912-135 912-135

Explanation: The device failed to configure.

Failing Item:

- FFC_912
- FFC_B88
- SOFTWARE

912-136 912-136

Explanation: The certify operation failed.

Failing Item:

- FFC_912

912-137 912-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_912
- FFC_B88
- FFC_190

912-138 912-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General Problem Resolution.

Failing Item:

- FFC_912

912-140 912-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_912

912-640 912-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

913-102 913-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_913

913-104 913-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_913

913-105 913-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_913

913-106 913-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_913

913-108 913-108

Explanation: The bus test failed.

Failing Item:

- FFC_913

913-110 913-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_913

913-112 913-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_913

913-114 913-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_913

913-116 913-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_913

913-117 913-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_913

913-118 913-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_913
- FFC_B88

913-120 913-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_913

913-122 913-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_913

913-124 913-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_913

913-126 913-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_913
- FFC_B88

913-128 913-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_913
- SOFTWARE

913-129 913-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_913
- SOFTWARE

913-130 913-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_913

913-132 913-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_913

913-133 913-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

913-134 913-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

913-135 913-135

Explanation: The device failed to configure.

Failing Item:

- FFC_913
- FFC_B88
- SOFTWARE

913-136 913-136

Explanation: The certify operation failed.

Failing Item:

- FFC_913

913-137 913-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_913
- FFC_B88
- FFC_190

913-138 913-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General Problem Resolution.

Failing Item:

- FFC_913

913-140 913-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_913

913-640 913-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

914-110 914-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_914

914-120 914-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_914

914-130 914-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-131 914-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-135 914-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-136 914-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-140 914-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_914

914-150 914-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-151 914-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-160 914-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-168 914-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-169 914-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914

- MEDIA

914-16L 914-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-170 914-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- FFC_B88
- MEDIA

914-171 914-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914
- FFC_B88

914-180 914-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-181 914-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-185 914-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-186 914-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-190 914-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_914

914-200 914-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-201 914-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-210 914-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-211 914-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-220 914-220

Explanation: The Release command failed.

Failing Item:

- FFC_914

914-230 914-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_914

914-240 914-240

Explanation: The Openx command failed.

Failing Item:

- FFC_914

914-300 914-300

Explanation: The device configuration failed.

Failing Item:

- FFC_914
 - SOFTWARE
-

914-310 914-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_914
 - SOFTWARE
-

914-320 914-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
 - MEDIA
-

914-321 914-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_914
-

914-411 914-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-412 914-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914

- FFC_B88
 - SOFTWARE
-

914-413 914-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-414 914-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-415 914-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-416 914-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-417 914-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-418 914-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-419 • 914-511

914-419 914-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41A 914-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41B 914-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41C 914-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41D 914-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41E 914-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41F 914-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-420 914-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-421 914-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-422 914-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-423 914-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-511 914-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-512 **914-512**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-513 **914-513**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-514 **914-514**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-515 **914-515**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-516 **914-516**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-517 **914-517**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-518 **914-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-519 **914-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-51A **914-51A**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-51B **914-51B**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-51C **914-51C**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-51D **914-51D**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-51E **914-51E**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-51F • 914-618

914-51F 914-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-520 914-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-521 914-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-522 914-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-523 914-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-611 914-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-612 914-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
-

- FFC_B88
 - SOFTWARE
-

914-613 914-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-614 914-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-615 914-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-616 914-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-617 914-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-618 914-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-619 **914-619**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-61A **914-61A**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-61B **914-61B**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-61C **914-61C**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-61D **914-61D**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-61E **914-61E**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-61F **914-61F**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-620 **914-620**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-621 **914-621**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-622 **914-622**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-623 **914-623**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-711 **914-711**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-712 • 914-71D

914-712 914-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-713 914-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-714 914-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-715 914-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-716 914-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-717 914-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-718 914-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-719 914-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-71A 914-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-71B 914-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-71C 914-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-71D 914-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71E **914-71E**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71F **914-71F**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-720 **914-720**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-721 **914-721**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-722 **914-722**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-723 **914-723**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

915-110 **915-110**

Explanation: The Reserve command is corrupted.

Failing Item:

- FFC_915
-

915-120 **915-120**

Explanation: The Inquiry command failed.

Failing Item:

- FFC_915
-

915-130 **915-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-131 **915-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_915
-

915-135 **915-135**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-136 **915-136**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

915-140 • 915-171

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-140 915-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_915

915-150 915-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-151 915-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-160 915-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-168 915-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-169 915-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-16L 915-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-170 915-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- FFC_B88
- MEDIA

915-171 915-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915
- FFC_B88

915-180 **915-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-181 **915-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-185 **915-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-186 **915-186**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-190 **915-190**

Explanation: The Mode Select command failed.

Failing Item:

- FFC_915

915-200 **915-200**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-201 **915-201**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-210 **915-210**

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-211 **915-211**

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-220 915-220

Explanation: The Replace command failed.

Failing Item:

- FFC_915

915-230 915-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_915

915-240 915-240

Explanation: The Openx command failed.

Failing Item:

- FFC_915

915-300 915-300

Explanation: The device configuration failed.

Failing Item:

- FFC_915
- SOFTWARE

915-310 915-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_915
- SOFTWARE

915-320 915-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-321 915-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-411 915-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-412 915-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-413 915-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-414 915-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-415 915-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-416 915-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-417 **915-417****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-418 **915-418****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-419 **915-419****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-420 **915-420****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-421 **915-421****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-422 **915-422****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-423 **915-423****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-511 **915-511****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_915
 - FFC_B88
-

915-512 **915-512****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_915
 - FFC_B88
-

915-513 **915-513****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_915
 - FFC_B88
-

915-514 **915-514****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_915
 - FFC_B88
-

915-515 **915-515****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_915
 - FFC_B88
-

915-516 **915-516****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

915-517 • 915-615

- FFC_915
- FFC_B88

915-517 915-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-518 915-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-519 915-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-520 915-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-521 915-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-522 915-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-523 915-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-611 915-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-612 915-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-613 915-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-614 915-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-615 915-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-616 **915-616****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-617 **915-617****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-618 **915-618****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-619 **915-619****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-620 **915-620****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-621 **915-621****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-622 **915-622****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-623 **915-623****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-711 **915-711****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-712 **915-712****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-713 **915-713****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-714 **915-714****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-715 **915-715**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-716 **915-716**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-717 **915-717**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-718 **915-718**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-719 **915-719**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-720 **915-720**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-721 **915-721**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-722 **915-722**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-723 **915-723**
Explanation: A device timeout error occurred.
Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

917-102 **917-102**
Explanation: An unrecoverable media error.
Failing Item:

- FFC_917
- FFC_B88

917-104 **917-104**
Explanation: The motor failed to restart.
Failing Item:

- FFC_917

917-105 **917-105**
Explanation: The drive did not become ready.
Failing Item:

- FFC_917

917-106 **917-106**
Explanation: The electronics card test failed.
Failing Item:

- FFC_917

917-108 917-108

Explanation: The bus test failed.

Failing Item:

- FFC_917
-

917-110 917-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_917
-

917-112 917-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_917
-

917-114 917-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_917
-

917-116 917-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to ensure they are all compatible. If you do not find a problem, call your support person.

917-117 917-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_917
-

917-118 917-118

Explanation: A SCSI command timeout.

Failing Item:

- FFC_917
 - FFC_B88
-

917-120 917-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_917
-

917-122 917-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_917
-

917-124 917-124

Explanation: A SCSI check condition error.

Failing Item:

- FFC_917
-

917-126 917-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_917
 - FFC_B88
-

917-128 917-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_917
-

917-129 917-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_917
-

917-130 917-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_917
 - FFC_B88
-

917-132 917-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_917
-

917-133 917-133

Explanation: Use the subsystem guide to complete diagnostics.

Failing Item:

917-134 • 918-116

- FFC_917

917-134 917-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

917-135 917-135

Explanation: The device failed to configure.

Failing Item:

- FFC_917
- FFC_B88
- SOFTWARE

917-136 917-136

Explanation: The certify operation failed.

Failing Item:

- FFC_917

917-137 917-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_917
- FFC_B88
- FFC_190

917-138 917-138

Explanation: Error log indicates that the disk is operating at higher than recommended temperatures.

Failing Item:

- FFC_190

917-139 917-139

Explanation: Error configuring or opening device.

Failing Item:

- FFC_917

917-640 917-640

Explanation: Error Log Analysis indicates a path error.

Failing Item:

- FFC_640

918-102 918-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_918

918-104 918-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_918

918-105 918-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_918

918-106 918-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_918

918-108 918-108

Explanation: The bus test failed.

Failing Item:

- FFC_918

918-110 918-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_918

918-112 918-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_918

918-114 918-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_918

918-116 918-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_918

918-117 918-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_918

918-118 918-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_918
- FFC_B88

918-120 918-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_918

918-122 918-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_918

918-124 918-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_918

918-126 918-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_918
- FFC_B88

918-128 918-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_918
- SOFTWARE

918-129 918-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_918
- SOFTWARE

918-130 918-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_918

918-132 918-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_918

918-133 918-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_918

918-134 918-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

918-135 918-135

Explanation: The device failed to configure.

Failing Item:

- FFC_918
- FFC_B88
- SOFTWARE

918-136 918-136

Explanation: The certify operation failed.

Failing Item:

- FFC_918

918-137 **918-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_918
 - FFC_B88
 - FFC_190
-

918-138 **918-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_918
-

918-140 **918-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_918
-

918-640 **918-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

921-101 **921-101**

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-102 **921-102**

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-103 **921-103**

Explanation: The keyboard reset failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-104 **921-104**

Explanation: Unknown keyboard.

Failing Item:

- FFC_921
-

921-105 **921-105**

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-106 **921-106**

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-201 **921-201**

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-202 **921-202**

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-203 **921-203**

Explanation: The read keyboard ID test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-204 921-204

Explanation: The keyboard layout ID test failed.

Failing Item:

- FFC_921
-

921-205 921-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-206 921-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-301 921-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-302 921-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-303 921-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_921
-

921-304 921-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_921
-

921-401 921-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

921-402 921-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-403 921-403

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_921
-

921-404 921-404

Explanation: The keyboard is failing.

Failing Item:

- FFC_921
 - FFC_821
-

921-501 921-501

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-502 921-502

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-503 921-503

Explanation: The auto-click cannot be disabled.

Failing Item:

- FFC_921
-

921-504 921-504

Explanation: The auto-click cannot be enabled.

Failing Item:

- FFC_921
-

921-505 921-505

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_921

921-601 921-601

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-602 921-602

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-603 921-603

Explanation: The speaker test failed.

Failing Item:

- FFC_921
-

921-701 921-701

Explanation: Error configuring the device.

Failing Item:

- FFC_921
 - FFC_821
-

921-901 921-901

Explanation: The error log analysis indicates an adapter failure.

Failing Item:

- FFC_821
-

921-902 921-902

Explanation: The error log analysis indicates a device failure.

Failing Item:

- FFC_921
 - FFC_821
-

921-903 921-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_921
 - FFC_821
-

922-101 922-101

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-102 922-102

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
 - FFC_821
-

922-103 922-103

Explanation: The keyboard reset failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-104 922-104

Explanation: Unknown keyboard.

Failing Item:

- FFC_922
-

922-105 922-105

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-106 922-106

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-201 922-201

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-202 922-202

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922

- FFC_821

922-203 922-203

Explanation: The read keyboard id test failed.

Failing Item:

- FFC_922
- FFC_821

922-204 922-204

Explanation: The keyboard layout id test failed.

Failing Item:

- FFC_922

922-205 922-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_922
- FFC_821

922-206 922-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_922
- FFC_821

922-301 922-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

922-302 922-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
- FFC_821

922-303 922-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_922

922-304 922-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_922

922-401 922-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

922-402 922-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
- FFC_821

922-403 922-403

Explanation: The keyboard is failing.

Failing Item:

- FFC_922

922-404 922-404

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_922
- FFC_821

922-501 922-501

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

922-502 922-502

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
- FFC_821

922-503 922-503

Explanation: The auto-click cannot be disabled.

Failing Item:

- FFC_921

922-504 922-504

Explanation: The auto-click cannot be enabled.

Failing Item:

- FFC_922
-

922-505 922-505

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_922
-

922-601 922-601

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-602 922-602

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
 - FFC_821
-

922-603 922-603

Explanation: The speaker test failed.

Failing Item:

- FFC_922
-

922-701 922-701

Explanation: Error configuring the device.

Failing Item:

- FFC_923
 - FFC_821
-

922-901 922-901

Explanation: The error log indicates an adapter failed.

Failing Item:

- FFC_821
-

922-902 922-902

Explanation: The error log indicates a device failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-903 922-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_922
 - FFC_821
-

923-101 923-101

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-102 923-102

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
 - FFC_821
-

923-103 923-103

Explanation: The keyboard reset failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-104 923-104

Explanation: Unknown keyboard.

Failing Item:

- FFC_923
-

923-105 923-105

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-106 923-106

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-201 923-201

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-202 923-202

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
 - FFC_821
-

923-203 923-203

Explanation: The read keyboard id test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-204 923-204

Explanation: The keyboard layout id test failed.

Failing Item:

- FFC_923
-

923-205 923-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-206 923-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-301 923-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-302 923-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923

- FFC_821
-

923-303 923-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_923
-

923-304 923-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_923
-

923-401 923-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-402 923-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
 - FFC_821
-

923-403 923-403

Explanation: The keyboard is failing.

Failing Item:

- FFC_923
-

923-404 923-404

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_923
 - FFC_821
-

923-501 923-501

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-502 923-502

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
- FFC_821

923-503 923-503

Explanation: The auto-click cannot be disabled.

Failing Item:

- FFC_923

923-504 923-504

Explanation: The auto-click cannot be enabled.

Failing Item:

- FFC_923

923-505 923-505

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_923

923-601 923-601

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

923-602 923-602

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
- FFC_821

923-603 923-603

Explanation: The speaker test failed.

Failing Item:

- FFC_923

923-901 923-901

Explanation: The error log indicates an adapter failed.

Failing Item:

- FFC_821

923-902 923-902

Explanation: The error log analysis indicates a device failure.

Failing Item:

- FFC_923
- FFC_821

923-903 923-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_923
- FFC_821

925-111 925-111

Explanation: An unexpected device error occurred.

Failing Item:

- FFC_925
- FFC_823

925-112 925-112

Explanation: The device disable test failed.

Failing Item:

- FFC_925
- FFC_823

925-113 925-113

Explanation: Could not reset the device.

Failing Item:

- FFC_925

925-114 925-114

Explanation: The Read Status command failed.

Failing Item:

- FFC_925
- FFC_823

925-115 925-115

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-116 925-116

Explanation: Unknown Mouse type.

Failing Item:

- FFC_925
-

925-117 925-117

Explanation: Mouse wrap mode failed.

Failing Item:

- FFC_925
 - FFC_823
-

925-118 925-118

Explanation: Error setting mouse parameters.

Failing Item:

- FFC_925
 - FFC_823
-

925-121 925-121

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-122 925-122

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-123 925-123

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-124 925-124

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-125 925-125

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-126 925-126

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-127 925-127

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-128 925-128

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-129 925-129

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-130 925-130

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-131 925-131

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-132 925-132

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-133 925-133

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-134 925-134

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-135 • 925-152

925-135 925-135

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-136 925-136

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-137 925-137

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-138 925-138

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-139 925-139

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-140 925-140

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-141 925-141

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-142 925-142

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-143 925-143

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-144 925-144

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-145 925-145

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-146 925-146

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-147 925-147

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-148 925-148

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-149 925-149

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-150 925-150

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-151 925-151

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-152 925-152

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-153 925-153

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-154 925-154

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-155 925-155

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-156 925-156

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-157 925-157

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-158 925-158

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-159 925-159

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-160 925-160

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-161 925-161

Explanation: The device test failed.

Failing Item:

- FFC_925

925-162 925-162

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-163 925-163

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-164 925-164

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-165 925-165

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-166 925-166

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-167 925-167

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-168 925-168

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-169 925-169

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-170 925-170

Explanation: The device test failed.

Failing Item:

- FFC_925

925-171 925-171

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-200 925-200

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_925
 - FFC_823
-

925-300 925-300

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_925
-

925-301 925-301

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_925
 - FFC_823
-

926-104 926-104

Explanation: Input device cable is not attached.

Failing Item:

- FFC_926
 - FFC_159
-

926-111 926-111

Explanation: Adapter error.

Failing Item:

- FFC_824
-

926-112 926-112

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-113 926-113

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-114 926-114

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-115 926-115

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-116 926-116

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

926-119 926-119

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

926-121 926-121

Explanation: Adapter error.

Failing Item:

- FFC_824
-

926-131 926-131

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_926
-

926-132 926-132

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-133 926-133

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-134 926-134

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-135 926-135

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-141 926-141

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_926
-

926-142 926-142

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-143 926-143

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-144 926-144

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-145 926-145

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-146 926-146

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-147 926-147

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-148 926-148

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-149 926-149

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-150 926-150

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-151 926-151

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-152 926-152

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-153 926-153

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-154 926-154

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-155 926-155

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-156 926-156

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-157 926-157

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-158 926-158

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-159 926-159

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-160 926-160

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-161 926-161

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-162 926-162

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_926
-

926-163 926-163

Explanation: Error in turning off input device LED.

Failing Item:

- FFC_159
 - FFC_926
-

926-164 926-164

Explanation: Error in turning off input device LED.

Failing Item:

- FFC_159
 - FFC_926
-

926-165 926-165

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

926-166 926-166

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_926
-

926-167 926-167

Explanation: Error in turning off input device LED.

Failing Item:

- FFC_188
 - FFC_926
-

926-168 926-168

Explanation: Error in turning on input device LED.

Failing Item:

- FFC_188
 - FFC_926
-

926-169 926-169

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

926-172 926-172

Explanation: Device or adapter error.

Failing Item:

- FFC_159

- FFC_926

926-173 926-173

Explanation: Error in turning off input device switch.

Failing Item:

- FFC_159
- FFC_926

926-174 926-174

Explanation: Error in turning on input device switch.

Failing Item:

- FFC_159
- FFC_926

926-175 926-175

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

926-176 926-176

Explanation: Device or adapter error.

Failing Item:

- FFC_188
- FFC_926

926-177 926-177

Explanation: Error in turning off input device switch.

Failing Item:

- FFC_188
- FFC_926

926-178 926-178

Explanation: Error in turning on input device switch.

Failing Item:

- FFC_188
- FFC_926

926-179 926-179

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

926-181 926-181

Explanation: Adapter error.

Failing Item:

- FFC_824
- FFC_926

926-182 926-182

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_926

926-183 926-183

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
- FFC_926

926-184 926-184

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

926-186 926-186

Explanation: Device or adapter error.

Failing Item:

- FFC_188
- FFC_926

926-187 926-187

Explanation: The incremental data mode test failed.

Failing Item:

- FFC_188
- FFC_926

926-188 926-188

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

926-203 926-203

Explanation: Error in disabling tablet.

Failing Item:

- FFC_926

926-204 • 926-282

- FFC_824

926-204 926-204

Explanation: Error in enabling tablet.

Failing Item:

- FFC_926
- FFC_824

926-207 926-207

Explanation: Enabled/disabled test failed.

Failing Item:

- FFC_926
- FFC_824

926-208 926-208

Explanation: Enabled/disabled test failed.

Failing Item:

- FFC_926
- FFC_824

926-221 926-221

Explanation: Adapter error.

Failing Item:

- FFC_824

926-222 926-222

Explanation: Device or adapter error.

Failing Item:

- FFC_926
- FFC_824

926-225 926-225

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

926-229 926-229

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

926-271 926-271

Explanation: Adapter error.

Failing Item:

- FFC_926

926-272 926-272

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_926

926-273 926-273

Explanation: Error in input device switch test.

Failing Item:

- FFC_159

926-274 926-274

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

926-276 926-276

Explanation: Device or adapter error.

Failing Item:

- FFC_188
- FFC_926

926-277 926-277

Explanation: Error in input device switch test.

Failing Item:

- FFC_188
- FFC_926

926-278 926-278

Explanation: Input device cable is not attached.

Failing Item:

- FFC_188

926-281 926-281

Explanation: Adapter error.

Failing Item:

- FFC_824
- FFC_926

926-282 926-282

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_926

926-283 926-283

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
 - FFC_926
-

926-284 926-284

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

926-286 926-286

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_926
-

926-287 926-287

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_188
 - FFC_926
-

926-288 926-288

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-104 927-104

Explanation: The input device cable is not attached.

Failing Item:

- FFC_927
 - FFC_159
-

927-111 927-111

Explanation: Adapter error.

Failing Item:

- FFC_824
-

927-112 927-112

Explanation: Device or adapter error.

Failing Item:

- FFC_927
- FFC_824

927-113 927-113

Explanation: Tablet reset failed.

Failing Item:

- FFC_927
 - FFC_824
-

927-114 927-114

Explanation: The read configuration test failed.

Failing Item:

- FFC_927
 - FFC_824
-

927-115 927-115

Explanation: The read status test failed.

Failing Item:

- FFC_927
 - FFC_824
-

927-116 927-116

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-119 927-119

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-121 927-121

Explanation: Adapter error.

Failing Item:

- FFC_824
-

927-122 927-122

Explanation: Device or adapter error.

Failing Item:

- FFC_927
 - FFC_824
-

927-125 927-125

Explanation: The input device cable is not attached.

Failing Item:

- FFC_927
- FFC_824

927-131 • 927-168

927-131 927-131

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_927
-

927-132 927-132

Explanation: Device or adapter error.

Failing Item:

- FFC_927
-

927-133 927-133

Explanation: The set conversion mode test failed.

Failing Item:

- FFC_927
-

927-134 927-134

Explanation: The set resolution test failed.

Failing Item:

- FFC_927
-

927-135 927-135

Explanation: The read status test failed.

Failing Item:

- FFC_927
-

927-141 927-141

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_927
-

927-142 927-142

Explanation: Device or adapter error.

Failing Item:

- FFC_927
-

927-143 927-143

Explanation: Error in tablet indicator.

Failing Item:

- FFC_927
-

927-161 927-161

Explanation: Adapter error.

Failing Item:

- FFC_927
-

927-162 927-162

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_927
-

927-163 927-163

Explanation: Error in turning off input device LED.

Failing Item:

- FFC_159
 - FFC_927
-

927-164 927-164

Explanation: Error in turning on input device LED.

Failing Item:

- FFC_159
 - FFC_927
-

927-165 927-165

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-166 927-166

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_927
-

927-167 927-167

Explanation: Error in turning off input device LED.

Failing Item:

- FFC_188
 - FFC_927
-

927-168 927-168

Explanation: Error in turning on input device LED.

Failing Item:

- FFC_188

- FFC_927

927-169 927-169

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

927-171 927-171

Explanation: Adapter error.

Failing Item:

- FFC_927

927-172 927-172

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_927

927-173 927-173

Explanation: Error in turning off input device switch.

Failing Item:

- FFC_159
- FFC_927

927-174 927-174

Explanation: Error in turning on input device switch.

Failing Item:

- FFC_159
- FFC_927

927-175 927-175

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

927-176 927-176

Explanation: Device or adapter error.

Failing Item:

- FFC_188
- FFC_927

927-177 927-177

Explanation: Error in turning off input device switch.

Failing Item:

- FFC_188

- FFC_927

927-178 927-178

Explanation: Error in turning on input device switch.

Failing Item:

- FFC_188
- FFC_927

927-179 927-179

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

927-181 927-181

Explanation: Adapter error.

Failing Item:

- FFC_824
- FFC_927

927-182 927-182

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_927

927-183 927-183

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
- FFC_927

927-184 927-184

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

927-186 927-186

Explanation: Device or adapter error.

Failing Item:

- FFC_188
- FFC_927

927-187 927-187

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_188
 - FFC_927
-

927-188 927-188

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-203 927-203

Explanation: Error in disabling tablet.

Failing Item:

- FFC_927
 - FFC_824
-

927-204 927-204

Explanation: Error in enabling tablet.

Failing Item:

- FFC_927
 - FFC_824
-

927-221 927-221

Explanation: Adapter error.

Failing Item:

- FFC_824
-

927-222 927-222

Explanation: Device or adapter error.

Failing Item:

- FFC_927
 - FFC_824
-

927-225 927-225

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-229 927-229

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-271 927-271

Explanation: Adapter error.

Failing Item:

- FFC_927
-

927-272 927-272

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_927
-

927-273 927-273

Explanation: Error in input device switch test.

Failing Item:

- FFC_159
 - FFC_927
-

927-274 927-274

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-276 927-276

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_927
-

927-277 927-277

Explanation: Error in input device switch test.

Failing Item:

- FFC_188
 - FFC_927
-

927-278 927-278

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-281 927-281

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_927
-

927-282 927-282

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_927
-

927-283 927-283

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
 - FFC_927
-

927-284 927-284

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-286 927-286

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_927
-

927-287 927-287

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_188
 - FFC_927
-

927-288 927-288

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

929-201 929-201

Explanation: Failed to register input ring.

Failing Item:

- FFC_929
-

929-202 929-202

Explanation: Unable to read event from the device.

Failing Item:

- FFC_929

929-203 929-203

Explanation: Unable to communicate with the device.

Failing Item:

- FFC_929
-

929-204 929-204

Explanation: Cannot set the device granularity.

Failing Item:

- FFC_929
-

929-210 929-210

Explanation: Device or adapter failure.

Failing Item:

- FFC_929
-

929-212 929-212

Explanation: Cannot set the device to HIGH granularity.

Failing Item:

- FFC_929
-

929-213 929-213

Explanation: Cannot set the device to LOW granularity.

Failing Item:

- FFC_929
-

929-299 929-299

Explanation: Error unconfiguring the device.

Failing Item:

- SOFTWARE
 - FFC_929
-

929-301 929-301

Explanation: Error configuring the device.

Failing Item:

- SOFTWARE
 - FFC_929
-

930-201 930-201

Explanation: Device or adapter failure.

Failing Item:

- FFC_930
-

930-210 930-210

Explanation: Unable to turn the lights on.

Failing Item:

- FFC_930
-

930-220 930-220

Explanation: Unable to turn the lights off hardware failure.

Failing Item:

- FFC_930
-

930-230 930-230

Explanation: Unable to turn the lights off.

Failing Item:

- FFC_930
-

930-241 930-241

Explanation: Unable to turn a single light-on.

Failing Item:

- FFC_930
-

930-242 930-242

Explanation: Device or adapter failure.

Failing Item:

- FFC_930
-

930-243 930-243

Explanation: Device or adapter failure.

Failing Item:

- FFC_930
-

930-261 930-261

Explanation: Cable test failed.

Failing Item:

- FFC_930
-

930-262 930-262

Explanation: Cable test failed.

Failing Item:

- FFC_930
-

930-299 930-299

Explanation: Error unconfiguring the device.

Failing Item:

- SOFTWARE
 - FFC_930
-

930-301 930-301

Explanation: Error configuring the device.

Failing Item:

- SOFTWARE
 - FFC_930
-

935-101 935-101

Explanation: The diskette-drive select or deselect test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-102 935-102

Explanation: The diskette-drive select or deselect test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-103 935-103

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-104 935-104

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-105 935-105

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-106 935-106

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-107 935-107

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-108 935-108

Explanation: The diskette read test failed.

Failing Item:

- FFC_935
-

935-109 935-109

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-110 935-110

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-111 935-111

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935
-

935-112 935-112

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935
-

935-113 935-113

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935

935-114 935-114

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935
-

935-115 935-115

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-116 935-116

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-117 935-117

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-118 935-118

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-119 935-119

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-120 935-120

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-121 935-121

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-122 935-122

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_935
 - FFC_828
-

935-123 935-123

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_935
-

935-124 935-124

Explanation: Unable to configure the device.

Failing Item:

- FFC_935
 - SOFTWARE
-

938-101 938-101

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-104 938-104

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-105 938-105

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-108 938-108

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-109 938-109

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-10A 938-10A

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-10B 938-10B

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-10C 938-10C

Explanation: HIPPI Adapter test failed.

Failing Item:

- WRAP_PLUG
 - FFC_938
-

938-124 938-124

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-600 938-600

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
 - SOFTWARE
-

938-800 938-800

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

945-102 945-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_945
-

945-104 945-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_945
-

945-105 945-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_945
-

945-106 945-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_945
-

945-108 945-108

Explanation: The bus test failed.

Failing Item:

- FFC_945
-

945-110 945-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_945
-

945-112 945-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_945
-

945-114 945-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_945
-

945-116 945-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_945
-

945-117 945-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_945
-

945-118 945-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_945
 - FFC_B88
-

945-120 945-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_945
-

945-122 945-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_945
-

945-124 945-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_945
-

945-126 945-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_945
-

- FFC_B88

945-128 945-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_945
- SOFTWARE

945-129 945-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_945
- SOFTWARE

945-130 945-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_945

945-132 945-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_945

945-133 945-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

945-134 945-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

945-135 945-135

Explanation: The device failed to configure.

Failing Item:

- FFC_945
- FFC_B88
- SOFTWARE

945-136 945-136

Explanation: The certify operation failed.

Failing Item:

- FFC_945

945-137 945-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_945
- FFC_B88
- FFC_190

945-138 945-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_945

945-140 945-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_945

945-640 945-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

946-111 **946-111**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_227
-

946-114 **946-114**

Explanation: The register verification test failed.

Failing Item:

- FFC_946
-

946-121 **946-121**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_227
-

946-122 **946-122**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
 - FFC_227
-

946-123 **946-123**

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
 - FFC_227
-

946-131 **946-131**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
-

946-132 **946-132**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
 - FFC_227
-

946-133 **946-133**

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-161 **946-161**

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_252
-

946-162 **946-162**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_252
-

946-163 **946-163**

Explanation: The modem control line test failed.

Failing Item:

- FFC_252
-

946-171 **946-171**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

946-172 **946-172**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

946-173 **946-173**

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

946-181 **946-181**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

946-182 **946-182**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261

946-183 **946-183**

Explanation: The modem control line test failed.

Failing Item:

- FFC_261

946-271 **946-271**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
- FFC_259

946-272 **946-272**

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_946
- FFC_259

946-273 **946-273**

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
- FFC_259

946-281 **946-281**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
- FFC_261

946-282 **946-282**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
- FFC_261

946-283 **946-283**

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
- FFC_261

946-321 **946-321**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946

946-322 **946-322**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946

946-323 **946-323**

Explanation: The modem control line test failed.

Failing Item:

- FFC_946

946-331 **946-331**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946

946-332 **946-332**

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946

946-333 **946-333**

Explanation: The modem control line test failed.

Failing Item:

- FFC_946

946-371 **946-371**

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946

946-372 946-372

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
-

946-373 946-373

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-381 946-381

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
-

946-382 946-382

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
-

946-383 946-383

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-481 946-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

946-482 946-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

946-483 946-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56
-

946-581 946-581

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_D56
-

946-582 946-582

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_946
 - FFC_D56
-

946-583 946-583

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
 - FFC_D56
-

946-901 946-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-902 946-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-903 **946-903**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-904 **946-904**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-905 **946-905**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-906 **946-906**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_946

946-907 **946-907**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-908 **946-908**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-909 **946-909**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-910 **946-910**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-911 **946-911**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-912 **946-912**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-913 **946-913**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-914 **946-914**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-915 **946-915**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-916 **946-916**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-917 **946-917**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-918 **946-918**

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General

problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-919 946-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-920 946-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-921 946-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_946
- SOFTWARE

946-922 946-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-923 946-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-924 946-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-925 946-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_946
- SOFTWARE

946-926 946-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-927 946-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-928 946-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-929 946-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-930 946-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-931 946-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-932 946-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-933 946-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-934 946-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_946

946-935 946-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-936 946-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-937 946-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-938 946-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-939 946-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-940 946-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-941 946-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-942 946-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-943 946-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

950-100 950-100

Explanation: Power supply problem.

Response: Use the service documentation for the portable disk.

Failing Item:

- FFC_192

950-101 950-101

Explanation: PCI bus was not found.

Response: Rerun diagnostics in Advanced Mode for additional problem isolation.

Failing Item:

- FFC_2C9
- FFC_153

950-102 950-102

Explanation: PCI bus was not found.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2C9

950-103 950-103

Explanation: Multiple adapters on bus were not found.

Failing Item:

- FFC_2C9

950-105 950-105

Explanation: PCI bus was not found.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2C9
- FFC_221

950-106 950-106

Explanation: PCI bus was not found.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2C9

950-107 950-107

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_153
- FFC_165

950-108 950-108

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_190
- FFC_199
- FFC_153
- FFC_165

950-200 950-200

Explanation: Power supply problem.

Response: Use the service documentation for the external device.

Failing Item:

- FFC_152

950-201 950-201

Explanation: SCSI bus problem.

Response: Refer to MAP2010 in the 7134 High Density SCSI Disk Subsystem Installation and Service Guide

Failing Item:

- SCSI_BUS

950-400 950-400

Explanation: Power supply problem.

Response: Use the service documentation for the drawer/tower containing the failing power supply. If the drawer/deskside unit service documentation does not isolate the problem, go to Power problem isolation for your system.

Failing Item:

- FFC_153

950-440 950-440

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_440
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-441 950-441

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_441
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-442 950-442

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_442
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-443 950-443

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_443
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-451 950-451

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_451
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-500 950-500

Explanation: Power supply problem.

Response: Use the service documentation for the system unit, rack, or drawer that contains the missing device.

Failing Item:

- FFC_152

950-56D 950-56D

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_56D
- FFC_B88
- FFC_190
- FFC_152

950-58D 950-58D

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_58D

- FFC_B88
- FFC_190
- FFC_152

950-61D **950-61D**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_61D
- FFC_B88
- FFC_190
- FFC_152

950-638 **950-638**

Explanation: The SCSI device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_638
- FFC_B88
- FFC_277
- FFC_190
- FFC_152

950-639 **950-639**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_639
- FFC_B88
- FFC_190
- FFC_152

950-63A **950-63A**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63A
- FFC_B88
- FFC_190
- FFC_152

950-63B **950-63B**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63B
- FFC_B88
- FFC_190
- FFC_152

950-63C **950-63C**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63C
- FFC_B88
- FFC_190
- FFC_152

950-63D **950-63D**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63D
- FFC_B88
- FFC_190
- FFC_152

950-63E **950-63E**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63E
- FFC_B88
- FFC_277
- FFC_190
- FFC_152

950-63F **950-63F**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

950-640 • 950-703

- FFC_63F
- FFC_B88
- FFC_190
- FFC_152

950-640 950-640

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_640
- FFC_B88
- FFC_190
- FFC_152

950-664 950-664

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_664
- FFC_B88
- FFC_190
- FFC_152

950-678 950-678

Explanation: The SCSI Tape Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_678
- FFC_B88
- FFC_190
- FFC_152

950-679 950-679

Explanation: The SCSI Disk Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_679
- FFC_B88
- FFC_190
- FFC_152

950-681 950-681

Explanation: The SCSI Disk Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_681
- FFC_2E7
- FFC_190
- FFC_152

950-700 950-700

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_700
- FFC_B88
- FFC_190
- FFC_152

950-701 950-701

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_701
- FFC_B88
- FFC_190
- FFC_152

950-702 950-702

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_702
- FFC_B88
- FFC_190
- FFC_152

950-703 950-703

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_703

- FFC_B88
- FFC_190
- FFC_152

950-704 **950-704**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_704
- FFC_B88
- FFC_190
- FFC_152

950-705 **950-705**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_705
- FFC_B88
- FFC_190
- FFC_152

950-706 **950-706**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_706
- FFC_B88
- FFC_190
- FFC_152

950-707 **950-707**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_707
- FFC_B88
- FFC_190
- FFC_152

950-721 **950-721**

Explanation: An unknown drive type is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_721
- FFC_B88
- FFC_190
- FFC_152

950-722 **950-722**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_722
- FFC_B88
- FFC_190
- FFC_152

950-723 **950-723**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_723
- FFC_B88
- FFC_190
- FFC_152

950-724 **950-724**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_724
- FFC_B88
- FFC_190
- FFC_152

950-734 **950-734**

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

950-741 • 950-912

- FFC_734
- FFC_B88
- FFC_190
- FFC_152

950-741 950-741

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_741
- FFC_B88
- FFC_190
- FFC_152

950-772 950-772

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_772
- FFC_B88
- FFC_190
- FFC_152

950-773 950-773

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_773
- FFC_B88
- FFC_190
- FFC_152

950-789 950-789

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_789
- FFC_B88
- FFC_190
- FFC_152

950-792 950-792

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_792
- FFC_B88
- FFC_190
- FFC_152

950-793 950-793

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_793
- FFC_B88
- FFC_190
- FFC_152

950-804 950-804

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_804
- FFC_B88
- FFC_190
- FFC_152

950-807 950-807

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_804
- FFC_B88
- FFC_190
- FFC_152

950-912 950-912

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_912

- FFC_B88
- FFC_190
- FFC_152

950-914 **950-914**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_914
- FFC_B88
- FFC_190
- FFC_152

950-915 **950-915**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_915
- FFC_B88
- FFC_190
- FFC_152

950-917 **950-917**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_917
- FFC_B88
- FFC_190
- FFC_152

950-918 **950-918**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_918
- FFC_B88
- FFC_190
- FFC_152

950-935 **950-935**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_935
- FFC_B88
- FFC_190
- FFC_152

950-951 **950-951**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_951
- FFC_B88
- FFC_190
- FFC_152

950-952 **950-952**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_952
- FFC_B88
- FFC_190
- FFC_152

950-953 **950-953**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_953
- FFC_B88
- FFC_190
- FFC_152

950-954 **950-954**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_954

950-955 • 950-972

- FFC_B88
- FFC_190
- FFC_152

950-955 950-955

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_955
- FFC_B88
- FFC_141
- FFC_190
- FFC_152

950-956 950-956

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_956
- FFC_B88
- FFC_190
- FFC_152

950-959 950-959

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_959
- FFC_B88
- FFC_190
- FFC_152

950-960 950-960

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_960
- FFC_B88
- FFC_190
- FFC_152

950-964 950-964

Explanation: The SCSI Tape Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_964
- FFC_B88
- FFC_190
- FFC_152

950-968 950-968

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_968
- FFC_B88
- FFC_190
- FFC_152

950-970 950-970

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_970
- FFC_B88
- FFC_190
- FFC_152

950-971 950-971

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_971
- FFC_B88
- FFC_190
- FFC_152

950-972 950-972

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_972

- FFC_B88
- FFC_190
- FFC_152

950-974 **950-974**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_974
- FFC_B88
- FFC_190
- FFC_152

950-981 **950-981**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_981
- FFC_B88
- FFC_190
- FFC_152

950-984 **950-984**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_984
- FFC_B88
- FFC_190
- FFC_152

950-986 **950-986**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_986
- FFC_B88
- FFC_190
- FFC_152

950-987 **950-987**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_987
- FFC_B88
- FFC_190
- FFC_152

950-989 **950-989**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_989
- FFC_B88
- FFC_190
- FFC_152

950-990 **950-990**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_990
- FFC_B88
- FFC_190
- FFC_152

950-991 **950-991**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_991
- FFC_B88
- FFC_190
- FFC_152

950-994 **950-994**

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_994

950-995 • 951-120

- FFC_B88
- FFC_190
- FFC_152

950-995 950-995

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_995
- FFC_B88
- FFC_190
- FFC_152

950-998 950-998

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_998
- FFC_B88
- FFC_190
- FFC_152

951-102 951-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_951

951-104 951-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_951

951-105 951-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_951

951-106 951-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_951

951-108 951-108

Explanation: The bus test failed.

Failing Item:

- FFC_951

951-110 951-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_951

951-112 951-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_951

951-114 951-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_951

951-116 951-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_951

951-117 951-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_951

951-118 951-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_951
- FFC_B88

951-120 951-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_951

951-122 951-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_951
-

951-124 951-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_951
-

951-126 951-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_951
 - FFC_B88
-

951-128 951-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_951
 - SOFTWARE
-

951-129 951-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_951
 - SOFTWARE
-

951-130 951-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_951
-

951-132 951-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_951
-

951-133 951-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

951-134 951-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

951-135 951-135

Explanation: The device failed to configure.

Failing Item:

- FFC_951
 - FFC_B88
 - SOFTWARE
-

951-136 951-136

Explanation: The certify operation failed.

Failing Item:

- FFC_951
-

951-137 951-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_951
 - FFC_B88
 - FFC_190
-

951-138 951-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_951
-

951-140 951-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_951

951-640 951-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

952-102 952-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_952

952-104 952-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_952

952-105 952-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_952

952-106 952-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_952

952-108 952-108

Explanation: The bus test failed.

Failing Item:

- FFC_952

952-110 952-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_952

952-112 952-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_952

952-114 952-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_952

952-116 952-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_952

952-117 952-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_952

952-118 952-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_952
- FFC_B88

952-120 952-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_952

952-122 952-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_952

952-124 952-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_952

952-126 952-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_952
 - FFC_B88
-

952-128 952-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_952
 - SOFTWARE
-

952-129 952-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_952
 - SOFTWARE
-

952-130 952-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_952
-

952-132 952-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_952
-

952-133 952-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_952
-

952-134 952-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE
-

952-135 952-135

Explanation: The device failed to configure.

Failing Item:

- FFC_952
 - FFC_B88
 - SOFTWARE
-

952-136 952-136

Explanation: The certify operation failed.

Failing Item:

- FFC_952
-

952-137 952-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_952
 - FFC_B88
 - FFC_190
-

952-138 952-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_952
-

952-140 952-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_952
-

952-640 952-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

953-102 953-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_953
-

953-104 953-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_953
-

953-105 953-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_953
-

953-106 953-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_953
-

953-108 953-108

Explanation: The bus test failed.

Failing Item:

- FFC_953
-

953-110 953-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_953
-

953-112 953-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_953
-

953-114 953-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_953
-

953-116 953-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_953
-

953-117 953-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_953
-

953-118 953-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_953
 - FFC_B88
-

953-120 953-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_953
-

953-122 953-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_953
-

953-124 953-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_953
-

953-126 953-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_953
 - FFC_B88
-

953-128 953-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_953
- SOFTWARE

953-129 953-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_953
 - SOFTWARE
-

953-130 953-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_953
-

953-132 953-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_953
-

953-133 953-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_953
-

953-134 953-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

953-135 953-135

Explanation: The device failed to configure.

Failing Item:

- FFC_953
 - FFC_B88
 - SOFTWARE
-

953-136 953-136

Explanation: The certify operation failed.

Failing Item:

- FFC_953
-

953-137 953-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_953
 - FFC_B88
 - FFC_190
-

953-138 953-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_953
-

953-140 953-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_953
-

953-640 953-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

954-102 954-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_954
-

954-104 954-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_954
-

954-105 954-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_954
-

954-106 954-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_954
-

954-108 954-108

Explanation: The bus test failed.

Failing Item:

- FFC_954
-

954-110 954-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_954
-

954-112 954-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_954
-

954-114 954-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_954
-

954-116 954-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_954
-

954-117 954-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_954
-

954-118 954-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_954
- FFC_B88

954-120 954-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_954
-

954-122 954-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_954
-

954-124 954-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_954
-

954-126 954-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_954
 - FFC_B88
-

954-128 954-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_954
 - SOFTWARE
-

954-129 954-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_954
 - SOFTWARE
-

954-130 954-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_954

954-132 954-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_954
-

954-133 954-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

954-134 954-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

954-135 954-135

Explanation: The device failed to configure.

Failing Item:

- FFC_954
 - FFC_B88
 - SOFTWARE
-

954-136 954-136

Explanation: The certify operation failed.

Failing Item:

- FFC_954
-

954-137 954-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_954
 - FFC_B88
 - FFC_190
-

954-138 954-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_954
-

954-140 954-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_954
-

954-640 954-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

955-102 955-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_955
-

955-104 955-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_955
-

955-105 955-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_955
-

955-106 955-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_955
-

955-108 955-108

Explanation: The bus test failed.

Failing Item:

- FFC_955
-

955-110 955-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_955

 955-112 955-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_955
-

955-114 955-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_955
-

955-116 955-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_955
-

955-117 955-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_955
-

955-118 955-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_955
 - FFC_B88
-

955-120 955-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_955
-

955-122 955-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_955
-

955-124 955-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_955
-

 955-126 955-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_955
 - FFC_B88
-

955-128 955-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_955
 - SOFTWARE
-

955-129 955-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_955
 - SOFTWARE
-

955-130 955-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_955
-

955-132 955-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_955
-

955-133 955-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_955
-

955-134 955-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

955-135 955-135

Explanation: The device failed to configure.

Failing Item:

- FFC_955
 - FFC_B88
 - SOFTWARE
-

955-136 955-136

Explanation: The certify operation failed.

Failing Item:

- FFC_955
-

955-137 955-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_955
 - FFC_B88
 - FFC_190
-

955-138 955-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_955
-

955-140 955-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_955
-

955-640 955-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

956-102 956-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_956
-

956-104 956-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_956
-

956-105 956-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_956
-

956-106 956-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_956
-

956-108 956-108

Explanation: The bus test failed.

Failing Item:

- FFC_956
-

956-110 956-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_956
-

956-112 956-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_956
-

956-114 956-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_956
-

956-116 956-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

956-117 • 956-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_956
-

956-117 956-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_956
-

956-118 956-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_956
 - FFC_B88
-

956-120 956-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_956
-

956-122 956-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_956
-

956-124 956-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_956
-

956-126 956-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_956
 - FFC_B88
-

956-128 956-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_956
 - SOFTWARE
-

956-129 956-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_956
 - SOFTWARE
-

956-130 956-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_956
-

956-132 956-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_956
-

956-133 956-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

956-134 956-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

956-135 956-135

Explanation: The device failed to configure.

Failing Item:

- FFC_956
 - FFC_B88
 - SOFTWARE
-

956-136 956-136

Explanation: The certify operation failed.

Failing Item:

- FFC_956
-

956-137 956-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_956
 - FFC_B88
 - FFC_190
-

956-138 956-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_956
-

956-140 956-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_956
-

956-640 956-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

957-102 957-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_957
-

957-104 957-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_957
-

957-105 957-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_957

957-106 957-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_957
-

957-108 957-108

Explanation: The bus test failed.

Failing Item:

- FFC_957
-

957-110 957-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_957
-

957-112 957-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_957
-

957-114 957-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_957
-

957-116 957-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_957
-

957-117 957-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_957
-

957-118 957-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_957
- FFC_B88

 957-120 957-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_957
-

957-122 957-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_957
-

957-124 957-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_957
-

957-126 957-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_957
 - FFC_B88
-

957-128 957-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_957
 - SOFTWARE
-

957-129 957-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_957
 - SOFTWARE
-

957-130 957-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_957

 957-132 957-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_957
-

957-133 957-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_957
-

957-134 957-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

957-135 957-135

Explanation: The device failed to configure.

Failing Item:

- FFC_957
 - FFC_B88
 - SOFTWARE
-

957-136 957-136

Explanation: The certify operation failed.

Failing Item:

- FFC_957
-

957-137 957-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_957
 - FFC_B88
 - FFC_190
-

957-138 957-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_957

957-140 957-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_957
-

957-640 957-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

959-102 959-102

Explanation: Non-recoverable medium error.

Failing Item:

- FFC_959
-

959-104 959-104

Explanation: Motor failed to restart.

Failing Item:

- FFC_959
-

959-105 959-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_959
-

959-106 959-106

Explanation: Electronics card failure.

Failing Item:

- FFC_959
-

959-108 959-108

Explanation: Bus failure.

Failing Item:

- FFC_959
-

959-110 959-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_959
-

959-112 959-112

Explanation: Diagnostic failure.

Failing Item:

- FFC_959
-

959-114 959-114

Explanation: Non-recoverable hardware error.

Failing Item:

- FFC_959
-

959-116 959-116

Explanation: A protocol error was detected.

Response: Check the levels of the device, adapter, diagnostic and application software, and ensure they are all compatible. If you do not find a problem, call your support person.

959-117 959-117

Explanation: write-protect error.

Failing Item:

- FFC_959
-

959-118 959-118

Explanation: SCSI command timeout.

Failing Item:

- FFC_959
 - FFC_B88
-

959-120 959-120

Explanation: SCSI busy/command error.

Failing Item:

- FFC_959
-

959-122 959-122

Explanation: SCSI reservation conflict error.

Failing Item:

- FFC_959
-

959-124 959-124

Explanation: SCSI check condition error.

Failing Item:

- FFC_959
-

959-126 959-126

Explanation: Software error caused by hardware failure.

Failing Item:

- FFC_959
 - FFC_B88
-

959-128 959-128

Explanation: Error log analysis indicates hardware failure.

Failing Item:

- FFC_959
-

959-129 959-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_959
 - FFC_B88
 - SOFTWARE
-

959-130 959-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_959
-

959-134 959-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

959-135 959-135

Explanation: The device failed to configure.

Failing Item:

- FFC_959
 - FFC_B88
 - SOFTWARE
-

959-136 959-136

Explanation: The certify operation failed.

Failing Item:

- FFC_959
-

959-137 959-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_959
 - FFC_B88
 - FFC_190
-

960-102 960-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_960
-

960-104 960-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_960
-

960-105 960-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_960
-

960-106 960-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_960
-

960-108 960-108

Explanation: The bus test failed.

Failing Item:

- FFC_960
-

960-110 960-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_960
-

960-112 960-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_960
-

960-114 960-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_960
-

960-116 960-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_960
-

960-117 960-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_960
-

960-118 960-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_960
 - FFC_B88
-

960-120 960-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_960
-

960-122 960-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_960
-

960-124 960-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_960
-

960-126 960-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_960
-

- FFC_B88
-

960-128 960-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_960
 - SOFTWARE
-

960-129 960-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_960
 - SOFTWARE
-

960-130 960-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_960
-

960-132 960-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_960
-

960-133 960-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_960
-

960-134 960-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

960-135 960-135

Explanation: The device failed to configure.

Failing Item:

- FFC_960
 - FFC_B88
 - SOFTWARE
-

960-136 960-136

Explanation: The certify operation failed.

Failing Item:

- FFC_960
-

960-137 960-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_960
 - FFC_B88
 - FFC_190
-

960-138 960-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_960
-

960-140 960-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_960
-

960-640 960-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

964-101 964-101

Explanation: Timeout while attempting to communicate with SCSI device.

Failing Item:

- FFC_964
-

964-102 964-102

Explanation: The SCSI device indicates busy.

Failing Item:

- FFC_964
-

964-103 964-103

Explanation: The SCSI device indicates a reservation conflict.

Failing Item:

- FFC_964
-

964-104 964-104

Explanation: The SCSI device indicates a check condition.

Failing Item:

- FFC_964
-

964-105 964-105

Explanation: An error is detected in request sense data.

Failing Item:

- FFC_964
-

964-107 964-107

Explanation: Sense data from the SCSI drive has unexpected data.

Failing Item:

- FFC_964
-

964-110 964-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_964
-

964-111 964-111

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_964

964-112 **964-112**

Explanation: The write-protect sensor test failed.

Failing Item:

- FFC_964
-

964-113 **964-113**

Explanation: Invalid condition from drive after a request sense.

Failing Item:

- FFC_964
-

964-114 **964-114**

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_964
-

964-120 **964-120**

Explanation: The Inquiry command failed.

Failing Item:

- FFC_964
-

964-130 **964-130**

Explanation: The Load command failed.

Failing Item:

- FFC_964
 - MEDIA
-

964-134 **964-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

964-135 **964-135**

Explanation: The Unload command failed.

Failing Item:

- FFC_964
 - MEDIA
-

964-140 **964-140**

Explanation: The Mode Select command failed.

Failing Item:

- FFC_964
-

964-150 **964-150**

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_964
 - MEDIA
-

964-160 **964-160**

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_964
 - MEDIA
-

964-161 **964-161**

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_964
 - FFC_B88
-

964-163 **964-163**

Explanation: Invalid condition from the drive after a request sense.

Failing Item:

- FFC_964
 - FFC_B88
-

964-164 **964-164**

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_964
 - FFC_B88
-

964-165 **964-165**

Explanation: Write, Read and Compare Test failed.

Failing Item:

- FFC_964
 - FFC_B88
 - FFC_276
-

964-166 **964-166**

Explanation: Unable to configure the device.

Failing Item:

- FFC_964
 - FFC_B88
-

964-167 • 964-260

- SOFTWARE

964-167 964-167

Explanation: An unexpected SCSI error occurred.

Failing Item:

- FFC_964
- FFC_B88

964-168 964-168

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

964-169 964-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_964
- MEDIA

964-170 964-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_964
- FFC_B88
- MEDIA

964-180 964-180

Explanation: The Load command failed.

Failing Item:

- FFC_964
- MEDIA

964-185 964-185

Explanation: The Unload command failed.

Failing Item:

- FFC_964
- MEDIA

964-190 964-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_964

964-200 964-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_964
- MEDIA

964-201 964-201

Explanation: Error diagnosed from error log analysis.

Failing Item:

- FFC_964
- FFC_B88

964-210 964-210

Explanation: The device configuration failed.

Failing Item:

- FFC_964
- FFC_B88

964-211 964-211

Explanation: The device open failed.

Failing Item:

- FFC_964
- FFC_B88

964-220 964-220

Explanation: The Release command failed.

Failing Item:

- FFC_964

964-230 964-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_964

964-240 964-240

Explanation: The Openx command failed.

Failing Item:

- FFC_964

964-260 964-260

Explanation: The device configuration failed.

Failing Item:

- FFC_964
-

964-261 **964-261****Explanation:** The device open failed.**Failing Item:**

- FFC_964
-

964-300 **964-300****Explanation:** The device configuration failed.**Failing Item:**

- FFC_964
 - SOFTWARE
-

964-310 **964-310****Explanation:** SCSI adapter configuration failed.**Failing Item:**

- FFC_B88
 - FFC_964
 - SOFTWARE
-

964-320 **964-320****Explanation:** Error log analysis indicates a failure.**Failing Item:**

- FFC_964
 - MEDIA
-

964-411 **964-411****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-412 **964-412****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-413 **964-413****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-414 **964-414****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-415 **964-415****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-416 **964-416****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-417 **964-417****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-418 **964-418****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-419 **964-419****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-420 964-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-421 964-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-422 964-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-423 964-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-511 964-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-512 964-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-513 964-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-514 964-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-515 964-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-516 964-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-517 964-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-518 964-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-519 964-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-520 **964-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-521 **964-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-522 **964-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-523 **964-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-611 **964-611**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-612 **964-612**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-613 **964-613**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-614 **964-614**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-615 **964-615**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-616 **964-616**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-617 **964-617**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-618 **964-618**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-619 964-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-620 964-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-621 964-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-622 964-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-623 964-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-711 964-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-712 964-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-713 964-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-714 964-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-715 964-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-716 964-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-717 964-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-718 964-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-719 964-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-720 964-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-721 964-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-722 964-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-723 964-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

966-101 966-101

Explanation: Error in non-interactive tests.

Failing Item:

- FFC_966
-

966-103 966-103

Explanation: The test pattern failed.

Failing Item:

- FFC_966
-

966-201 966-201

Explanation: Error in non-interactive tests on card.

Failing Item:

- FFC_966
 - FFC_190
-

966-203 966-203

Explanation: The test pattern failed.

Failing Item:

- FFC_966
 - FFC_190
-

966-205 966-205

Explanation: Test pattern failed.

Failing Item:

- FFC_966
 - FFC_190
-

966-207 966-207

Explanation: Test pattern failed.

Failing Item:

- FFC_966
 - FFC_190
-

966-208 966-208

Explanation: Error in non-interactive test on card.

Failing Item:

- FFC_190
-

966-209 966-209

Explanation: Test pattern failed.

Failing Item:

- FFC_190
-

966-211 966-211

Explanation: Test pattern failed.

Failing Item:

- FFC_190
-

966-213 966-213

Explanation: Test pattern failed.

Failing Item:

- FFC_190
-

966-304 966-304

Explanation: Video error in interactive test.

Failing Item:

- FFC_E22
 - FFC_725
 - FFC_966
-

966-306 966-306

Explanation: Audio error in interactive test.

Failing Item:

- FFC_E23
 - FFC_725
 - FFC_966
-

966-310 966-310

Explanation: Video error in interactive test.

Failing Item:

- FFC_E22
 - FFC_725
-

966-312 966-312

Explanation: Audio error in interactive test.

Failing Item:

- FFC_E22
 - FFC_725
-

966-400 966-400

Explanation: Error in non-interactive tests.

Failing Item:

- FFC_152
 - FFC_190
 - FFC_E24
 - FFC_166
-

966-402 966-402

Explanation: Test pattern failed.

Failing Item:

- FFC_190
 - FFC_E23
 - FFC_E22
-

968-102 968-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_968
-

968-104 968-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_968
-

968-105 968-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_968
-

968-106 968-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_968
-

968-108 968-108

Explanation: The bus test failed.

Failing Item:

- FFC_968
-

968-110 968-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_968
-

968-112 968-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_968
-

968-114 968-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_968
-

968-116 968-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_968
-

968-117 968-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_968
-

968-118 968-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_968
 - FFC_B88
-

968-120 968-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_968
-

968-122 968-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_968
-

968-124 968-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_968
-

968-126 968-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_968

- FFC_B88
-

968-128 968-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_968
 - SOFTWARE
-

968-129 968-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_968
 - SOFTWARE
-

968-130 968-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_968
-

968-132 968-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_968
-

968-133 968-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_968
-

968-134 968-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

 968-135 968-135

Explanation: The device failed to configure.

Failing Item:

- FFC_968
 - FFC_B88
 - SOFTWARE
-

968-136 968-136

Explanation: The certify operation failed.

Failing Item:

- FFC_968
-

968-137 968-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_968
 - FFC_B88
 - FFC_190
-

968-138 968-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_968
-

968-140 968-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_968
-

968-640 968-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

 970-110 970-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_970
-

970-120 970-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_970
-

970-130 970-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-131 970-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_970
-

970-135 970-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-136 970-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-140 970-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_970

970-150 970-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-151 970-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-160 970-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-168 970-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-169 970-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-16L 970-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-170 970-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- FFC_B88
- MEDIA

970-171 970-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

970-180 • 970-211

- MEDIA
- FFC_970
- FFC_B88

970-180 970-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-181 970-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-185 970-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-186 970-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-190 970-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_970

970-200 970-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-201 970-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-210 970-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-211 970-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-220 970-220

Explanation: The Release command failed.

Failing Item:

- FFC_970
-

970-230 970-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_970
-

970-240 970-240

Explanation: The Openx command failed.

Failing Item:

- FFC_970
-

970-300 970-300

Explanation: The device configuration failed.

Failing Item:

- FFC_970
 - SOFTWARE
-

970-310 970-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_970
 - SOFTWARE
-

970-320 970-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-321 970-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_970
-

970-411 970-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-412 970-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-413 970-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-414 970-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-415 970-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-416 970-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-417 970-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-418 970-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-419 970-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-41A 970-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-41B 970-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-41C 970-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-41D 970-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-41E 970-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-41F 970-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-420 970-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-421 970-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-422 970-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-423 970-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-511 970-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-512 970-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-513 970-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-514 970-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-515 970-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-516 970-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-517 970-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-518 970-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-519 970-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-51A 970-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-51B 970-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-51C 970-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-51D • 970-616

970-51D 970-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51E 970-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51F 970-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-520 970-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-521 970-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-522 970-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-523 970-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-611 970-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-612 970-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-613 970-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-614 970-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-615 970-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-616 970-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-617 **970-617**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-618 **970-618**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-619 **970-619**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-61A **970-61A**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-61B **970-61B**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-61C **970-61C**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-61D **970-61D**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-61E **970-61E**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-61F **970-61F**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-620 **970-620**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-621 **970-621**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-622 **970-622**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-623 970-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-711 970-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-712 970-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-713 970-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-714 970-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-715 970-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-716 970-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-717 970-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-718 970-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-719 970-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-71A 970-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-71B 970-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71C **970-71C****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71D **970-71D****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71E **970-71E****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71F **970-71F****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-720 **970-720****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-721 **970-721****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-722 **970-722****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-723 **970-723****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_970
 - FFC_B88
 - SOFTWARE
-

971-110 **971-110****Explanation:** The Reserve command failed.**Failing Item:**

- FFC_971
-

971-120 **971-120****Explanation:** The Inquiry command failed.**Failing Item:**

- FFC_971
-

971-130 **971-130****Explanation:** The Load command failed.**Response:** Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_971
 - MEDIA
-

971-131 **971-131****Explanation:** The Load command failed.**Response:** Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.**Failing Item:**

- MEDIA
 - FFC_971
-

971-135 971-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-136 971-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-140 971-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_971

971-150 971-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-151 971-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-160 971-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-168 971-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-169 971-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-16L 971-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-170 971-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- FFC_B88
- MEDIA

971-171 971-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971
- FFC_B88

971-180 971-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-181 971-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-185 971-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-186 971-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-190 971-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_971

971-200 971-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-201 971-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-210 971-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

971-211 • 971-414

- FFC_971
- MEDIA

971-211 971-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-220 971-220

Explanation: The Release command failed.

Failing Item:

- FFC_971

971-230 971-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_971

971-240 971-240

Explanation: The Openx command failed.

Failing Item:

- FFC_971

971-300 971-300

Explanation: The device configuration failed.

Failing Item:

- FFC_971
- SOFTWARE

971-310 971-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_971
- SOFTWARE

971-320 971-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-321 971-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-411 971-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-412 971-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-413 971-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-414 971-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-415 **971-415****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-416 **971-416****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-417 **971-417****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-418 **971-418****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-419 **971-419****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-41A **971-41A****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-41B **971-41B****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-41C **971-41C****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-41D **971-41D****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-41E **971-41E****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-41F **971-41F****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-420 **971-420****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-421 • 971-51A

971-421 971-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-422 971-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-423 971-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-511 971-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-512 971-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-513 971-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-514 971-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-515 971-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-516 971-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-517 971-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-518 971-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-519 971-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-51A 971-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-51B **971-51B**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-51C **971-51C**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-51D **971-51D**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-51E **971-51E**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-51F **971-51F**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-520 **971-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-521 **971-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-522 **971-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-523 **971-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-611 **971-611**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-612 **971-612**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-613 **971-613**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-614 • 971-61F

971-614 971-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-615 971-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-616 971-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-617 971-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-618 971-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-619 971-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-61A 971-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-61B 971-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-61C 971-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-61D 971-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-61E 971-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-61F 971-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-620 971-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-621 971-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-622 971-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-623 971-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-711 971-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-712 971-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-713 971-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-714 971-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-715 971-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-716 971-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-717 971-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-718 971-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-719 **971-719**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71A **971-71A**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71B **971-71B**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71C **971-71C**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71D **971-71D**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71E **971-71E**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71F **971-71F**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-720 **971-720**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-721 **971-721**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-722 **971-722**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-723 **971-723**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

972-110 **972-110**

Explanation: The Reserve command failed.

Failing Item:

- FFC_972

972-120 **972-120**

Explanation: The Inquiry command failed.

Failing Item:

- FFC_972

 972-130 972-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
 - MEDIA
-

972-131 972-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_972
-

972-135 972-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
 - MEDIA
-

972-136 972-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_972
-

972-140 972-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_972
-

972-150 972-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
 - MEDIA
-

972-151 972-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_972
-

972-160 972-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
 - MEDIA
-

972-168 972-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_972
-

972-169 972-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-16L 972-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-170 972-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- FFC_B88
- MEDIA

972-171 972-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972
- FFC_B88

972-180 972-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-181 972-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-185 972-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-186 972-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-190 972-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_972

972-200 972-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-201 972-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-210 972-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-211 972-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-220 972-220

Explanation: The Release command failed.

Failing Item:

- FFC_972

972-230 972-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_972

972-240 972-240

Explanation: The Openx command failed.

Failing Item:

- FFC_972

972-300 972-300

Explanation: The device configuration failed.

Failing Item:

- FFC_972
- SOFTWARE

972-310 972-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_972
- SOFTWARE

972-320 972-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-321 972-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-411 972-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-412 • 972-41D

972-412 972-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-413 972-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-414 972-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-415 972-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-416 972-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-417 972-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-418 972-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-419 972-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-41A 972-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-41B 972-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-41C 972-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-41D 972-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41E **972-41E****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41F **972-41F****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-420 **972-420****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-421 **972-421****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-422 **972-422****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-423 **972-423****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-511 **972-511****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_972
 - FFC_B88
-

972-512 **972-512****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_972
 - FFC_B88
-

972-513 **972-513****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_972
 - FFC_B88
-

972-514 **972-514****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_972
 - FFC_B88
-

972-515 **972-515****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_972
 - FFC_B88
-

972-516 **972-516****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_972
 - FFC_B88
-

972-517 **972-517****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

972-518 • 972-611

- FFC_972
- FFC_B88

972-518 972-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-519 972-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51A 972-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51B 972-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51C 972-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51D 972-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51E 972-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51F 972-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-520 972-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-521 972-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-522 972-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-523 972-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-611 972-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972

- FFC_B88
- SOFTWARE

972-612 972-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-613 972-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-614 972-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-615 972-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-616 972-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-617 972-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-618 972-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-619 972-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61A 972-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61B 972-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61C 972-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61D 972-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-61E 972-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61F 972-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-620 972-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-621 972-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-622 972-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-623 972-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-711 972-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-712 972-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-713 972-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-714 972-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-715 972-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-716 972-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-717 **972-717****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-718 **972-718****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-719 **972-719****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71A **972-71A****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71B **972-71B****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71C **972-71C****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71D **972-71D****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71E **972-71E****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71F **972-71F****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-720 **972-720****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-721 **972-721****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-722 **972-722****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-723 972-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

973-110 973-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_973

973-120 973-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_973

973-130 973-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-131 973-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-135 973-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-136 973-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-140 973-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_973

973-150 973-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-151 973-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-160 973-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-168 **973-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-169 **973-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-16L **973-16L**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-170 **973-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- FFC_B88
- MEDIA

973-171 **973-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973
- FFC_B88

973-180 **973-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-181 **973-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-185 **973-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
 - MEDIA
-

 973-186 973-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-190 973-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_973
-

973-200 973-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
 - MEDIA
-

973-201 973-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-210 973-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
 - MEDIA
-

 973-211 973-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-220 973-220

Explanation: The Release command failed.

Failing Item:

- FFC_973
-

973-230 973-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_973
-

973-240 973-240

Explanation: The Openx command failed.

Failing Item:

- FFC_973
-

973-300 973-300

Explanation: The device configuration failed.

Failing Item:

- FFC_973
 - SOFTWARE
-

973-310 973-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_973
 - SOFTWARE
-

973-320 973-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-321 973-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-411 973-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-412 973-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-413 973-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-414 973-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-415 973-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-416 973-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-417 973-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-418 973-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-419 973-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41A 973-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-41B 973-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41C 973-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41D 973-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41E 973-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41F 973-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-420 973-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-421 973-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-422 973-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-423 973-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-511 973-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-512 973-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-513 973-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-514 **973-514**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-515 **973-515**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-516 **973-516**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-517 **973-517**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-518 **973-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-519 **973-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-51A **973-51A**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-51B **973-51B**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-51C **973-51C**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-51D **973-51D**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-51E **973-51E**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-51F **973-51F**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-520 **973-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-521 973-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-522 973-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-523 973-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-611 973-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-612 973-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-613 973-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-614 973-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-615 973-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-616 973-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-617 973-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-618 973-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-619 973-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61A **973-61A**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61B **973-61B**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61C **973-61C**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61D **973-61D**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61E **973-61E**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61F **973-61F**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-620 **973-620**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-621 **973-621**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-622 **973-622**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-623 **973-623**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-711 **973-711**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-712 **973-712**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-713 • 973-71E

973-713 973-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-714 973-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-715 973-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-716 973-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-717 973-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-718 973-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-719 973-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71A 973-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71B 973-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71C 973-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71D 973-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71E 973-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71F 973-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-720 973-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-721 973-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-722 973-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-723 973-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

974-111 974-111

Explanation: Unable to reserve device.

Failing Item:

- FFC_974
 - FFC_B88
-

974-112 974-112

Explanation: Unable to do configuration.

Failing Item:

- FFC_974
-

- FFC_B88
-

974-113 974-113

Explanation: Unable to open the device driver.

Failing Item:

- FFC_974
 - FFC_B88
-

974-121 974-121

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-122 974-122

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-123 974-123

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-125 974-125

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
 - FFC_B88
-

974-126 974-126

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-127 974-127

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-128 974-128

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-129 974-129

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-150 974-150

Explanation: A media error was detected.

Failing Item:

- TEST_DISC
 - FFC_974
-

974-151 974-151

Explanation: A command timeout was detected.

Failing Item:

- FFC_974
 - FFC_D88
-

974-152 974-152

Explanation: A command reservation conflict was detected.

Failing Item:

- FFC_974
-

974-162 974-162

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-171 974-171

Explanation: Unable to reserve device.

Failing Item:

- FFC_974
-

974-172 974-172

Explanation: Unable to do configuration.

Failing Item:

- FFC_974
-

974-173 974-173

Explanation: Unable to open device driver.

Failing Item:

- FFC_974
-

974-175 974-175

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-198 974-198

Explanation: Undefined error detected.

Failing Item:

- FFC_974
 - FFC_B88
-

974-199 974-199

Explanation: Undefined error detected.

Failing Item:

- FFC_974
-

974-211 974-211

Explanation: The LED test failed.

Failing Item:

- FFC_974
-

974-281 974-281

Explanation: No tone during audio test.

Failing Item:

- FFC_974
-

974-301 974-301

Explanation: Errors found during ELA.

Failing Item:

- FFC_974
-

974-302 974-302

Explanation: Errors log analysis indicates hardware failure.

Failing Item:

- FFC_974
 - FFC_B88
-

980-102 980-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_980
-

980-104 980-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_980
-

980-105 980-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_980
-

980-106 980-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_980
-

980-108 980-108

Explanation: The bus test failed.

Failing Item:

- FFC_980
-

980-110 980-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_980
-

980-112 980-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_980
-

980-114 980-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_980
-

980-116 980-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_980
-

980-117 980-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_980
-

980-118 980-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_980
 - FFC_B88
-

980-120 980-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_980
-

980-122 980-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_980
-

980-124 980-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_980
-

980-126 980-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_980
 - FFC_B88
-

980-128 980-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_980
 - SOFTWARE
-

980-129 **980-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_980
 - SOFTWARE
-

980-130 **980-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_980
-

980-132 **980-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_980
-

980-133 **980-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_980
-

980-134 **980-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

980-135 **980-135**

Explanation: The device failed to configure.

Failing Item:

- FFC_980
 - FFC_B88
 - SOFTWARE
-

980-136 **980-136**

Explanation: The certify operation failed.

Failing Item:

- FFC_980
-

980-137 **980-137**

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_980
 - FFC_B88
 - FFC_190
-

980-138 **980-138**

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_980
-

980-140 **980-140**

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_980
-

980-640 **980-640**

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

981-102 **981-102**

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_981
-

981-104 **981-104**

Explanation: The motor failed to restart.

Failing Item:

- FFC_981
-

981-105 **981-105**

Explanation: The drive did not become ready.

Failing Item:

- FFC_981
-

981-106 981-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_981
-

981-108 981-108

Explanation: The bus test failed.

Failing Item:

- FFC_981
-

981-110 981-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_981
-

981-112 981-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_981
-

981-114 981-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_981
-

981-116 981-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_981
-

981-117 981-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_981
-

981-118 981-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_981
 - FFC_B88
-

981-120 981-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_981
-

981-122 981-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_981
-

981-124 981-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_981
-

981-126 981-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_981
 - FFC_B88
-

981-128 981-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_981
 - SOFTWARE
-

981-129 981-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_981
 - SOFTWARE
-

981-130 981-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_981
-

981-132 981-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_981
-

981-133 981-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_981
-

981-134 981-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

981-135 981-135

Explanation: The device failed to configure.

Failing Item:

- FFC_981
 - FFC_B88
 - SOFTWARE
-

981-136 981-136

Explanation: The certify operation failed.

Failing Item:

- FFC_981
-

981-137 981-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_981
 - FFC_B88
 - FFC_190
-

981-138 981-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_981
-

981-140 981-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_981
-

981-640 981-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

984-102 984-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_984
-

984-104 984-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_984
-

984-105 984-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_984
-

984-106 984-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_984
-

984-108 984-108

Explanation: The bus test failed.

Failing Item:

- FFC_984
-

984-110 984-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_912

984-112 **984-112**

Explanation: The diagnostic test failed.

Failing Item:

- FFC_984
-

984-114 **984-114**

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_984
-

984-116 **984-116**

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_984
-

984-117 **984-117**

Explanation: A write-protect error occurred.

Failing Item:

- FFC_984
-

984-118 **984-118**

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_984
 - FFC_B88
-

984-120 **984-120**

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_984
-

984-122 **984-122**

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_984
-

984-124 **984-124**

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_984
-

984-126 **984-126**

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_984
 - FFC_B88
-

984-128 **984-128**

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_984
 - SOFTWARE
-

984-129 **984-129**

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_984
 - SOFTWARE
-

984-130 **984-130**

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_984
-

984-132 **984-132**

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_984
-

984-133 **984-133**

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_984
-

984-134 **984-134**

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

984-135 • 986-116

- SOFTWARE

984-135 984-135

Explanation: The device failed to configure.

Failing Item:

- FFC_984
- FFC_B88
- SOFTWARE

984-136 984-136

Explanation: The certify operation failed.

Failing Item:

- FFC_984

984-137 984-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_984
- FFC_B88
- FFC_190

984-138 984-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_984

984-140 984-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_984

984-640 984-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

986-102 986-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_986

986-104 986-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_986

986-105 986-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_986

986-106 986-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_986

986-108 986-108

Explanation: The bus test failed.

Failing Item:

- FFC_986

986-110 986-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_986

986-112 986-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_986

986-114 986-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_986

986-116 986-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_986

986-117 986-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_986

986-118 986-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_986
- FFC_B88

986-120 986-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_986

986-122 986-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_986

986-124 986-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_986

986-126 986-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_986
- FFC_B88

986-128 986-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_986
- SOFTWARE

986-129 986-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_986
- SOFTWARE

986-130 986-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_986

986-132 986-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_986

986-133 986-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_986

986-134 986-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

986-135 986-135

Explanation: The device failed to configure.

Failing Item:

- FFC_986
- FFC_B88
- SOFTWARE

986-136 986-136

Explanation: The certify operation failed.

Failing Item:

- FFC_986

 986-137 986-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_986
 - FFC_B88
 - FFC_190
-

986-138 986-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_986
-

986-140 986-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_986
-

986-640 986-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

989-102 989-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_989
-

989-104 989-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_989
-

989-105 989-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_989
-

 989-106 989-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_989
-

989-108 989-108

Explanation: The bus test failed.

Failing Item:

- FFC_989
-

989-110 989-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_989
-

989-112 989-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_989
-

989-114 989-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_989
-

989-116 989-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_989
-

989-117 989-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_989
-

989-118 989-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_989
 - FFC_B88
-

989-120 989-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_989
-

989-122 989-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_989
-

989-124 989-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_989
-

989-126 989-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_989
 - FFC_B88
-

989-128 989-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_989
 - SOFTWARE
-

989-129 989-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_989
 - SOFTWARE
-

989-130 989-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_989

989-132 989-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_989
-

989-133 989-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_989
-

989-134 989-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

989-135 989-135

Explanation: The device failed to configure.

Failing Item:

- FFC_989
 - FFC_B88
 - SOFTWARE
-

989-136 989-136

Explanation: The certify operation failed.

Failing Item:

- FFC_989
-

989-137 989-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_989
 - FFC_B88
 - FFC_190
-

989-138 989-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

989-140 • 991-151

- FFC_989

989-140 989-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_989

989-640 989-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

991-110 991-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_991

991-120 991-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_991

991-130 991-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-131 991-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-135 991-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-136 991-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-140 991-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_991

991-150 991-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-151 991-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-160 **991-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - MEDIA
-

991-168 **991-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
-

991-169 **991-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - MEDIA
-

991-16L **991-16L**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
-

991-170 **991-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - FFC_B88
 - MEDIA
-

991-171 **991-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
 - FFC_B88
-

991-180 **991-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - MEDIA
-

991-181 **991-181**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
-

991-185 **991-185**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

991-186 • 991-320

- FFC_991
- MEDIA

991-186 991-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-190 991-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_991

991-200 991-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-201 991-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-210 991-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-211 991-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-220 991-220

Explanation: The Release command failed.

Failing Item:

- FFC_991

991-230 991-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_991

991-240 991-240

Explanation: The Openx command failed.

Failing Item:

- FFC_991

991-300 991-300

Explanation: The device configuration failed.

Failing Item:

- FFC_991
- SOFTWARE

991-310 991-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_991
- SOFTWARE

991-320 991-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-321 991-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-411 991-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-412 991-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-413 991-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-414 991-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-415 991-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-416 991-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-417 991-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-418 991-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-419 991-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41A 991-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41B 991-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41C 991-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41D 991-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41E 991-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41F 991-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-420 991-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-421 991-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-422 991-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-423 991-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-511 991-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-512 991-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-513 991-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-514 **991-514**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-515 **991-515**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-516 **991-516**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-517 **991-517**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-518 **991-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-519 **991-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-51A **991-51A**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-51B **991-51B**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-51C **991-51C**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-51D **991-51D**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-51E **991-51E**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-51F **991-51F**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-520 **991-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-521 991-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-522 991-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-523 991-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-611 991-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-612 991-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-613 991-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-614 991-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-615 991-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-616 991-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-617 991-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-618 991-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-619 991-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61A **991-61A**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61B **991-61B**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61C **991-61C**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61D **991-61D**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61E **991-61E**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61F **991-61F**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-620 **991-620**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-621 **991-621**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-622 **991-622**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-623 **991-623**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-711 **991-711**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-712 **991-712**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-713 • 991-71E

991-713 991-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-714 991-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-715 991-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-716 991-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-717 991-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-718 991-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-719 991-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-71A 991-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-71B 991-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-71C 991-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-71D 991-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-71E 991-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-71F **991-71F**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-720 **991-720**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-721 **991-721**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-722 **991-722**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-723 **991-723**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

994-110 **994-110**

Explanation: The Reserve command failed.

Failing Item:

- FFC_994
-

994-120 **994-120**

Explanation: The Inquiry command failed.

Failing Item:

- FFC_994

994-130 **994-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
 - MEDIA
-

994-131 **994-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_994
-

994-135 **994-135**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
 - MEDIA
-

994-136 **994-136**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_994
-

994-140 **994-140**

Explanation: The Mode Select command failed.

Failing Item:

- FFC_994

994-150 **994-150**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
 - MEDIA
-

994-151 **994-151**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_994
-

994-160 **994-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
 - MEDIA
-

994-168 **994-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_994
-

994-169 **994-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
 - MEDIA
-

994-16L **994-16L**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_994
-

994-170 **994-170**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
 - FFC_B88
 - MEDIA
-

994-171 **994-171**

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_994
 - FFC_B88
-

994-180 **994-180**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-181 994-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-185 994-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-186 994-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-190 994-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_994

994-200 994-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-201 994-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-210 994-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-211 994-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-220 994-220

Explanation: The Release command failed.

Failing Item:

- FFC_994

994-230 994-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_994
-

994-240 994-240

Explanation: The Openx command failed.

Failing Item:

- FFC_994
-

994-300 994-300

Explanation: The device configuration failed.

Failing Item:

- FFC_994
 - SOFTWARE
-

994-310 994-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_994
 - SOFTWARE
-

994-320 994-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
 - MEDIA
-

994-321 994-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_994
-

994-411 994-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-412 994-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-413 994-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-414 994-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-415 994-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-416 994-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-417 994-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-418 **994-418****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-419 **994-419****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-420 **994-420****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-421 **994-421****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-422 **994-422****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-423 **994-423****Explanation:** A reservation conflict occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-511 **994-511****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_994
 - FFC_B88
-

994-512 **994-512****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_994
 - FFC_B88
-

994-513 **994-513****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_994
 - FFC_B88
-

994-514 **994-514****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_994
 - FFC_B88
-

994-515 **994-515****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_994
 - FFC_B88
-

994-516 **994-516****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

- FFC_994
 - FFC_B88
-

994-517 **994-517****Explanation:** The drive returned bad or non-extended sense data.**Failing Item:**

994-518 • 994-616

- FFC_994
- FFC_B88

994-518 994-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-519 994-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-520 994-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-521 994-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-522 994-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-523 994-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-611 994-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-612 994-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-613 994-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-614 994-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-615 994-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-616 994-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-617 **994-617****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-618 **994-618****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-619 **994-619****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-620 **994-620****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-621 **994-621****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-622 **994-622****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-623 **994-623****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-711 **994-711****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-712 **994-712****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-713 **994-713****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-714 **994-714****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-715 **994-715****Explanation:** A device timeout error occurred.**Failing Item:**

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-716 **994-716**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-717 **994-717**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-718 **994-718**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-719 **994-719**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-720 **994-720**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-721 **994-721**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-722 **994-722**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-723 **994-723**

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

995-110 **995-110**

Explanation: The Reserve command failed.

Failing Item:

- FFC_995

995-120 **995-120**

Explanation: The Inquiry command failed.

Failing Item:

- FFC_995

995-130 **995-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-131 **995-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

 995-135 995-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
 - MEDIA
-

995-136 995-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_995
-

995-140 995-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_995
-

995-150 995-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
 - MEDIA
-

995-151 995-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_995
-

995-160 995-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
 - MEDIA
-

995-168 995-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_995
-

995-169 995-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
 - MEDIA
-

995-16L 995-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_995
-

995-170 995-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- FFC_B88
- MEDIA

995-171 995-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995
- FFC_B88

995-180 995-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-181 995-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-185 995-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-186 995-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-190 995-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_995

995-200 995-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-201 995-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-210 995-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-211 995-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-220 995-220

Explanation: The Release command failed.

Failing Item:

- FFC_995

995-230 995-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_995

995-240 995-240

Explanation: The Openx command failed.

Failing Item:

- FFC_995

995-300 995-300

Explanation: The device configuration failed.

Failing Item:

- FFC_995
- SOFTWARE

995-310 995-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_995
- SOFTWARE

995-320 995-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-321 995-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-411 995-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-412 995-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-413 995-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-414 995-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-415 995-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-416 995-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-417 995-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-418 995-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-419 995-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-420 995-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-421 995-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-422 995-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-423 995-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-511 995-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
- FFC_B88

995-512 995-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
- FFC_B88

995-513 995-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-514 **995-514**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-515 **995-515**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-516 **995-516**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-517 **995-517**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-518 **995-518**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-519 **995-519**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-520 **995-520**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-521 **995-521**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-522 **995-522**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-523 **995-523**

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-611 **995-611**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-612 **995-612**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-613 **995-613**

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-614 995-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-615 995-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-616 995-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-617 995-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-618 995-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-619 995-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-620 995-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-621 995-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-622 995-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-623 995-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-711 995-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-712 995-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-713 995-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-714 995-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-715 995-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-716 995-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-717 995-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-718 995-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-719 995-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-720 995-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-721 995-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-722 995-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-723 995-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

998-110 998-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_998
-

998-120 998-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_998
-

998-130 **998-130**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-131 **998-131**

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-135 **998-135**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-136 **998-136**

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-140 **998-140**

Explanation: The Mode Select command failed.

Failing Item:

- FFC_998

998-150 **998-150**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-151 **998-151**

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-160 **998-160**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-168 **998-168**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-169 **998-169**

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-16L 998-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-170 998-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- FFC_B88
- MEDIA

998-171 998-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998
- FFC_B88

998-180 998-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-181 998-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-185 998-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-186 998-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-190 998-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_998

998-200 998-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

998-201 • 998-411

- FFC_998
- MEDIA

998-201 998-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-210 998-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-211 998-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-220 998-220

Explanation: The Release command failed.

Failing Item:

- FFC_998

998-230 998-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_998

998-240 998-240

Explanation: The Openx command failed.

Failing Item:

- FFC_995

998-300 998-300

Explanation: The device configuration failed.

Failing Item:

- FFC_995
- SOFTWARE

998-310 998-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_995
- SOFTWARE

998-320 998-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-321 998-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-411 998-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-412 998-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-413 998-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-414 998-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-415 998-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-416 998-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-417 998-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-418 998-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-419 998-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-420 998-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-421 998-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-422 998-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-423 998-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-511 998-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-512 998-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-513 998-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-514 998-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-515 998-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-516 998-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-517 998-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-518 998-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-519 998-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-520 998-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-521 998-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-522 998-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-523 998-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
 - FFC_B88
-

998-611 **998-611****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-612 **998-612****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-613 **998-613****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-614 **998-614****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-615 **998-615****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-616 **998-616****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-617 **998-617****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-618 **998-618****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-619 **998-619****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-620 **998-620****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-621 **998-621****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-622 **998-622****Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-623 998-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-711 998-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-712 998-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-713 998-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-714 998-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-715 998-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-716 998-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-717 998-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-718 998-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-719 998-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-720 998-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-721 998-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-722 998-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-723 998-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

9CC-1XX 9CC-1XX

Explanation: I/O Error on PCI bus.

Response: Refer to the Bus SRN to FRU Reference Table in the system unit's service guide. Note: xx represents the last 2 digits of the SRN.

9CC-XXX 9CC-XXX

Explanation: I/O Bus Data, Address Parity Error, or Time-out error.

Response: Note: xxx represents the last 3 digits of the SRN. Use MAP0210 : General problem resolution.

Failing Item:

- XXX
 - FFC_2C9
-

801-XXXX 801-XXXX

Explanation: No LED value could be determined for the missing resource.

Response: Note: To obtain the FRU substitute the last three or four digits of the SRN following the dash (-) for xxxx . (The substituted xxxx is the FRU). Use MAP0210 : General problem resolution.

Failing Item:

- FFC_E10
 - FFC_227
-

802-2592 802-2592

Explanation: The DVD-ROM that was previously installed was not detected.

Failing Item:

- FFC_2592
 - FFC_199
 - FFC_E10
-

- FFC_227
-

802-XXXX 802-XXXX

Explanation: The diagnostics did not detect an installed resource.

Response: Note: To obtain the FRU substitute the last three or four digits of the SRN following the dash (-) for xxxx . (The substituted xxxx is the FRU) . Use MAP0210 : General problem resolution.

Failing Item:

- FFC_E10
 - FFC_227
-

803-XXXX 803-XXXX

Explanation: A software error occurred while running the diagnostics which could be caused by either hardware or software.

Response: Note: This SRN can also occur if the filesystem is full, particularly in the / , /var , or /tmp directories (verify using the df command at the AIX prompt, make sure %Used is 90% or less for each file system). Run standalone diagnostics. If you get a different SRN, use it in place of the original SRN. If you get the same SRN, use the last three or four digits of the 803- xxx(x) as the FRU and use general problem resolution. If you get no error from the standalone diagnostics, you may have a problem with the software, contact your support center. Note: xxxx corresponds to the last three or four digits of the SRN. If your 803- xxx(x) SRN is not listed, substitute the last three or four digits of the SRN after the dash (-) for xxx(x) , then proceed to the FRU list using the substituted digits as your FRU.

832-XXXX 832-XXXX

Explanation: I/O bridge/device internal error

Response: Note: xxxx represents the last 3 or 4 digits of the SRN after the dash (-). Use MAP0210 : General problem resolution.

833-XXXX 833-XXXX

Explanation: PCI device address parity error, PCI device data parity error, or PCI device abort error. The diagnostics screen indicates the actual error.

Response: Note: xxxx represents the last 3 or 4 digits of the SRN after the dash (-). Use MAP0210 : General problem resolution.

Failing Item:

- FFC_296
 - FFC_2C9
-

950-2502 950-2502

Explanation: Missing options resolution for PCI-X266 Planar 3GB SAS Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2502
- FFC_221

950-2503 950-2503

Explanation: Missing options resolution for PCI-X266 Planar 3GB SAS RAID Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2503
- FFC_221

950-2504 950-2504

Explanation: Missing options resolution for PCI Express x1 Auxiliary cache adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2504
- FFC_221

950-2505 950-2505

Explanation: Missing options resolution for PCI-X266 Planar 3 GB SAS RAID adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2505
- FFC_2502

950-2512 950-2512

Explanation: Missing options resolution for PCI-X DDR Quad Channel U320 SCSI RAID

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2512
- FFC_221

950-2513 950-2513

Explanation: Missing options resolution for PCI-X DDR Quad Channel U320 SCSI RAID Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2513
- FFC_221

950-2514 950-2514

Explanation: Missing options resolution for PCI-X DDR Dual Channel U320 SCSI

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2514
- FFC_221

950-2515 950-2515

Explanation: Missing options resolution for PCI-X266 Ext Dual-x4 3 GB SAS adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2515

950-2516 950-2516

Explanation: Missing options resolution for PCI Express x8 Ext Dual-x4 3GB SAS Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2516

950-2517 950-2517

Explanation: Missing options resolution for PCI-X266 Ext Dual-x4 3 GB SAS RAID adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2517
-

950-2518 **950-2518**

Explanation: Missing options resolution for PCI Express x8 Ext Dual-x4 3Gb SAS Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2518
-

950-2519 **950-2519**

Explanation: Missing options resolution for PCI-X266 Ext Tri-x4 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2519
-

950-251D **950-251D**

Explanation: Missing options resolution for PCI-X266 Ext Tri-x4 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_251D
-

950-2522 **950-2522**

Explanation: Missing options resolution for PCI-x Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2522
 - FFC_221
-

950-2523 **950-2523**

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2523
 - FFC_221
-

950-2524 **950-2524**

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2524
-

950-2525 **950-2525**

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2525
 - FFC_2524
-

950-2527 **950-2527**

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2527
 - FFC_221
-

950-2528 **950-2528**

Explanation: Missing options resolution for PCI-X Dual Channel U320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2528
 - FFC_221
-

950-2529 **950-2529**

Explanation: Missing options resolution for PCI-X Dual Channel U320 SCSI RAID Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2529
 - FFC_221
-

950-252B **950-252B**

Explanation: Missing options resolution for PCI-X DDR Dual Channel U320 SCSI

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_252B
 - FFC_221
-

950-252D **950-252D**

Explanation: Missing options resolution for PCI-X DDR Dual Channel U320 SCSI

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_252D
 - FFC_221
-

950-2D0B **950-2D0B**

Explanation: Missing options resolution for PCI-X266 Ext Tri-x4 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2D0B
-

950-2D14 **950-2D14**

Explanation: Missing options resolution for PCI Express x8 Planar 3Gb SAS Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2D14
-

950-2D15 **950-2D15**

Explanation: Missing options resolution for PCI Express x8 Planar 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2D15
-

950-XXXX **950-XXXX**

Explanation: The device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution. Note: xxxx corresponds to the last three or four digits of the SRN after the dash (-). If your 950- xxxx SRN is not listed, substitute the last three or four digits of the SRN for xxxx .

Failing Item:

- FFC_XXXX
 - FFC_B88
 - FFC_190
 - FFC_152
-

A00-FF0 **A00-FF0**

Explanation: Error log analysis is unable to determine the error. The error log indicates the following physical FRU locations as the probable causes.

Response: Use MAP0230 : Platform error problem resolution.

A01-00X **A01-00X**

Explanation: Error log analysis indicates an error detected by the CPU, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A01-01X **A01-01X**

Explanation: CPU internal error.

Response: Use MAP0230 : Platform error problem resolution.

A01-02X **A01-02X**

Explanation: CPU internal cache or cache controller error.

Response: Use MAP0230 : Platform error problem resolution.

A01-03X **A01-03X**

Explanation: External cache parity or multi-bit ECC error.

Response: Use MAP0230 : Platform error problem resolution.

A01-04X **A01-04X**

Explanation: External cache ECC single-bit error.

Response: Use MAP0230 : Platform error problem resolution.

A01-05X **A01-05X**

Explanation: System bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A01-06X **A01-06X**

Explanation: Time-out error waiting for I/O.

Response: Use MAP0230 : Platform error problem resolution.

A01-07X **A01-07X**

Explanation: System bus parity error.

Response: Use MAP0230 : Platform error problem resolution.

A01-08X **A01-08X**

Explanation: System bus protocol/transfer error.

Response: Use MAP0230 : Platform error problem resolution.

A02-00X **A02-00X**

Explanation: Error log analysis indicates an error detected by the memory controller, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A02-01X **A02-01X**

Explanation: Uncorrectable Memory Error.

Response: Use MAP0230 : Platform error problem resolution.

A02-02X **A02-02X**

Explanation: ECC correctable error.

Response: Use MAP0230 : Platform error problem resolution.

A02-03X **A02-03X**

Explanation: Correctable error threshold exceeded.

Response: Use MAP0230 : Platform error problem resolution.

A02-04X **A02-04X**

Explanation: Memory Control subsystem internal error.

Response: Use MAP0230 : Platform error problem resolution.

A02-05X **A02-05X**

Explanation: Memory Address Error (invalid address or access attempt).

Response: Use MAP0230 : Platform error problem resolution.

A02-06X **A02-06X**

Explanation: Memory Data error (Bad data going to memory).

Response: Use MAP0230 : Platform error problem resolution.

A02-07X **A02-07X**

Explanation: Memory bus/switch internal error.

Response: Use MAP0230 : Platform error problem resolution.

A02-08X **A02-08X**

Explanation: Memory time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A02-09X **A02-09X**

Explanation: System bus parity error.

Response: Use MAP0230 : Platform error problem resolution.

A02-10X **A02-10X**

Explanation: System bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A02-11X **A02-11X**

Explanation: System bus protocol/transfer error.

Response: Use MAP0230 : Platform error problem resolution.

A02-12X **A02-12X**

Explanation: I/O Host Bridge time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A02-13X • A03-13X

A02-13X A02-13X

Explanation: I/O Host Bridge address/data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A02-15X A02-15X

Explanation: System support function error.

Response: Use MAP0230 : Platform error problem resolution.

A02-16X A02-16X

Explanation: System bus internal hardware/switch error.

Response: Use MAP0230 : Platform error problem resolution.

A03-00X A03-00X

Explanation: Error log analysis indicates an error detected by the I/O device, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A03-01X A03-01X

Explanation: I/O Bus Address parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-02X A03-02X

Explanation: I/O Bus Data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-03X A03-03X

Explanation: I/O bridge/device time-out, access or other error.

Response: Use MAP0230 : Platform error problem resolution.

A03-04X A03-04X

Explanation: I/O bridge/device internal error.

Response: Use MAP0230 : Platform error problem resolution.

A03-05X A03-05X

Explanation: I/O Error on non-PCI bus.

Response: Use MAP0230 : Platform error problem resolution.

A03-06X A03-06X

Explanation: Mezzanine bus address parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-07X A03-07X

Explanation: System bus address parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-08X A03-08X

Explanation: Mezzanine bus data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-09X A03-09X

Explanation: System bus data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-10X A03-10X

Explanation: Mezzanine bus time-out, transfer or protocol error.

Response: Use MAP0230 : Platform error problem resolution.

A03-11X A03-11X

Explanation: System bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A03-12X A03-12X

Explanation: Error on System bus.

Response: Use MAP0230 : Platform error problem resolution.

A03-13X A03-13X

Explanation: I/O Expansion bus parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-14X A03-14X

Explanation: I/O Expansion bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A03-15X A03-15X

Explanation: I/O Expansion bus connection failure.

Response: Use MAP0230 : Platform error problem resolution.

A03-16X A03-16X

Explanation: I/O Expansion unit not in an operating state.

Response: Use MAP0230 : Platform error problem resolution.

A05-00X A05-00X

Explanation: Error log analysis indicates an environmental and power warning, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A05-01X A05-01X

Explanation: Sensor indicates a fan has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-02X A05-02X

Explanation: System shutdown due to a fan failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-03X A05-03X

Explanation: Sensor indicates a voltage outside normal range.

Response: Use Power problem isolation for your system.

A05-04X A05-04X

Explanation: System shutdown due to voltage outside normal range.

Response: Use Power problem isolation for your system.

A05-05X A05-05X

Explanation: Sensor indicates an abnormally high internal temperature.

Response: Verify that:

1. The room ambient temperature is within the system operating environment.
2. There is unrestricted air flow around the system.
3. All system covers are closed.
4. There are no fan failures.

If none of these problems exist, then proceed with MAP0230 : Platform error problem resolution.

A05-06X A05-06X

Explanation: System shutdown due to abnormally high internal temperature.

Response: Verify that:

1. The room ambient temperature is within the system operating environment.
2. There is unrestricted air flow around the system.
3. All system covers are closed.
4. There are no fan failures.

If none of these problems exist, then proceed with MAP0230 : Platform error problem resolution.

A05-07X A05-07X

Explanation: Sensor indicates a power supply has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-08X A05-08X

Explanation: System shutdown due to power supply failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-09X A05-09X

Explanation: Sensor detected a FRU that has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-10X A05-10X

Explanation: System shutdown due to FRU that has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-14X • A0D-08X

A05-14X A05-14X

Explanation: System shutdown due to power fault with an unspecified cause.

Response: Use MAP0230 : Platform error problem resolution.

A05-16X A05-16X

Explanation: System shutdown due to internal power supply failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-19X A05-19X

Explanation: System shutdown due to Fan failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-21X A05-21X

Explanation: System shutdown due to over temperature condition.

Response: Verify the following:

- The room ambient temperature is within the system operating environment.
- There is unrestricted air flow around the system.
- All system covers are closed.

If all conditions are met, then use MAP0230 : Platform error problem resolution.

A05-22X A05-22X

Explanation: System shutdown due to over temperature and fan failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-24X A05-24X

Explanation: Power fault specifically due to internal battery failure.

Response: Use MAP0230 : Platform error problem resolution.

A0D-00X A0D-00X

Explanation: Error log analysis indicates an error detected by the service processor, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A0D-01X A0D-01X

Explanation: Description: Time-out communication response from service processor.

Response: Use MAP0230 : Platform error problem resolution. Note: Ensure that the system IPLROS and service processor are at the latest firmware level before removing any parts from the system.

A0D-02X A0D-02X

Explanation: I/O (I2C) general bus error.

Response: Use MAP0230 : Platform error problem resolution. Note: If you are servicing a 9076/Nxx system, go to the service processor Error Log (SVP).

A0D-03X A0D-03X

Explanation: Secondary I/O (I2C) general bus error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-04X A0D-04X

Explanation: Internal service processor memory error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-05X A0D-05X

Explanation: Service processor error accessing special registers.

Response: Use MAP0230 : Platform error problem resolution.

A0D-06X A0D-06X

Explanation: Service processor reports unknown communication error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-07X A0D-07X

Explanation: Internal service processor firmware error or incorrect version.

Response: Use MAP0230 : Platform error problem resolution.

A0D-08X A0D-08X

Explanation: Other internal service processor hardware error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-09X A0D-09X

Explanation: Service processor error accessing vital product data EEPROM.

Response: Use MAP0230 : Platform error problem resolution.

A0D-10X A0D-10X

Explanation: Service processor error accessing operator panel.

Response: Use MAP0230 : Platform error problem resolution.

A0D-11X A0D-11X

Explanation: Service processor error accessing power controller.

Response: Use MAP0230 : Platform error problem resolution.

A0D-12X A0D-12X

Explanation: Service processor error accessing fan sensor.

Response: Use MAP0230 : Platform error problem resolution.

A0D-13X A0D-13X

Explanation: Service processor error accessing thermal sensor.

Response: Use MAP0230 : Platform error problem resolution. Note: If you are servicing a 9076/Nxx system, go to the service processor Error Log (SVP).

A0D-14X A0D-14X

Explanation: Service processor error accessing voltage sensor.

Response: Use MAP0230 : Platform error problem resolution. Note: If you are servicing a 9076/Nxx system, go to the service processor Error Log (SVP).

A0D-17X A0D-17X

Explanation: Service processor error accessing serial port.

Response: Use MAP0230 : Platform error problem resolution.

A0D-18X A0D-18X

Explanation: Service processor detected NVRAM error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-19X A0D-19X

Explanation: Service processor error accessing real time clock/time-of-day clock.

Response: Use MAP0230 : Platform error problem resolution.

A0D-20X A0D-20X

Explanation: Service processor error accessing scan controller/hardware.

Response: Use MAP0230 : Platform error problem resolution.

A0D-21X A0D-21X

Explanation: Service processor detected error with time-of-day clock backup battery.

Response: Use MAP0230 : Platform error problem resolution.

A0D-23X A0D-23X

Explanation: Loss of heart beat from service processor.

Response: Use MAP0230 : Platform error problem resolution.

A0D-24X A0D-24X

Explanation: Service processor detected a surveillance time-out.

Response: Use MAP0230 : Platform error problem resolution.

A0D-25X A0D-25X

Explanation: Power control network general connection failure.

Response: Use MAP0230 : Platform error problem resolution.

A0D-26X A0D-26X

Explanation: Power control network node failure.

Response: Use MAP0230 : Platform error problem resolution.

A0D-29X A0D-29X

Explanation: Service processor error accessing power control network.

Response: Use MAP0230 : Platform error problem resolution.

A0D-30X • A11-03X

A0D-30X A0D-30X

Explanation: Non-supported hardware.

Response: Use MAP0230 : Platform error problem resolution.

A0D-31X A0D-31X

Explanation: Error detected while handling an attention/interrupt from the system hardware.

Response: Use MAP0230 : Platform error problem resolution.

A0D-33X A0D-33X

Explanation: Array of Logic Built in Self Test Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-34X A0D-34X

Explanation: Wire Test Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-35X A0D-35X

Explanation: Mainstore or Cache IPL Diagnostic Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-36X A0D-36X

Explanation: Other IPL Diagnostic Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-37X A0D-37X

Explanation: Clock or PLL Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-38X A0D-38X

Explanation: Hardware Scan or Initialization Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-39X A0D-39X

Explanation: Chip ID Verification Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-40X A0D-40X

Explanation: FRU Presence/Detect Error (Mis-Plugged).

Response: Use MAP0230 : Platform error problem resolution.

A10-100 A10-100

Explanation: The resource is unavailable due to an error. System is operating in degraded mode.

Response: Use MAP0230 : Platform error problem resolution.

A10-200 A10-200

Explanation: The resource was marked failed by the platform. The system is operating in degraded mode.

Response: Use MAP0230 : Platform error problem resolution.

A10-210 A10-210

Explanation: The processor has been deconfigured. The system is operating in degraded mode.

Response: Use MAP0230 : Platform error problem resolution.

A11-00X A11-00X

Explanation: A non-critical error has been detected. Error log analysis indicates an error detected by the CPU, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A11-01X A11-01X

Explanation: A non-critical error has been detected, a CPU internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-02X A11-02X

Explanation: A non-critical error has been detected, a CPU internal cache or cache controller error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-03X A11-03X

Explanation: A non-critical error has been detected, an external cache parity or multi-bit ECC error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-04X A11-04X

Explanation: A non-critical error has been detected, an external cache ECC single-bit error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-05X A11-05X

Explanation: A non-critical error has been detected, a system bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-06X A11-06X

Explanation: A non-critical error has been detected, a time-out error waiting for an I/O device.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-07X A11-07X

Explanation: A non-critical error has been detected, a system bus parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-08X A11-08X

Explanation: A non-critical error has been detected, a system bus protocol/transfer error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-50X A11-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A11-510 A11-510

Explanation: Resource has been deconfigured and is no longer in use due to a trend toward an unrecoverable error.

Response: The system is operating in a degraded mode. Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-520 A11-520

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: Try removing the processes from the failing processor and retry the deconfiguration; use the `ha_star -C` command. An alternative is reboot, and the processor will be deconfigured. Then the system can continue in a degraded mode. To repair Use MAP0230 : Platform error problem resolution.

A11-530 A11-530

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error. Run-time processor deconfiguration can be enabled to deconfigure the processor.

Response: To enable run-time processor deconfiguration, use the `chdev -a cpuguard=enable -l sys0` command. Then to retry the deconfiguration, use the `ha_star -C` command. An alternative is reboot, and the processor will be deconfigured. Then the system can continue in a degraded mode. To repair Use MAP0230 : Platform error problem resolution.

A11-540 A11-540

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A11-550 A11-550

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A11-560 • A12-11X

A11-560 A11-560

Explanation: Recoverable errors on a resource indicate a potential for unrecoverable errors. The resource cannot be deconfigured and is still in use. The problem may be corrected by array bit steering.

Response: Use MAP0235: System array self-repair problem resolution.

A11-570 A11-570

Explanation: A processor has been deconfigured due to a trend toward an unrecoverable error. The system is operating in a degraded mode. The problem may be corrected by array bit steering.

Response: Use MAP0235: System array self-repair problem resolution.

A11-580 A11-580

Explanation: Recoverable errors on a processor indicate a potential for an unrecoverable error. The resource cannot be deconfigured and is still in use. The problem may be corrected by array bit steering.

Response: Use MAP0235: System array self-repair problem resolution.

A12-00X A12-00X

Explanation: A non-critical error has been detected. Error log analysis indicates an error detected by the memory controller, but the failure could not be isolated.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-01X A12-01X

Explanation: A non-critical error has been detected, an uncorrectable memory error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-02X A12-02X

Explanation: A non-critical error has been detected, an ECC correctable error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-03X A12-03X

Explanation: A non-critical error has been detected, a correctable error threshold exceeded.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-04X A12-04X

Explanation: A non-critical error has been detected, a memory control subsystem internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-05X A12-05X

Explanation: A non-critical error has been detected, a memory address error (invalid address or access attempt).

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-06X A12-06X

Explanation: A non-critical error has been detected, a memory data error (bad data going to memory).

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-07X A12-07X

Explanation: A non-critical error has been detected, a memory bus/switch internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-08X A12-08X

Explanation: A non-critical error has been detected, a memory time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-09X A12-09X

Explanation: A non-critical error has been detected, a system bus parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-10X A12-10X

Explanation: A non-critical error has been detected, a system bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-11X A12-11X

Explanation: A non-critical error has been detected, a system bus protocol/transfer error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-12X **A12-12X**

Explanation: A non-critical error has been detected, an I/O host bridge time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-13X **A12-13X**

Explanation: A non-critical error has been detected, a I/O host bridge address/data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-15X **A12-15X**

Explanation: A non-critical error has been detected, a system support function error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-16X **A12-16X**

Explanation: A non-critical error has been detected, a system bus internal hardware/switch error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-50X **A12-50X**

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. Use MAP0230 : Platform error problem resolution.

A13-00X **A13-00X**

Explanation: A non-critical error has been detected, a error log analysis indicates an error detected by the I/O device, but the failure could not be isolated.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-01X **A13-01X**

Explanation: A non-critical error has been detected, an I/O bus address parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-02X **A13-02X**

Explanation: A non-critical error has been detected, an I/O bus data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-03X **A13-03X**

Explanation: A non-critical error has been detected, an I/O bus time-out, access or other error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-04X **A13-04X**

Explanation: A non-critical error has been detected, an I/O bridge/device internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-05X **A13-05X**

Explanation: A non-critical error has been detected, an I/O error on non-PCI bus.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-06X **A13-06X**

Explanation: A non-critical error has been detected, a mezzanine bus address parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-07X **A13-07X**

Explanation: A non-critical error has been detected, a system bus address parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-08X **A13-08X**

Explanation: A non-critical error has been detected, a mezzanine bus data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-09X **A13-09X**

Explanation: A non-critical error has been detected, a system bus data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-10X • A15-11X

A13-10X A13-10X

Explanation: A non-critical error has been detected, a mezzanine bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-11X A13-11X

Explanation: A non-critical error has been detected, a system bus time-out error

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-12X A13-12X

Explanation: A non-critical error has been detected, an error on system bus.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-13X A13-13X

Explanation: A non-critical error has been detected, an I/O expansion bus parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-14X A13-14X

Explanation: A non-critical error has been detected, an I/O expansion bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-15X A13-15X

Explanation: A non-critical error has been detected, an I/O expansion bus connection failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-16X A13-16X

Explanation: A non-critical error has been detected, an I/O expansion unit not in an operating state.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-50X A13-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A15-01X A15-01X

Explanation: Sensor indicates a fan is turning too slowly.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-03X A15-03X

Explanation: Description: Sensor indicates a voltage outside normal range.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-05X A15-05X

Explanation: Sensor indicates an abnormally high internal temperature.

Response: Verify that:

1. The room ambient temperature is within the system operating environment.
2. There is unrestricted air flow around the system.
3. All system covers are closed.
4. There are no fan failures.

If none of these problems exist, then proceed with MAP0230 : Platform error problem resolution.

A15-07X A15-07X

Explanation: Sensor indicates a power supply has failed.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-09X A15-09X

Explanation: Sensor indicates a FRU has failed.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-11X A15-11X

Explanation: Sensor detected a redundant fan failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-12X **A15-12X**

Explanation: Sensor detected redundant power supply failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-13X **A15-13X**

Explanation: Sensor detected a redundant FRU that has failed.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-14X **A15-14X**

Explanation: Power fault due to unspecified cause.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-16X **A15-16X**

Explanation: Internal power supply failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-17X **A15-17X**

Explanation: Internal redundant power supply failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-19X **A15-19X**

Explanation: Fan failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-20X **A15-20X**

Explanation: Non-critical cooling problem, loss of redundant fan.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-21X **A15-21X**

Explanation: Over temperature condition.

Response: Verify the following:

- The room ambient temperature is within the system operating environment.
- There is unrestricted air flow around the system.
- All system covers are closed.

If all conditions are met, then use MAP0230 : Platform error problem resolution.

A15-22X **A15-22X**

Explanation: Fan failure and Over temperature condition.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-23X **A15-23X**

Explanation: Non-critical power problem, loss of redundant power supply.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-24X **A15-24X**

Explanation: Power Fault specifically due to internal battery failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-50X **A15-50X**

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A1D-00X **A1D-00X**

Explanation: A non-critical error has been detected. Error log analysis indicates an error detected by the service processor, but the failure could not be isolated.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-01X **A1D-01X**

Explanation: A non-critical error has been detected. Time Out communication response from service processor

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution. Note: Ensure that the system IPLROS and service processor are at the latest firmware level before removing any parts from the system.

A1D-02X • A1D-18X

A1D-02X A1D-02X

Explanation: A non-critical error has been detected, an I/O (I2C) general bus error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-03X A1D-03X

Explanation: A non-critical error has been detected, a secondary I/O (I2C) general bus error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-04X A1D-04X

Explanation: A non-critical error has been detected, an internal service processor memory error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-05X A1D-05X

Explanation: A non-critical error has been detected, a service processor error accessing special registers.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-06X A1D-06X

Explanation: A non-critical error has been detected, a service processor reports unknown communication error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-07X A1D-07X

Explanation: A non-critical error has been detected. Internal service processor firmware error or incorrect version.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-08X A1D-08X

Explanation: A non-critical error has been detected, an other internal service processor hardware error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-09X A1D-09X

Explanation: A non-critical error has been detected, a service processor error accessing vital product data EEPROM.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-10X A1D-10X

Explanation: A non-critical error has been detected, a service processor error accessing operator panel.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-11X A1D-11X

Explanation: A non-critical error has been detected, a service processor error accessing power controller.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-12X A1D-12X

Explanation: A non-critical error has been detected, a service processor error accessing fan sensor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-13X A1D-13X

Explanation: A non-critical error has been detected, a service processor error accessing a thermal sensor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-14X A1D-14X

Explanation: A non-critical error has been detected, a service processor error accessing voltage sensor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-17X A1D-17X

Explanation: A non-critical error has been detected, a service processor error accessing serial port.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-18X A1D-18X

Explanation: A non-critical error has been detected, a service processor detected NVRAM error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-19X A1D-19X

Explanation: A non-critical error has been detected, a service processor error accessing real time clock/time-of-day clock.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-20X A1D-20X

Explanation: A non-critical error has been detected: Service processor error accessing scan controller/hardware.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-21X A1D-21X

Explanation: A non-critical error has been detected, a service processor detected error with time-of-day clock backup battery.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-23X A1D-23X

Explanation: A non-critical error has been detected: Loss of heart beat from service processor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-24X A1D-24X

Explanation: A non-critical error has been detected, a service processor detected a surveillance time-out.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-25X A1D-25X

Explanation: A non-critical error has been detected, a power control network general connection failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-26X A1D-26X

Explanation: A non-critical error has been detected, a power control network node failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-29X A1D-29X

Explanation: A non-critical error has been detected, a service process error accessing power control network.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-30X A1D-30X

Explanation: A non-critical error has been detected: Non-supported hardware.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-31X A1D-31X

Explanation: A non-critical error has been detected: Error detected while handling an attention/interrupt from the system hardware.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-33X A1D-33X

Explanation: A non-critical error has been detected: Array of Logic Built in Self Test Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-34X A1D-34X

Explanation: A non-critical error has been detected: Wire Test Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-35X A1D-35X

Explanation: A non-critical error has been detected: Mainstore or Cache IPL Diagnostic Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-36X A1D-36X

Explanation: A non-critical error has been detected: Other IPL Diagnostic Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-37X A1D-37X

Explanation: A non-critical error has been detected: Clock or PLL Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-38X • D0300

A1D-38X A1D-38X

Explanation: A non-critical error has been detected: Hardware Scan or Initialization Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-39X A1D-39X

Explanation: A non-critical error has been detected: Chip ID Verification Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-40X A1D-40X

Explanation: A non-critical error has been detected: Presence/Detect Error (Mis-Plugged).

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-50X A1D-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A23-001 A23-001

Explanation: Multipath I/O Problem Resolution.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

A24-000 A24-000

Explanation: Spurious interrupts on shared interrupt level have exceeded threshold.

Response: Use the part numbers reported by diagnostics and use MAP0210 : General problem resolution.

Failing Item:

- USE_DIAGNOSTIC_PART_NUMBER
- FFC_227

A24-XXX A24-XXX

Explanation: Spurious interrupts have exceeded threshold.

Failing Item:

- XXX
- FFC_227

A25-001 A25-001

Explanation: Platform error, switch network interface extended error data is available.

Response: Refer to the management console. Use the system reference codes in the serviceable event view for this partition.

A22-XXXX A22-XXXX

Explanation: Defective Multipath I/O Device.

Response: Note: To obtain the FFC, substitute the last 3 or 4 digits after the dash (-) for xxxx (The substituted xxxx is the FFC).

D0000 D0000

Explanation: The using system cannot configure the disk drive module.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0100 D0100

Explanation: Unable to clear a disk drive module reservation.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0101 D0101

Explanation: The disk drive module has been reserved since the diagnostics started.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0200 D0200

Explanation: The disk drive module timed out while the diagnostics were running.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0300 D0300

Explanation: The disk drive module failed the diagnostic test.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0400 **D0400**

Explanation: The disk drive module is Not Ready while the diagnostics are running.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0450 **D0450**

Explanation: The Format operation that was started on this disk drive module has not finished.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0460 **D0460**

Explanation: A Format operation was degraded.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D4000 **D4000**

Explanation: The diagnostics cannot configure the SSA adapter.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

D4100 **D4100**

Explanation: The diagnostics cannot open the SSA adapter.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

D4300 **D4300**

Explanation: The diagnostics have detected an SSA adapter POST failure.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

D44XX **D44XX**

Explanation: The diagnostics detected that the SSA adapter has corrupted microcode, but cannot download a new version of the microcode.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note: In this SRN, an x represents a digit 0 through F.

D6PAA **D6PAA**

Explanation: A high-speed SSA link is running at low speed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

DFFFF **DFFFF**

Explanation: A command or parameter that was sent or received is not valid.

Response: Note: The description and action for this SRN are valid only if you ran the diagnostics on the SSA attachment. Refer to the SRN table in the Service Guide for the unit containing the disk drive and to the User's Guide and Maintenance Information for the SSA adapter.

Notices

This information was developed for products and services offered in the U.S.A.

The manufacturer may not offer the products, services, or features discussed in this document in other countries. Consult the manufacturer's representative for information on the products and services currently available in your area. Any reference to the manufacturer's product, program, or service is not intended to state or imply that only that product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any intellectual property right of the manufacturer may be used instead. However, it is the user's responsibility to evaluate and verify the operation of any product, program, or service.

The manufacturer may have patents or pending patent applications covering subject matter described in this document. The furnishing of this document does not grant you any license to these patents. You can send license inquiries, in writing, to the manufacturer.

The following paragraph does not apply to the United Kingdom or any other country where such provisions are inconsistent with local law: THIS INFORMATION IS PROVIDED "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This information could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. The manufacturer may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time without notice.

Any references in this information to websites not owned by the manufacturer are provided for convenience only and do not in any manner serve as an endorsement of those websites. The materials at those websites are not part of the materials for this product and use of those websites is at your own risk.

The manufacturer may use or distribute any of the information you supply in any way it believes appropriate without incurring any obligation to you.

Any performance data contained herein was determined in a controlled environment. Therefore, the results obtained in other operating environments may vary significantly. Some measurements may have been made on development-level systems and there is no guarantee that these measurements will be the same on generally available systems. Furthermore, some measurements may have been estimated through extrapolation. Actual results may vary. Users of this document should verify the applicable data for their specific environment.

Information concerning products not produced by this manufacturer was obtained from the suppliers of those products, their published announcements or other publicly available sources. This manufacturer has not tested those products and cannot confirm the accuracy of performance, compatibility or any other claims related to products not produced by this manufacturer. Questions on the capabilities of products not produced by this manufacturer should be addressed to the suppliers of those products.

All statements regarding the manufacturer's future direction or intent are subject to change or withdrawal without notice, and represent goals and objectives only.

The manufacturer's prices shown are the manufacturer's suggested retail prices, are current and are subject to change without notice. Dealer prices may vary.

This information is for planning purposes only. The information herein is subject to change before the products described become available.

This information contains examples of data and reports used in daily business operations. To illustrate them as completely as possible, the examples include the names of individuals, companies, brands, and products. All of these names are fictitious and any similarity to the names and addresses used by an actual business enterprise is entirely coincidental.

If you are viewing this information in softcopy, the photographs and color illustrations may not appear.

The drawings and specifications contained herein shall not be reproduced in whole or in part without the written permission of the manufacturer.

The manufacturer has prepared this information for use with the specific machines indicated. The manufacturer makes no representations that it is suitable for any other purpose.

The manufacturer's computer systems contain mechanisms designed to reduce the possibility of undetected data corruption or loss. This risk, however, cannot be eliminated. Users who experience unplanned outages, system failures, power fluctuations or outages, or component failures must verify the accuracy of operations performed and data saved or transmitted by the system at or near the time of the outage or failure. In addition, users must establish procedures to ensure that there is independent data verification before relying on such data in sensitive or critical operations. Users should periodically check the manufacturer's support websites for updated information and fixes applicable to the system and related software.

Ethernet connection usage restriction

This product is not intended to be connected directly or indirectly by any means whatsoever to interfaces of public telecommunications networks.

Trademarks

IBM, the IBM logo, and ibm.com are trademarks or registered trademarks of International Business Machines Corp., registered in many jurisdictions worldwide. Other product and service names might be trademarks of IBM or other companies. A current list of IBM trademarks is available on the Web at Copyright and trademark information at www.ibm.com/legal/copytrade.shtml.

INFINIBAND, InfiniBand Trade Association, and the INFINIBAND design marks are trademarks and/or service marks of the INFINIBAND Trade Association.

Linux is a registered trademark of Linus Torvalds in the United States, other countries, or both.

Java and all Java-based trademarks and logos are trademarks or registered trademarks of Oracle and/or its affiliates.

UNIX is a registered trademark of The Open Group in the United States and other countries.

Other product and service names might be trademarks of IBM or other companies.

Electronic emission notices

When attaching a monitor to the equipment, you must use the designated monitor cable and any interference suppression devices supplied with the monitor.

Class A Notices

The following Class A statements apply to the IBM servers that contain the POWER7[®] processor and its features unless designated as electromagnetic compatibility (EMC) Class B in the feature information.

Federal Communications Commission (FCC) statement

Note: This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference, in which case the user will be required to correct the interference at his own expense.

Properly shielded and grounded cables and connectors must be used in order to meet FCC emission limits. IBM is not responsible for any radio or television interference caused by using other than recommended cables and connectors or by unauthorized changes or modifications to this equipment. Unauthorized changes or modifications could void the user's authority to operate the equipment.

This device complies with Part 15 of the FCC rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Industry Canada Compliance Statement

This Class A digital apparatus complies with Canadian ICES-003.

Avis de conformité à la réglementation d'Industrie Canada

Cet appareil numérique de la classe A est conforme à la norme NMB-003 du Canada.

European Community Compliance Statement

This product is in conformity with the protection requirements of EU Council Directive 2004/108/EC on the approximation of the laws of the Member States relating to electromagnetic compatibility. IBM cannot accept responsibility for any failure to satisfy the protection requirements resulting from a non-recommended modification of the product, including the fitting of non-IBM option cards.

This product has been tested and found to comply with the limits for Class A Information Technology Equipment according to European Standard EN 55022. The limits for Class A equipment were derived for commercial and industrial environments to provide reasonable protection against interference with licensed communication equipment.

European Community contact:
IBM Deutschland GmbH
Technical Regulations, Department M456
IBM-Allee 1, 71139 Ehningen, Germany
Tele: +49 7032 15-2937
email: tjahn@de.ibm.com

Warning: This is a Class A product. In a domestic environment, this product may cause radio interference, in which case the user may be required to take adequate measures.

VCCI Statement - Japan

この装置は、クラスA 情報技術装置です。この装置を家庭環境で使用すると電波妨害を引き起こすことがあります。この場合には使用者が適切な対策を講ずるよう要求されることがあります。

VCCI-A

The following is a summary of the VCCI Japanese statement in the box above:

This is a Class A product based on the standard of the VCCI Council. If this equipment is used in a domestic environment, radio interference may occur, in which case, the user may be required to take corrective actions.

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline (products less than or equal to 20 A per phase)

高調波ガイドライン適合品

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline with Modifications (products greater than 20 A per phase)

高調波ガイドライン準用品

Electromagnetic Interference (EMI) Statement - People's Republic of China

声 明

此为 A 级产品, 在生活环境中, 该产品可能会造成无线电干扰。在这种情况下, 可能需要用户对其干扰采取切实可行的措施。

Declaration: This is a Class A product. In a domestic environment this product may cause radio interference in which case the user may need to perform practical action.

Electromagnetic Interference (EMI) Statement - Taiwan

警告使用者：
這是甲類的資訊產品，在居住的環境中使用時，可能會造成射頻干擾，在這種情況下，使用者會被要求採取某些適當的對策。

The following is a summary of the EMI Taiwan statement above.

Warning: This is a Class A product. In a domestic environment this product may cause radio interference in which case the user will be required to take adequate measures.

IBM Taiwan Contact Information:

台灣IBM 產品服務聯絡方式：
台灣國際商業機器股份有限公司
台北市松仁路7號3樓
電話：0800-016-888

Electromagnetic Interference (EMI) Statement - Korea

이 기기는 업무용(A급)으로 전자파적합기기로서 판매자 또는 사용자는 이 점을 주의하시기 바라며, 가정외의 지역에서 사용하는 것을 목적으로 합니다.

Germany Compliance Statement

Deutschsprachiger EU Hinweis: Hinweis für Geräte der Klasse A EU-Richtlinie zur Elektromagnetischen Verträglichkeit

Dieses Produkt entspricht den Schutzanforderungen der EU-Richtlinie 2004/108/EG zur Angleichung der Rechtsvorschriften über die elektromagnetische Verträglichkeit in den EU-Mitgliedsstaaten und hält die Grenzwerte der EN 55022 Klasse A ein.

Um dieses sicherzustellen, sind die Geräte wie in den Handbüchern beschrieben zu installieren und zu betreiben. Des Weiteren dürfen auch nur von der IBM empfohlene Kabel angeschlossen werden. IBM übernimmt keine Verantwortung für die Einhaltung der Schutzanforderungen, wenn das Produkt ohne Zustimmung von IBM verändert bzw. wenn Erweiterungskomponenten von Fremdherstellern ohne Empfehlung von IBM gesteckt/eingebaut werden.

EN 55022 Klasse A Geräte müssen mit folgendem Warnhinweis versehen werden:
"Warnung: Dieses ist eine Einrichtung der Klasse A. Diese Einrichtung kann im Wohnbereich Funk-Störungen verursachen; in diesem Fall kann vom Betreiber verlangt werden, angemessene Maßnahmen zu ergreifen und dafür aufzukommen."

Deutschland: Einhaltung des Gesetzes über die elektromagnetische Verträglichkeit von Geräten

Dieses Produkt entspricht dem "Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG)". Dies ist die Umsetzung der EU-Richtlinie 2004/108/EG in der Bundesrepublik Deutschland.

Zulassungsbescheinigung laut dem Deutschen Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG) (bzw. der EMC EG Richtlinie 2004/108/EG) für Geräte der Klasse A

Dieses Gerät ist berechtigt, in Übereinstimmung mit dem Deutschen EMVG das EG-Konformitätszeichen - CE - zu führen.

Verantwortlich für die Einhaltung der EMV Vorschriften ist der Hersteller:
International Business Machines Corp.
New Orchard Road
Armonk, New York 10504
Tel: 914-499-1900

Der verantwortliche Ansprechpartner des Herstellers in der EU ist:
IBM Deutschland GmbH
Technical Regulations, Abteilung M456
IBM-Allee 1, 71139 Ehningen, Germany
Tel: +49 7032 15-2937
email: tjahn@de.ibm.com

Generelle Informationen:

Das Gerät erfüllt die Schutzanforderungen nach EN 55024 und EN 55022 Klasse A.

Electromagnetic Interference (EMI) Statement - Russia

ВНИМАНИЕ! Настоящее изделие относится к классу А.
В жилых помещениях оно может создавать радиопомехи, для снижения которых необходимы дополнительные меры

Class B Notices

The following Class B statements apply to features designated as electromagnetic compatibility (EMC) Class B in the feature installation information.

Federal Communications Commission (FCC) statement

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation.

This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation.

If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult an IBM-authorized dealer or service representative for help.

Properly shielded and grounded cables and connectors must be used in order to meet FCC emission limits. Proper cables and connectors are available from IBM-authorized dealers. IBM is not responsible for any radio or television interference caused by unauthorized changes or modifications to this equipment. Unauthorized changes or modifications could void the user's authority to operate this equipment.

This device complies with Part 15 of the FCC rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Industry Canada Compliance Statement

This Class B digital apparatus complies with Canadian ICES-003.

Avis de conformité à la réglementation d'Industrie Canada

Cet appareil numérique de la classe B est conforme à la norme NMB-003 du Canada.

European Community Compliance Statement

This product is in conformity with the protection requirements of EU Council Directive 2004/108/EC on the approximation of the laws of the Member States relating to electromagnetic compatibility. IBM cannot accept responsibility for any failure to satisfy the protection requirements resulting from a non-recommended modification of the product, including the fitting of non-IBM option cards.

This product has been tested and found to comply with the limits for Class B Information Technology Equipment according to European Standard EN 55022. The limits for Class B equipment were derived for typical residential environments to provide reasonable protection against interference with licensed communication equipment.

European Community contact:
IBM Deutschland GmbH
Technical Regulations, Department M456
IBM-Allee 1, 71139 Ehningen, Germany
Tele: +49 7032 15-2937
email: tjahn@de.ibm.com

VCCI Statement - Japan

この装置は、クラスB情報技術装置です。この装置は、家庭環境で使用することを目的としていますが、この装置がラジオやテレビジョン受信機に近接して使用されると、受信障害を引き起こすことがあります。

取扱説明書に従って正しい取り扱いをして下さい。 VCCI-B

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline (products less than or equal to 20 A per phase)

高調波ガイドライン適合品

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline with Modifications (products greater than 20 A per phase)

高調波ガイドライン準用品

IBM Taiwan Contact Information

台灣IBM 產品服務聯絡方式：
台灣國際商業機器股份有限公司
台北市松仁路7號3樓
電話：0800-016-888

Electromagnetic Interference (EMI) Statement - Korea

이 기기는 가정용(B급)으로 전자파적합기기로서 주로 가정에서 사용하는 것을 목적으로 하며, 모든 지역에서 사용할 수 있습니다.

Germany Compliance Statement

Deutschsprachiger EU Hinweis: Hinweis für Geräte der Klasse B EU-Richtlinie zur Elektromagnetischen Verträglichkeit

Dieses Produkt entspricht den Schutzanforderungen der EU-Richtlinie 2004/108/EG zur Angleichung der Rechtsvorschriften über die elektromagnetische Verträglichkeit in den EU-Mitgliedsstaaten und hält die Grenzwerte der EN 55022 Klasse B ein.

Um dieses sicherzustellen, sind die Geräte wie in den Handbüchern beschrieben zu installieren und zu betreiben. Des Weiteren dürfen auch nur von der IBM empfohlene Kabel angeschlossen werden. IBM übernimmt keine Verantwortung für die Einhaltung der Schutzanforderungen, wenn das Produkt ohne Zustimmung von IBM verändert bzw. wenn Erweiterungskomponenten von Fremdherstellern ohne Empfehlung von IBM gesteckt/eingebaut werden.

Deutschland: Einhaltung des Gesetzes über die elektromagnetische Verträglichkeit von Geräten

Dieses Produkt entspricht dem "Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG)". Dies ist die Umsetzung der EU-Richtlinie 2004/108/EG in der Bundesrepublik Deutschland.

Zulassungsbescheinigung laut dem Deutschen Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG) (bzw. der EMC EG Richtlinie 2004/108/EG) für Geräte der Klasse B

Dieses Gerät ist berechtigt, in Übereinstimmung mit dem Deutschen EMVG das EG-Konformitätszeichen - CE - zu führen.

Verantwortlich für die Einhaltung der EMV Vorschriften ist der Hersteller:
International Business Machines Corp.
New Orchard Road
Armonk, New York 10504
Tel: 914-499-1900

Der verantwortliche Ansprechpartner des Herstellers in der EU ist:
IBM Deutschland GmbH
Technical Regulations, Abteilung M456
IBM-Allee 1, 71139 Ehningen, Germany
Tel: +49 7032 15-2937
email: tjahn@de.ibm.com

Generelle Informationen:

Das Gerät erfüllt die Schutzanforderungen nach EN 55024 und EN 55022 Klasse B.

Terms and conditions

Permissions for the use of these publications is granted subject to the following terms and conditions.

Personal Use: You may reproduce these publications for your personal, noncommercial use provided that all proprietary notices are preserved. You may not distribute, display or make derivative works of these publications, or any portion thereof, without the express consent of the manufacturer.

Commercial Use: You may reproduce, distribute and display these publications solely within your enterprise provided that all proprietary notices are preserved. You may not make derivative works of these publications, or reproduce, distribute or display these publications or any portion thereof outside your enterprise, without the express consent of the manufacturer.

Except as expressly granted in this permission, no other permissions, licenses or rights are granted, either express or implied, to the publications or any information, data, software or other intellectual property contained therein.

Service Request Numbers

ESCALA Power7



REFERENCE
86 A1 46FF 03

ESCALA Power7

Service Request Numbers

The ESCALA Power7 publications concern the following models:

- Bull Escala E5-700 (Power 750 / 8233-E8B)
- Bull Escala M6-700 (Power 770 / 9117-MMB)
- Bull Escala M6-705 (Power 770 / 9117-MMC)
- Bull Escala M7-700 (Power 780 / 9179-MHB)
- Bull Escala M7-705 (Power 780 / 9179-MHC)
- Bull Escala E1-700 (Power 710 / 8231-E2B)
- Bull Escala E1-705 (Power 710 / 8231-E1C)
- Bull Escala E2-700 / E2-700T (Power 720 / 8202-E4B)
- Bull Escala E2-705 / E2-705T (Power 720 / 8202-E4C)
- Bull Escala E3-700 (Power 730 / 8231-E2B)
- Bull Escala E3-705 (Power 730 / 8231-E2C)
- Bull Escala E4-700 / E4-700T (Power 740 / 8205-E6B)
- Bull Escala E4-705 (Power 740 / 8205-E6C)

References to Power 755 / 8236-E8C models are irrelevant.

Hardware

October 2011

BULL CEDOC
357 AVENUE PATTON
B.P.20845
49008 ANGERS CEDEX 01
FRANCE

REFERENCE
86 A1 46FF 03

The following copyright notice protects this book under Copyright laws which prohibit such actions as, but not limited to, copying, distributing, modifying, and making derivative works.

Copyright © Bull SAS 2011

Printed in France

Suggestions and criticisms concerning the form, content, and presentation of this book are invited. A form is provided at the end of this book for this purpose.

To order additional copies of this book or other Bull Technical Publications, you are invited to use the Ordering Form also provided at the end of this book.

Trademarks and Acknowledgements

We acknowledge the right of proprietors of trademarks mentioned in this book.

The information in this document is subject to change without notice. Bull will not be liable for errors contained herein, or for incidental or consequential damages in connection with the use of this material.

The manufacturer reserves the right to withdraw the permissions granted herein whenever, in its discretion, the use of the publications is detrimental to its interest or, as determined by the manufacturer, the above instructions are not being properly followed.

You may not download, export or re-export this information except in full compliance with all applicable laws and regulations, including all United States export laws and regulations.

THE MANUFACTURER MAKES NO GUARANTEE ABOUT THE CONTENT OF THESE PUBLICATIONS. THESE PUBLICATIONS ARE PROVIDED "AS-IS" AND WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO IMPLIED WARRANTIES OF MERCHANTABILITY, NON-INFRINGEMENT, AND FITNESS FOR A PARTICULAR PURPOSE.